

PRIMARY CORNER DESCRIPTION 1/4 Cor. for Secs. 19 and 20

Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_

GLO survey by John A. McQuinn, Deputy Surveyor, under Contract #466, dated April 5, 1883 (DCSO records Vol. 6 Page(s) 2446)

-----  
Set Yew post 3 ft. long, 3" sq., 24" in the ground for ¼ sec. cor., mkd. ¼ S on W. face, from which  
A Fir 20" dia., bears N.6°E., 33 lks. dist. mkd. ¼ S BT.  
A Fir 10" dia., bears N.39°W., 90 lks. dist. mkd. ¼ S BT

BLM resurvey by Otis Gould, Joseph Gawron, and Orville Eggen, Cadastral Surveyors, under Group #244, surveyed June 1943/October 1957 (DCSO records Vol. 30 Page(s) 12707)

-----  
Point for the ¼ sec. cor., at proportionate distance; there is no remaining evidence of the original corner.  
Set an iron post, 30" long, 2" dia., 20" in the ground, and in a mound of stone, 3 ft. base, to top, with brass cap mkd: with brass cap mkd:  
T23SR6W  
¼  
S19 | S20  
1957  
from which  
A Fir 26" dia., bears S.46½°E., 30 lks. dist. mkd. ¼ S20 BT.  
A Hemlock 8" dia., bears N.36°W., 16 lks. dist. mkd. ¼ S19 BT.

Douglas Co. Surveyors Office - Milo E. Godfrey and crew - May 17, 1963 - C.S. File 52/102-29

-----  
Found - GLO brass cap at corner.  
The 26" Fir S.46½°E., 19.8 ft. is uprooted and down, underneath several other down trees.  
The 8" Hemlock N.36°W., 10.6 ft., scribing visible, is leaning badly and will probably be destroyed when down timber is cleared out of the area.  
New BTs -10" Hemlock N.9°W., 57.8 ft. mkd. ¼ S19 CS BT.  
18" D.Fir N.42°E., 41.2 ft. mkd. ¼ S20 CS BT.

BLM resurvey by Floyd A. Brooks, Cadastral Surveyor, under Group #244, Surveyed April/May 1964 (DCSO records Vol. 32 Page(s) 13505-06) (Report of this corner was also submitted by BLM and is filed in C.S. File 52/102-30)

-----  
Point for the ¼ sec. cor., at proportionate distance; there is no remaining evidence of the original corner.  
(Cont. Next Page)

PRIMARY CORNER DESCRIPTION 1/4 Cor. for Secs. 19 and 20

Alias \_\_\_\_\_ Description \_\_\_\_\_  
 Alias \_\_\_\_\_ Description \_\_\_\_\_  
 Alias \_\_\_\_\_ Description \_\_\_\_\_  
 Alias \_\_\_\_\_ Description \_\_\_\_\_

From this point, the ¼ sec. cor. of secs. 19 and 20, erroneously reestablished by Eggen in 1957, bears N.8°10'E., 0.44 chs. dist., set and marked as described in the official record. Both 1957 BTs are down. I remove the iron post, destroy the marks on the bearing trees, and at the corner point

Reset the iron post, 28" long, 2½" dia., 24" in the ground, with brass cap mkd: T 23 S R 6 W

¼  
 S 19 | S 20  
 1957

from which a new bearing tree

A Fir 24" dia., bears N.85°E., 54 lks. dist., mkd. ¼ S20 BT.

and bearing trees previously mkd. by the County

A Fir 17" dia., bears N.30°E., 103 lks. dist., mkd. ¼ S20 CS BT.

A Hemlock 11" dia., bears N.2°W., 132 lks. dist., mkd. ¼ S19 CS BT.

Cor. Fd. and used in BLM resurvey by Jelley, Rogers and Bishop under Contract #1098, surveyed June 1982/Nov. 1983 (DCSO records, Vol. 46 Page 17735)

BLM Corrective Dependent Resurvey by Wayne L. Rogers; Boyd W. Peterson; Philip G. Griffin; Dale T. Bedell; Cadastral Surveyors; and Robert H. Browning, Surveying Technician - under Group #'s 1266, 1637 and 1688, - surveyed June 9, 1986/Aug. 22, 1995 - (DCSO records Vol. 51 Page(s) 19506)

Point for the ¼ sec. cor. at proportionate distance. There is no remaining evidence of the original corner.

Set a stainless steel post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T23S R6W

¼  
 S19 | S20  
 1994

from which remains of the bearing trees mkd. by Milo E. Godfrey, Deputy County Surveyor, in 1963,

A fir stump, 18 ins. diam., bears N. 22½° E., 103 lks. dist., with scribe marks ¼ S20 CS BT visible on open, double blaze.

A hemlock, 19 ins. diam., bears N. 6° W., 136 lks. dist., with healed double blaze.

and a new bearing tree

A fir, 11 ins. diam., bears S. 60° E., 47 lks. dist., mkd. ¼ S20 BT. (Cont. Next Page)

PRIMARY CORNER DESCRIPTION 1/4 Cor. for Secs. 19 and 20

Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_

Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.

From this point, the ¼ sec. cor. of secs. 19 and 20, erroneously corrected by Brooks in 1964, bears N. 55° 00' 30" W., 0.097 chs. dist.; monumented with an iron post, 2½ ins. diam., firmly set, projecting 4 ins. above the ground, with brass cap marked and witnessed as described in the official record except the NE. bearing tree marked by the County Surveyor's Office is a stump and Brooks' bearing tree is dead. Amended the marks on the brass cap to read AM 1994 1957 and reset the monument inverted, and obliterated the marks on Brooks' bearing tree.

Ronald L. Rice, Ward NW - April 29, 2009 - C.S. File 65/66-19  
-----

Found - 3¼" BLM brass cap dated 1994 with the following accessories:

21" Hemlock bears N.6°W., 89.8' - healed face

18" D.Fir bears S.60°E., 31.0' - healed face

New BTs- 13" D. Fir bears S.86°W., 42.9' - blazed, scribed "¼ S19 BT"

11" twin Alder bears N.44°E., 15.2' - scribed "¼ S20 BT"

Note - Corner has steel post adjacent to it. All BTs have red painted bands & BT tags.

Comp. dec. 17°East.