

TOWNSHIP 29 RANGE 02 POINT IDENTIFIER # 200440

PRIMARY CORNER DESCRIPTION 1/4 Cor. for Secs. 17 and 18

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

GLO resurvey by Elmer F. Strickler, U.S. Transitman, under Special Instructions dated Jan. 22, 1917 - (DCSO records Vol. 15 Page(s) 6289)

Set an iron post, 3 ft. long, 1 in. dia., 26 ins. in the ground, for 1/4 sec. cor., with brass cap marked

1/4
S18 | S17
1917

from which

A Fir 12" dia., bears N.81°E., 10 lks. dist. mkd. 1/4 S17 BT
A Fir 15" dia., bears N.51°30'W., 21 lks. dist. mkd. 1/4 S18 BT.

Cor. referenced out by J. Powell, DCSO, May 30, 1973 for road construction.

Douglas Co. Surveyors Office - Gary L. Langlitz; P. Earle - Jan. 15, 1974 - C.S. File 56/43-3

Found - 1917 GLO brass cap with iron pipe.
16" rotten D.Fir stob, bears N.82°E., 6.2 ft. scribing "1/4 S17 BT" visible. (Rec. N.81°E., 6.6 ft.)

Downed and shattered D.Fir, bears approx. N.39°W., tagged and scibing "1/4 S18 BT" visible. (Rec. N.51°30'W., 13.9 ft.)

New BTs- 30" D.Fir bears N.53°E., 22.3 ft. scribed 1/4 S17 CS BT.

30" D.Fir bears N.24°W., 29.6 ft. scribed 1/4 S18 CS BT.

Record NW. BT is out of position due to being knocked down by blowdown. Brass cap is presently located underneath large blown down tree.

Douglas Co. Surveyors Office - Gary L. Langlitz; P. Earle - April 29, 1975 - C.S. File 57/21-14

Found - Brass cap out of ground and moved approx. 30 ft. downhill from its proper position by logging operations.

The remains of both original BTs have also been destroyed.

The two additional BTs marked as noted in 1974 are now both stumps. They are in the positions as noted. However, only the scribing "CS BT" remains on the NW. tree. The full scribe is visible on the NE. BT. (Cont. Next Page)

TOWNSHIP 29 RANGE 02 POINT IDENTIFIER # 200440

PRIMARY CORNER DESCRIPTION 1/4 Cor. for Secs. 17 and 18

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

At the corner point. We RESET the original monument a 1" Iron pipe with brass cap attached and marked properly, to which WE ADD the markings "CS 1975". We also place a steel fence post with survey marker sign attached near the corner.