

TOWNSHIP 29 RANGE 08 POINT IDENTIFIER # 050020

PRIMARY CORNER DESCRIPTION NW Cor. E. I. Higginson DLC #50

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

DLC Survey by J.A. Burnett, under Contract #75 dated Nov. 22, 1856 DLC Volume, Page 590

Set post from which
A Fir 10" dia., bears S.65°E., 27 lks.

Floyd C. Frear; Paulin; Garrett; Skelton; McWhopter - Oct. 1, 1954 - C.S. File 46/56

Set a 1½" x 48" Galv. I.Pipe from old BT stump, Fir bearing S.65°E., 27 lks., scribing visible but rotten.
Blazed and scribed new BT:
18" Yewwood tree, bearing S.60°30'W., 80.71 ft.

Douglas Co. Surveyors Office - James Byron, Deputy - Milo Godfrey; S. Bilow, crew - Sept. 1958 - C.S. File 49/100-12

Found - Pipe at corner and BT as recorded by Frear, 1954.
The BT may be washed out by stream.
I tie corner to bridge piling, corner bears N.19°W., 6.0 ft. from piling.

Douglas Co. Surveyors Office - Randall Smith, Stephen Flause, & John Pike - Oct. 21, 1997 - C.S. 64/78-23

Found - From 1954 renewal a 1½" O.D. iron pipe firmly set, protruding approx 18" above ground and leaning southwesterly approx. 1½'. After checking bearing objects to plumb position of iron pipe, position is referenced, pipe is removed from ground and found to measure 44" long (rec. 1½" x 48" galvanized iron pipe) Monument is on north stream bank and under a bridge deck.
BTs - No evidence of the original bearing tree is found.
From 1954 renewal
18" Yewwood now a dead and severely leaning 17" D.B.H. yew, with a partially healed blaze, no scribing visible the root crown of which bears S.58¾°W., 80.7' dist. (record S.60°W., 80.71').
From 1958 renewal sawed-off 12" dia. bridge piling protruding approximately 2½' above ground, bears S.19°E., 6' dist. (as per rec.). The bearing for this reference is measured under the bridge deck and may have a localized magnetic deflection, the distance is a face measurement to the bridge piling.

continued next page

TOWNSHIP 29 RANGE 08 POINT IDENTIFIER # 050020

PRIMARY CORNER DESCRIPTION NW Cor. E. I. Higginson DLC #50

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

Set- Found iron pipe monument is reset plumb at referenced position and now protrudes approximately 6" above ground.

New Accessories -

Corners at the top of the north and south concrete bridge abutment walls are tied as reference points for the iron pipe monument (see sketch). The southeast corner of the north abutment wall bears N.28°E., 14.3' distant. The northwest corner of the south abutment wall bears, S.16°W., 84.4' distant. The southwest corner of the north abutment wall bears N.57 3/4°W., 25' dist.

Monument is located on north high bank of the middle fork of the Coquille River approximately 6' lower than and beneath the bridge deck of Dancer Road (Co. Rd. #218) bridge over said river fork.