

PRIMARY CORNER DESCRIPTION E 1/16 Secs. 6 & 7

| Alias | Description |
|-------|-------------|
| Alias | Description |
| Alias | Description |
| Alias | Description |

BLM resurvey by Larry Evans, Cadastral Surveyor under Group #736, surveyed May/June 1971 (DCSO records Vol 37 Pg 15340-1)

Point for the E 1/16 sec. cor. of secs. 6 & 7.
Set an iron post, 28" long, 2½" dia., 24" in the ground, with brass cap marked: E 1/16 $\frac{S\ 6}{S\ 7}$
1971

from which
A fir, 16" dia. bears N.24¾°E. 105½ lks. mkd: E 1/16 S6 BT
A fir, 37" dia. bears S.71½°E. 207½ lks. mkd: E 1/16 S7 BT

Douglas Co. Surveyors Office - Stephen J. Flause - Kody Inda - 12/13/2007 - C.S. File 67/25-2

Found - 3.25" dia. brass cap (properly mkd) on a 2.5" O.D. by 28" long iron pipe.
Monument is out of ground and out of position. Leaning against a post at a fence corner, approx 80 ft. North-Easterly from 1/16 corner position indicated by fd. BTs.
Two orig. 1971 BTs are fd.
A fir 16" dia., now a 33" DBH D.Fir with a fully healed single blaze bears N.24¾°E., 69.6 ft. (as per rec)
A fir 37" dia., now a 47" DBH D.Fir with a fully healed double blaze bears S.71½°E., 137.0 ft. (as per rec)
New - Utilizing fd. BTs, monument is reset at indicated position with top of monument approx. 18" below ground surface. Monument stamping is altered to indicate reset condition. ADDED the following to the cap: RESET 12/13/07
Note - Monument is in westerly edge of shallow drainage depression in easterly edge of large pasture just west of Yeust Rd.
Compass decl. 16¼°E.