

**UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT**

FIELD NOTES

OF THE

REHABILITATION OF THE NW 1/16 SECTION CORNER

OF SECTION 35,

**TOWNSHIP 30 SOUTH, RANGE 7 WEST,**

OF THE WILLAMETTE MERIDIAN,

IN THE STATE OF OREGON.

**EXECUTED BY**

***Timothy J. Moore, Cadastral Surveyor***

***Robert H. Browning, Surveying Technician***

Under Special Instructions dated July 13, 1979, approved July 17, 1979,

and Supplemental Special Instructions

dated May 20, 1985, approved May 24, 1985,

which provided for the surveys included under Group No. 1000,

and assignment instructions dated May 14, 1999.

***Survey commenced May 17, 1999***

***Survey completed June 16, 1999***

**T. 30 S., R. 7 W., Willamette Meridian, Oregon**

FEET

The following field notes describe the rehabilitation of the NW 1/16 sec. cor. of sec. 35, township 30 south, range 7 west, Willamette Meridian, Oregon, as provided for in the Special Instructions dated July 13, 1979, and Supplemental Special Instructions dated May 20, 1985, under Group 1000, Oregon, "Rehabilitation of Corner Points, Without Remonumentation, When Suitable Monument Exists."

The rehabilitation of the NW 1/16 sec. cor. of section 35, was made at the request of the Roseburg District Manager for the administrative purposes of the Bureau of Land Management.

The mean magnetic declination as noted in the 1977 Jelley survey is 18° 22' East.

---

**Rehabilitation of the NW 1/16 Section Corner of  
Section 35,  
T. 30 S., R. 7 W., Willamette Meridian, Oregon**

---

(Rehabilitating a corner established by James E. Jelly,  
Cadastral Surveyor, in 1976 - 77)

---

The NW 1/16 sec. cor. of sec. 35, determined at record bearing and distance from the reference monuments by Jelly, (the iron post set by Jelly was found laying loose on the ground near the hole from where it came) from which reference monuments set by Jelly

A stainless steel post, 2½ ins. diam., firmly set projecting 2 ins. above the ground, bears N. 68° E., 25.1 ft. dist., with brass cap mkd. NW 1/16 S35 RM 1977, and an arrow pointing to the corner.

A stainless steel post, 2½ ins. diam., firmly set flush with the ground, bears N. 72½° W., 14.5 ft. dist., with brass cap mkd. NW 1/16 S35 RM 1977 and an arrow pointing to the corner.

At the corner point

Reset the iron post, 28 ins. long, 2½ ins. diam., 25 ins. in the ground, with brass cap mkd.,

T 30 S R 7 W  
NW 1/16 S 35  
1977

Add the mks. 1999 to the bottom of the brass cap.

Rehabilitation of the NW 1/16 Section Corner of  
Section 35,  
T. 30 S., R. 7 W., Willamette Meridian, Oregon

FEET	
	<p data-bbox="407 321 1435 411">The cor. is located on the south side of the borrow ditch, south of the tracks, within the right-of-way for the Southern Pacific Rail Road.</p> <hr data-bbox="407 436 1435 441"/>