

Douglas County Surveyor's Record of
Government Corners Renewed

19 T. S. 8 R.W.W.M.

HOKE-CHARMAN CO., EUGENE, ORE. 21881

1

R. Wilson
Hutchison
Wit: Ed.
Johnson
May, 1960
C.S. File
No. 51/97

Corner to Sections 26, 27, 24, and 35.
Gov't Dependent Resurvey - Brass Cap in Place.
Alder 11" dia, N.30°30'E. 93 lks, (61.38') Gone
Fir 77" dia, S. 6°15'E. 362 lks, (238.92') High Stump
Alder 17" dia, S.23°30'W. 211 lks, (139.26') In
Maple 22" dia, N.70°00'W. 86 lks. (56.76') In
Remarked B. T. in Section 35:
Alder 12" dia, S.86°00'E. 26.3 ft. (Mkd. S35 BT)

REMARKED BY
HUTCHISON
Nov. 1960
51/97

Remarked B. T. in Section 26 - November 11, 1960
Maple 20 " dia, N.60°00'E. 115.33 ft. (Mkd. CS BT.)

2

C.V. Oglesby,
Special Deputy
May 19, 1911
C.S. File No. 53/1

$\frac{1}{4}$ Corner between Sections 11 and 14.
Identified old gov't. cor. by Vine Maple Stub 5" diam which has been cut off & was nearly entirely decayed but marks could be identified sufficient to know that it was one of the Orig. BT's. bearing S.10°W. 6 links dist. from old gov't stake. The B.T. for Section 11 was entirely obliterated.

Set - New a Vine Maple Stake 4" sq., 4 ft. long, 2 ft. in ground mkd:
 $\frac{1}{4}$ S 11 C.S. on North face & $\frac{1}{4}$ S 14 CS on South face from which:
8" Alder bears N.10°E. 26 lks. mkd: $\frac{1}{4}$ S11 CS BT.
6" Vine Maple bears S.35 $\frac{1}{2}$ °E. 7 lks. mkd: $\frac{1}{4}$ S14 CS BT.

3

John Venator, Special
Deputy Surveyor
Sept. 19, 1962
C.S. File No. 53/1

Section Corner to Sections 13 - 14 - 23 - 24.
Found - Iron Pipe with brass cap, in place from which:
Cedar 13" diam. bears S.11°E. 3 lks. dist. mkd: T19S R8W S24 BT.
Hemlock 13" diam. bears S.29 $\frac{1}{2}$ °W. 92 $\frac{1}{2}$ lks. dist. mkd: T19SR8WS23 BT.
(Both trees mentioned above from depend. resurvey, 1958)
New BT's: A Maple 12" diam., bears N.10°E. 91.5 ft. mkd: CS BT.
A fir 15" diam., bears N.38 $\frac{1}{2}$ °W. 67.2 ft. Mkd: CS BT.

4

Sam. F. Konnie
for Swanson Bros. Lbr. Co.
Feb. 8, 1967
C. S. File No. 55/26

$\frac{1}{4}$ Corner between Sections 19 and 30.
From GLD Notes dated 10/2/1891, $\frac{1}{4}$ Sec. Cor. Sq. Post.
Cedar 18" diam. brs. S. 70 $\frac{1}{2}$ ° E. 50 lks.
Fir 48" diam. brs. N. 6° E. 35 lks.
Evidence found: Both B.T's. are rotted down almost to ground level. No stake could be found.
No scribe visible.
Restoration Notes: Set 1" pipe, 24" long, 18" into the ground for the $\frac{1}{4}$ Sec. Cor.
For Reference, drove a 3/8 x 8" Spike into a 56" Fir Stump.
Spike is N. 77 $\frac{1}{2}$ ° E. 41.5 ft. from $\frac{1}{4}$ corner.
Drove a 3/8 x 8" Spike into a 40" Fir Tree.
Spike is S. 56 $\frac{1}{2}$ ° E. 63.9 ft. from the $\frac{1}{4}$ corner.

RE-REVIEWED, SEE CORNER NO. #23

MICROFILM TO HERE 10/67

5

Vernon
"Ray"
Tracy
& Jack
Heritage
C. S.
File
No.
56/34

Section Corner to Sections 29 - 30 - 31 - 32.
Found-Orig. 18", now 40" Fir Stump S.18 1/2°E. 39.9 ft.,
no scribe found.
Orig. 12", now 18" Cedar Snag S.27 3/4°W. 30.4 ft.,
scribe visible on open blaze.
Orig. 18", now 30" Cedar N.55 3/4°W. 19.1 ft., alive,
good condition, not open, we rescribe:
"T19S R8W S30 CS BT".

No trace of N.E. Orig. BT.
Set-Brass Cap at Cor. Mkd: County Surveyor's Office 1973
T.19S. R.8W
S 30 | S 29
S 31 | S 32

This unit has been clearcut & there are no trees for new BT's.
The Orig. BT's. will last for several years.
This corner lies on very steep westerly slope approx. 25 ft.
East of bottom of canyon.

7/16/73