

Douglas County Surveyor's Record of
Government Corners Renewed

20 T. S. 9 R. W. W. M.

BY H. T. Lewis
Infr. #722
Nov. 10, 1939
Ren. cor. Vol. 1
Pg. 6

CORNER OF SEC. 36, T. 20 S., R. 10 W. & SEC. 31, T. 20 S.,
R. 9 W. SEE CORNER NO. 16
At this corner I found the original pine set for this corner,
on the cap of which was marked as follows: T. 20 S.
This pipe has been upset by a falling tree, R. 10 W. | R. 9 W.
but as the N. W. witness tree was in place, S. 36 | S. 31
I reset the pipe, from which T. 21 S. 1
A Cedar, 8" diam., bears N. 65° E. 17 ft.
Marked T. 20 S., R. 9 W., S. 31, R. T. C. S. 722

By John M. Phillips
For Snellstrom Lumber Co.
February 1960
C. S. File No. 51/69

1/4 Section Corner to Sections 14 and 23
Note - See C. S. File No. 51/69 for the desc. of this corner. 2
Data furnished by B.L.M. since the notes are not yet
recorded in the Surveyor's Office.
Upon searching for this corner in a freshly logged area:
1. I found the 72" Fir stump & put a B.L.M. B.T. tag on it.
Scribe is in good shape.
2. I also found the 50" Fir Stump & put a tag on it.
Scribe was not found, however.
3. I found a broken off Cedar stump where the 21" Cedar was
called for. No identification.
4. Where Cedar Corner was located, I found only a root hole.
I reset this 1/4 corner from the two Fir B.T. Stumps & marked
the corner with a 2" pipe four feet long sunk 40" in the ground.
RE-RENEWED SEE CORNER NO. #39
50" FIR STUMP - N. 44° W. 16.50 FT.
RESET CORNER - 2" X 48" IP
SET 40" IN GROUND

Mile E. Godfrey, Deputy Co. Surv.
Wm. Steffel & Mike Stone
September 1964
C. S. File No. 53/66

Section Corner to Sections 3 - 4 - 9 - 10. 3
Corner set on affidavit of Fred Zeigler, see reverse side of
original field notes in C. S. File No. 53/66.
Brass Cap & BT. mentioned in affidavit have been washed away.
Set - Brass Cap at Cor. Mkd: County Surveyor's T20S R9W S 4 | S 3
Office, 1964 S 9 | S 10
Pile Boulders around Corner.
New BT's: 50" D. Fir N. 70° W. 62.4 ft. Mkd: T20S R9W S4 CS BT.
60" D. Fir N. 30° E. 151.1 ft. Mkd: T20S R9W S3 CS BT. 65 59/2
Clear cut area S.E. & S.W. of corner. No trees available.
Note - Corner is in bottom of draw, approx. 75 ft. from forks in draw,
up left fork.

WIT. COR. to 1/4 Corner to Sections 6 and 5. 4
Corner renewed from trees referenced out from 1/4 Corner by
Merle Weaver (See affidavit in C.S. File No. 53/66) to wit:
8" Maple N. 85° W. 27.0 ft. - 14" Fir S. W. 47.8 ft.
Alum. Tags on both of these trees gave dist. to 1/4 Corner.
The corner position, as measured from these trees, falls part way up the
cut bank on the west side of Forest Service Road.
Set - Wit. Cor. 80 ft. S. of 1/4 Cor. Mkd: County Surveyor's Office, 1964
T20S R9W W.C. 1/4 S 6/S 5 80 ft. N. to Cor.
New BT's: 14" D. Fir N. 20° W. 40.4 ft. Mkd: W.C. 1/4 S 6 CS BT.
16" D. Fir South 45.2 ft. Mkd: W.C. 1/4 S 6 CS BT.
Note - Corner is approximately 30 ft. West of Forest Service Road.