

Douglas County Surveyor's Record of
Government Corners Renewed

T 21 T. S. R 4 R. W. W. M.

KOKE-CHAPMAN CO., EUGENE, ORE. 21801

SEE M80-25
For: FD I.P.
42 ft North
J. Andrews
10/79

Les Roberts LS 1039
For: Rosboro Lbr Co.
Jan. 3, 1989
C.S. 63/85
M 108-12

Robert Findorff
M 122-28
per
FD I.P.
M 80-25

SE Section corner for Section 19

Found - 3/4" x 43" iron rebar Robert Dean set in place of Bruce Shaners 1 1/4" iron pipe. (RM 2-17 and M43-28) Ren. #131
Could not find the RR spike set by Robert Dean in M90-40.
Set - I set a rock nail in the asphalt, South, 42 ft. from said 3/4" iron rebar and used said nail for the SE corner of Section 19. My basis of bearing is from Bruce Shaner's survey RM 2-17. I found a 33" fir stump, S.60°W., 32.82' from rock nail. Distance is to hub tack in the bark.
This corner lies about 250' east of freeway and on south side of county road.

148

1/3/89

West 1/4 Corner for Section 31

Found - Found disturbed, a BLM 1988 brass cap on a 2" alum. pipe. (Not of record yet). Shiloh Logging operation had pushed monument in a northeast direction.
Also found, BT stumps with tags and scribes visible on the NW & SE BTs and healed blaze on E-SE BT. All stumps have alum. sheets covering them.
4 ft. high 20" W. fir stump bears S.83 1/2°E., 18.0 ft. healed blaze
4 ft. 15" D. fir stump bears S.22°E., 12.6 ft.. Placed LS 2057 brass shiner in lower portion of blaze.
4 ft. high 13" D. fir stump bears N.46 1/2°W., 18.5 ft. Placed LS 2057 brass shiner in lower portion of blaze.
Set - I excavated the found BLM monument and found a 3/4" x 34" galv. iron pipe inside of monument. I was able to reestablish GIP position as it was set 3 to 4 inches deeper than BLM monument; I straightened both monuments and reset accordingly. Ren. #78

149

No new accessories marked, as stumps should perpetuate corner position until suitable trees can be used, I painted and re-tagged BT stumps. This 1/4 corner is located within a clear-cut approx. 150 ft. west of a Guistina Logging road on a NW aspect.

10/31/89

Section Corner for Sections 8, 9, 17 and 16

Found - 1972 BLM 3 1/4" brass cap on a 3" x 30" iron pipe. BC/IP extending 20" above ground and very loose. Record distances to BTs were up to one foot in error.
Set - Firmly reset BC/IP at record distance from SE and SW BTs, extending 6" above ground:
From Which:
11" fir, bent trunk, bears S.12°E., 3.96 ft. Closed face (1972)
15" dead and leaning fir bears S.45°W., 4.63 ft. Rotting face.
22" fir bears N.16°W., (Rec. N.20°W.) 28.39 ft. Closed face.
18" cedar bears N.24°E., 36.81 ft. (Rec. 36.96 ft. Closed face.
E-W woven fence 1.2 ft. north of corner. Placement of nearby fence post may have disturbed monument.

150

3/27/90

1/4 Section Corner for Sections 4 and 5.

Set - 2" x 41" iron pipe with brass cap.
new Bt's 17" fir bears N 38° E, 17.6 ft. scribed "1/4S4 BT"
18" fir bears S 56° E, 33.3 ft. scribed "1/4S4 BT"
15" fir bears N 85° W, 16.3 ft. scribed "1/4S4 BT"
22" fir bears N 12 1/4° W, 44.9 ft.
Set 6' steel fence post 2' north.

151

1/4 Corner for Section 7; and Sec. 12 of T.21-5

NO CORNER MONUMENT FOUND. Could not find 1971 BLM cap.
Found - 3/4" iron pipe down the hill 20 ft.
Reset - 3/4" iron pipe using 1971 found BLM bearing trees.
Found - 48" fir stump, N.16°E., 25.8 ft. No marks, unknown origin
10" fir, S.23°W., 13.2 ft. Scar visible. 1971 BT.
15" fir, N.56°E., 19.1 ft. Scar visible. 1971 BT.

152

6/90

Martin C. Stewart
For: Shiloh Forestry
Inc.
Oct. 31, 1989
C.S. 63/85

Ronald Geisler
For: Champion
International
C.S. 63/112
March 27, 1990

Donald Peel L.S. #752
For: Weyerhaeuser Co.
M 110 - 2
April 1990

Les Roberts
For: Seneca
Timber Co.
June 1990
M 110 - 25