

Douglas County Surveyor's Record of
Government Corners Renewed

23 T. S. 4 R. W. W. M.

Oscar Thiele
Geo Williams
Luther Daugherty
Witnesses
See C.S. 6115

$\frac{1}{4}$ Cor bet 4 & 5 $\frac{23}{4}$
One old BT gone, the other standing but decayed & old marks almost
obliterated. SEE CORNER NO. 18
Marked 26" Fir N 82°W 45 lks mkd $\frac{1}{4}$ S BT C.S. 136
22" " N 45°E 21"

Found 8
April 8th 1943
A. Boyer Dep.
Leonard Cain Wit.
From old Vol. 1.
Renewed Corners

COR. BET. 29-30
Found that someone found the decayed cherry B. T. and scribed
two new bearing trees for the renewed cor.--the cherry tree
was just a rotten stump--this renewed corner was probably
set by Oscar Thiel. The New B. T.'s. are: 19
A Fir 30", N.10°W., 10 ft. Scribed on bark $\frac{1}{4}$ C. S. B. T.
A Cedar 15", S.55°E., 17.0 ft. Scribed $\frac{1}{4}$ C. S. B. T.
A 3"x3" sq. Fir Post is at corner--Probably renewed or relocated
in 1942.

(SEE THEIR REPORT IN
C.S. 54793 (ADDED TO
6115 RECORDS 3/21/78 + d.R.)

James Byron County
Ray Irving Surveyors
Office
July 16, 1953
Vol. 45 B.W. 175

Sec. Corner to secs 1, 12, 6, and 7. T 23 S, R 4 and 5 W.
Being corner on E. to secs 1 and 12, R 5, and corner on W. to
secs 6 and 7, R 4 W.
Set brass cap and pipe at corner from original B.T. 12" Fir
S 58°E., 50 lks. and a 18" Fir (down) N 89°E., 153 lks.
Scribed 8" Red Fir, R 5/W S 1, C.S.B.T. S 72°W. 42.7 ft. Also set Round Brass Plate Below B.T.
Scribed 8" White Fir, R 5/W S 12, C.S.B.T. S 29°W. 27.6 ft.
Scribed 12" Red Fir, R 4/W S 7, C.S.B.T. - Also set round brass plate
below B.T. N 90°E. 72.3 ft.
Scribed 8" Fir, R 4/W S 7, C.S.B.T.
Oct. 1965 - Cor. Pd. O.K. - 8", now 11" D. Fir S.15°E. 46.0 ft., good scar, healed.

March 3, 1954
Rd. No. 7.
Floyd C. Frear
B. Paulin
M. Skelton
D. Garrett
B. Stringer
File 46/50.

$\frac{1}{4}$ corner to secs. 16 and 21.
Found a 50" Cedar Stump and a 40" Cedar stump.
Set $\frac{1}{2}$ inch iron pipe at corner. 21
From which:
12 inch Maple, S.8°E., _____ feet dist. 113
15 inch Oak, N.31°E., 71.3 feet dist.
This Corner is just on E. side of Elk Creek and 771 feet E. from Road No. 7.

Gene E. Johnson
October, 1954
Survey for E. A. Hostetler
See C. S. File 41/318.

Section corner to secs. 7 & 18, T23S, R4W., and secs. 12 & 13, T23S, R5W.
Found O. B. T. at corner in good condition.
Set $\frac{1}{2}$ inch iron rod at corner point. SEE CORNER NO. 36 22

Section corner to secs. 18 & 19, T23S, R4W., and secs. 13 & 24, T23S, R5W.
Found O. B. T. stump, 12 inch W. Fir, N.20°W., 25.4 ft.
Set $\frac{1}{2}$ inch galvanized iron pipe. 23
Blazed and scribed 4 B.Ts & 4 inch fir stake.
40 inch Fir, N.60°30'W., 46.2 feet.
4 inch Cascara, N.30°30'E., 13.1 feet.
4 inch Cascara, S.8°E., 1.8 feet.
24 inch W. Fir, S.75°30'W., 20.4 feet. SEE CORNER NO. 83

James W. Byron,
Deputy
Ray Irving
Jan. 19, 1955.
C. S. File 46/82

$\frac{1}{4}$ corner to secs. 28 and 29.
Found - 1 inch iron pipe under N. S. fence - checks bearing and distance to be
both B. T.'s. The S. E. BT has rotted face. No scribing left. The
S. W. BT O. K. REN. #3 SEE CORNER NO. 118
I set Brass Cap at side of 1 inch iron pipe marked County Surveyor's Office
1955 $\frac{1}{4}$ S 29/S 28 T23 R4W.
Blazed and Scribed 18 inch R. Fir S.35°E., 6.7 feet dist. mkd. $\frac{1}{4}$ S 28 CS BT.

Wilford N. Haines
For E.G. Whipple Mill
February, 1956
M 2 - 66
SEE ALSO
The 115 Book
20 Pg 70

$\frac{1}{4}$ Section Corner Section 17 & 20.
Found both original BTs down and very rotten. Found a rock at proper
place for $\frac{1}{4}$ corner. 25
Set a lot marker by rock and scribed: 19 Inch Fir N 48°30'W. 8.0 feet
18 inch Fir S 38°15'E 17.0 feet.
Section corner to sec. 16, 17, 20, & 21.
Set Lot Marker by double proportionate measurement.
22 inch Fir S 21°53'E 33.25 feet. 10 inch Cedar N 73°02'W 58.45 feet. 26
8 inch D. Fir S 54°13'W 79.05 feet. SEE CORNER NO. #174 (cont. over)