

Douglas County Surveyor's Record of  
Government Corners Renewed

T. 24 S. T. S. R. 5 W. R. W. W. M.

SEC. COR.  $\frac{514}{819}$

SEE CORNER NO. 31

12

Location identified by 3 original B.T.s whose bearing's and distances check original field notes.

Set a 6" Oak post for corner and blaze and scribe a 20" Fir N. 3°E. 93 lks. as a new B.T. in the N.E. quadrant. Original B.T.s. I do not disturb as all are in excellant condition.

B. B. Irving DCS  
W.S. Crear  
N.E. Richardson  
Ted Shallabarger  
Feb 12, 1929  
C.S. FILE 14/27

S.W. COR. JONATHAN TIBBIE'S D.C. No. 40 (P.B. No. 30) Page 31

SEE CORNER NO. 61 (1912)

13

This is also the S.W. Cor of sec. 34  
Fir 12° N. 86½° E. 144 lks. This tree cut off and rotten  
Mark Visible.  
Corner reset by Frear from Wit. tree above. Set a 1" x 4'  
G.I.P. marked a 16" fir N. 72½° E. 33.8 ft. See Notes in C 22  
Roads.

C.C. Boyer  
4-6-33  
Frear  
J.H. Wolford  
P.D. "  
N.E. Richardson  
A. Boyer  
2 surveys  
(B. 30 P. 3)

S.E. COR. SEC. 34 Large sandstone rock in place. Found old  
B.T. S. 65 E. 318.8 ft. Remark 12" Ash S. 38° W. 19.1 ft. 33  
36.6 ft. & 18" W. Oak Marked S. 34 B.T. N. 87° W. 45.6 ft.

14

Apr. 11. 1933  
F.C. Frear  
A. Boyer

¼ COR. N. SIDE SEC. 3 Set 1" x 36" G.I.P. from remarked W.O.  
S. 45½° W. 448.1 ft. and old Pine stump 59½° W. 650.1 ft. No  
more trees near or marked.

15

OLD  
COR  
VOL. 1  
15 44

CENTER OF SEC. 20.

The Highway Engineers found a stone 5" x 12" x 12 Marked CS  
at the center of section 20, No notes found in this office  
on it. This stone had to be moved during construction. When  
pavement was laid. The state put in 3 brass plugs in concrete  
pavement, one exact point, 2 for reference. No trees.

15A

SEE SKETCH  
C.S. 15/11

Set by E. E. Umphlette State resident Engineer

Summer 1937

¼ SECTION CORNER BETWEEN SECTION 15&10 Location identified  
from an O.B.T. a white oak which bears N. 15° E. 54 lks. This  
tree is down & rotted. The blaze marks were plain but the  
scribe marks had rotted off. The O.B.T. S. 11½° W. 116 lks. had  
been completely destroyed by fire, the stump hole where the  
tree stood checks for bearing & distance.

16

Ben B. Irving  
D.C. S.  
N.E. Richardson  
J. F. Lamoreaux  
Witnesses  
Jan 3, 1938

Drove a ½" x 12" iron bolt for the corner & set a 6" white post  
alongside 24" above ground and scribed ¼ S on the E face, S. 15  
C.S on the S. face, & S 10 on the N. face. Marked new bearing  
trees.

An Oak 16" S. 43° W. 83.4 ft.

An Oak 8" N. 51° W. 139.0 ft.

Blazed & scribed ¼ S. 310 C.S. B.T. on 8" oak

Blazed & scribed ¼ S. 315 C.S. B.T. on 16" Oak

C.S. FILE 53/91  
M 23-729

¼ SECTION CORNER BETWEEN SECTION 15 & 22.

17

Location identified from property corner & line fence. This  
fence corner has been used for a great many years as the true  
corner & has never been questioned. Its location fits the  
local topography as recorded in the Orig. Govt. field notes.  
All local traces of the original corner have disappeared.  
Drove ¾" x 24" piece of shafting with a gear attached for the  
corner at fence corner described in the previous paragraph. T  
There are no trees near available for bearing so none were set.  
A ½" x 27" bolt for property corner bears N. 0° 11' E. 1320 ft.  
along the line through center of section 15. A ¾" x 30" iron  
pipe set for a property corner is S 89° 36' W. 1320 ft.

FD 1" AXLE  
BY R. Ddan  
12/93 994-0009