

Douglas County Surveyor's Record of  
Government Corners Renewed

25 T. S. 1 R. W. W. M.

HOKE-CHAPMAN CO., EUGENE, ORE. 21881

29

Continued  
Map File  
M 19 - 46  
Lecklider.

$\frac{1}{4}$  Section Corner to Sections 13 and 14.  
Found - Corner Stone  
14" Fir S. 62°W. 8.8 ft., Rec. N. 33°W. 18.5 ft. 61  
Set -  $\frac{5}{8}$ " Steel Tube  
32" Fir N. 45°E. 22.0 ft.

30

Section Corner common to Sections 16, 17, 20 & 21.  
At this point a thorough search failed to reveal any conclusive evidence of the original corner. This area has burned at least twice since the orig. cor. was established & all that remains now are badly burned snags & windfalls. In the re-establishment of this corner, I gave the most weight to natural objects & to old blazes along the line between secs. 17 & 20, The four stream crossings noted in the first 20.75 chains west were much more than ordinarily accurate. By placing the corner from the calls on this line a burned cedar stub in the S.E. quad. & a cedar windfall in the SW. quad. appear to be the remains of two orig. BT's.

At this point, which is in the previously mentioned tractor-built fire trail, I drove a  $1\frac{1}{2}$ " iron pipe 36" long 12" above the ground from which:  
48" Fir bears S. 59 $\frac{1}{2}$ °W. 49.0 ft. mkd. T25S S20 253 BT.  
54" Fir bears N. 11 $\frac{1}{2}$ °W. 130.5 ft. mks. R.1W. S17 253 BT.  
48" Fir Snag bears N. 47 $\frac{1}{4}$ °E. 68.1 ft. mkd: T25S S16 253 BT.  
No suitable tree in S.E. quadrant. MAY, 1967 - FOUND O.K. V.R.T.

31

$\frac{1}{4}$  Corner common to Secs. 16 and 17.  
I failed to find any trace of the orig. corner here, or any trees of the size noted as BT's.  
At this point I drove a  $1\frac{1}{2}$ " iron pipe 36" long, 12" above the ground, from which:  
18" Hemlock bears S. 3 $\frac{1}{2}$ °E. 87.5 ft. mkd.  $\frac{1}{4}$  S16 253 B.T.  
6" Chinq. bears N. 36°W. 36.2 ft. mkd.  $\frac{1}{4}$  S17 253 B.T.

32

$\frac{1}{4}$  Corner common to Sections 9 and 16.  
Found the orig. corner stone in place. The B.T. for section 16 is dead & down. The B. T. for Section 9 is entirely gone. 100  
I marked new B. T.'s. as follows:  
10" Hemlock bears N. 45°E. 38.8 ft. mkd.  $\frac{1}{4}$  S9 253 B.T.  
20" Cedar bears S. 71 $\frac{1}{2}$ °E. 39.0 ft. mkd.  $\frac{1}{4}$  S16 253 B.T.

33

Section Corner common to Secs. 9, 10, 15 and 16.  
Here, I found the badly decayed stump of the Orig. corner tree and a 6" Dogwood B.T. for Sec. 16. 91  
At the corner I drove a  $1\frac{1}{2}$ " iron pipe & mkd. new BT's. as follows:  
8" Hemlock bears N. 58 $\frac{1}{2}$ °E. 27.3 ft. mkd: S10 253 B.T.  
32" Fir bears S. 86 $\frac{1}{2}$ °E. 12.4 ft. mkd: S15 253 B.T.  
6" Dogwood bears S. 77°W. 29.0 ft. Old B.T.-scribed in bark.  
16" Fir bears N. 27 $\frac{1}{4}$ °W. 23.8 ft. mkd: S 9 253 B.T.

34

$\frac{1}{4}$  Corner common to Secs. 15 and 16.  
Here, I found the orig. corner stone in place. The BT for Sec. 15 is O.K., now 22" in diam. The BT for sec. 16 was gone. 64  
I mkd. new B.T. as follows:  
12" Hemlock bears S. 72 $\frac{1}{4}$ °W. 35.3 ft. mkd:  $\frac{1}{4}$  S16 253 B.T.

35

Section corner common to Secs. 15, 16, 21 and 22. #105  
Here I found the Orig. Chinq. corner tree O.K. The Orig. B.T. for Sec. 22 is standing with rotted side toward the corner. The other BT's gone. Mkd. new BT's. as follows: 105  
12" Heml. bears N. 83 $\frac{1}{2}$ °E. 29.0 ft. mkd. S15 253 B.T.  
10" Heml. bears S. 73 $\frac{1}{2}$ °E. 18.3 ft. mkd. S22 253 B.T.  
12" Yew bears S. 13 $\frac{1}{2}$ °W. 14.7 ft. mkd. S21 253 B.T.  
6" Yew bears N. 34°W. 13.4 ft. mkd. S16 253 B.T.

RE-RENEWED

V. W. Hosford  
Surveyed for Evans Products Co.  
April 5th until Nov. 25, 1960  
C. S. File No. 51/152  
Map File M. 20 - 2

R. GEISLER  
FD 11/84  
C.S. 58/146

SEE PLS 20 691-93 FOR NEW BT'S & CALLS  
Resurvey BT's & CALLS  
1998/1999  
O.K. V.R.T.