

Douglas County Surveyor's Record of
Government Corners Renewed

31 T. S. 9 R. W. W. M.

MOKE-CHAPMAN CO., EUGENE, ORE. 21881

$\frac{1}{4}$ corner common to Secs. 21 and 22.

Found - In poor condition. A severe fire has burned this area, which probably took place soon after the original survey.

I found the orig. BT. for Sec. 21 in, & opened the remains of the old face & have found definite markings of the old scribing visible, but because of the condition of the face and snag, this may be gone in the near future.

Set - $7/8$ " x 30" Hex drill steel for the corner, driven 20" in the ground. 96" Fir N. $29\frac{1}{2}^{\circ}$ W., 16.8 ft. was referenced & scribed S. $21\frac{1}{2}$ S 4186 B.T. A 6" Fir N. 35° E. 41.1 ft. was referenced & scribed S $22\frac{1}{2}$ S 4186 B.T.

Lorne Swearingen
Wit: R. A. Harris &
Milner Larsen
May 20, 1960
C.S. File No. 51/68

South $\frac{1}{4}$ Corner of Section 34.

Corner destroyed during logging operations.

Orig. 14" Fir N. 27° W. 15.2 ft. is a stump with orig. scribing visible.

Orig. 12" Fir N. 57° E. 17.8 ft. is a windfall deteriorated so badly all evidence of scribing is gone.

Mkd. the corner with a $7/8$ " x 30" Hexdrill Steel, driven 20" in the ground from which I referenced:

12" I. Cedar N. 15° E. 92.2 ft. scribed S $34\frac{1}{4}$ S 4186 BT.

Since all of Sec. 34 has been logged & the remaining trees are wither too small or I felt they were not wind firm, I marked a 8" Fir S. $32\frac{1}{2}^{\circ}$ E. 24.9 ft. scribed S $34\frac{1}{4}$ S 4186 BT. The 8" Fir is in Sec. 3, T32S, R9W, W.M. & the $\frac{1}{4}$ corner is not common to this section, but I felt that this tree would best perpetuate the corner as it should be wind firm and not cut when section 3 is logged.

Lorne Swearingen
For Robert Dollar Co.
Milner Larson
November 16, 1960
C.S. File No. 51/68

$\frac{1}{4}$ Corner common to Section 35 and 36.

Corner found in poor condition. The Orig. BT. for Sec. 35 is a 20" Cedar which has had the face destroyed by a logging slash fire. The Orig. 10" Fir Tree for Section 36 has blown over but the Orig. face is clearly visible.

I marked the corner with a $7/8$ " x 30" Hex Drill Steel driven 20" in the ground from which I referenced a 8" Fir N. 28° W. 54.5 feet scribed S $35\frac{1}{4}$ 4186 BT, a 10" Fir S. 44° E. 16.9 ft. scribed S $36\frac{1}{4}$ 4186 BT.

Lorne Swearingen
For Robert Dollar
Jan. 16, 1961
C.S. File
No. 51/68

$\frac{1}{4}$ Corner to Sections 8 and 9.

Set $\frac{1}{2}$ " Gal. Iron Pipe & Post, from which:

16" Fir bears S. 35° W.

26" Fir bears S. 15° E. 22.4 feet.

Section Corner common to Sections 8 - 9 - 16 - 17.

Find Cedar marked for the corner down.

Set Iron Pipe Post at Roots of down Cedar for the corner from which:

16" Fir bears N. 42° E. 66.6 ft., Orig. BT. (Scribing visible.)

24" Fir bears S. 40° E. 23.2 ft., Orig. BT.

10" Fir bears S. 45° W. 22.4 ft., Orig. BT.

Section Corner to Sections 16 - 17 - 20 - 21.

Find 2" BT's. remaining. Corner falls under 60" Down Fir Log.

Set Post on East Side of Log from which:

38" Fir bears S. 45° W. 66.0 ft. (face not opened)

30" Fir bears S. 38° E. 85.6 ft. (scribing visible)

The BT's. in the NW and NE quadrant gone.

$\frac{1}{4}$ Section Corner to Sections 16 and 17.

No trace of Original found. BT's. were Chinquapin.

Set squared post & pipe for corner from which:

36" Fir bears N. 76° E. 18.3 ft.

12" Fir bears N. 5° E. 27.3 ft.

RE-RENEWED SEE CORNER NO. 132 8

RE-RENEWED SEE CORNER NO. 42 9

RE-RENEWED SEE CORNER NO. 79

RE-RENEWED SEE CORNER NO. 62

RE-RENEWED SEE CORNER NO. 93

RE-RENEWED SEE CORNER NO. #118

RE-RENEWED SEE CORNER NO. 141

Clifford A. Stephens
Surveyed For Coos Head Timber Co.
Date - Dec. 1959 - Feb. 1961
C. S. File No. 51/178
Map File M 20 - 16