



THE ROBERT DOLLAR CO.

LUMBER PRODUCTION DIVISION

TELETYPE 39 • TELEPHONE VERNON 2-5810

GLENDALE, OREGON

May 2, 1962

SAN FRANCISCO 4
HEAD OFFICE
311 CALIFORNIA STREET
NEW YORK 4, NEW YORK
1 BROADWAY
WASHINGTON 6, D. C.
716 TRANSPORTATION BUILDING

Douglas County Surveyor
County Courthouse
Roseburg, Oregon

Dear Sir:

The corner common to Sections 8,7,18 and 17, Township 31,S., Range 8W, W.M. was found to be in poor condition.

I scribed two new bearing trees and marked the corner as follows: marked the corner with a 7/8" Hex drill Steel 20" in the ground for the corner. A 36" Fir S 58 $\frac{1}{2}$ ° E 23.2 feet was referenced and scribed S17 R 4186 B.T.; the original B.T. for this quadrant has fallen over and rotted out. A 20" Fir S45° W, 24.3 feet was referenced and scribed S 18 R 4186 B.T.; the original B.T. for this quadrant is in place but is a 12" Fir snag with most the original bark scribing obliterated by old cruising chopping but the B.T. scribing is plainly visible at the base of the tree. The original B.T. in the SW quadrant is now 36" and since it has grown so rapidly, all evidence of the original bark scribing has gone. The original B.T. in the NE quadrant has old cruiser chopping marks which has nearly obliterated the original bark scribing, but with close scrutiny, original markings can be found above chopping.

Bearing trees were referenced with a compass and chain, magic declination used was 19 $\frac{1}{2}$ ° E.

Yours very truly,

THE ROBERT DOLLAR CO.

Lorne V. Swearingen
Logging Engineer
Registered Engineer 4186

FILED
RECEIVED

MAY 4 1962

LVS:mt

COUNTY SURVEYOR
DOUGLAS COUNTY, ORE.

C. S. File No. 51/68-4