

February 15, 1960

Resetting of Damaged 1/4 Corner

Section 14 Twp. 20 S., R. 9 W., W.M., Douglas County, Oregon
23

Done at the request of the Bureau of Land Management for the Snellstrom Lumber Co., P. O. Box 449, Eugene, Oregon.

The following gives the description of this Corner which is from the G. L. O. Survey. Data was furnished by the Bureau of Land Management since the notes are not yet recorded in the County Surveyor's office.

The Corner is a Cedar 11" in diameter with scribe 1/4 S visible on North side.

From which: A Fir 50" diameter bears N 44° W, 25 lks dist.
(Old B. T.) Badly scaled bark blaze

A Fir 72" diameter bears N 74° W, 20 lks dist.
(New B. T.) Marked 1/4 S14 B. T.


A Cedar 24" diameter bears S 65° E, 9 lks dist.
(Old B. T.) Plainly blazed and healed.

Upon searching for this corner in a freshly logged area:

1. I found the 72" Fir stump and put a Bureau of Land Management B. T. tag on it. Scribe is in good shape.
2. I also found the 50" Fir stump and put a tag on it. Scribe was not found, however.
3. I found a broken off Cedar stump where the 24" Cedar was called for. No identification.
4. Where Cedar Corner was located I found only a root hole.

I reset this 1/4 Corner from the two Fir B. T. stumps and marked the Corner with a 2" pipe four feet long sunk 40" in the ground.

Var. N 20° E

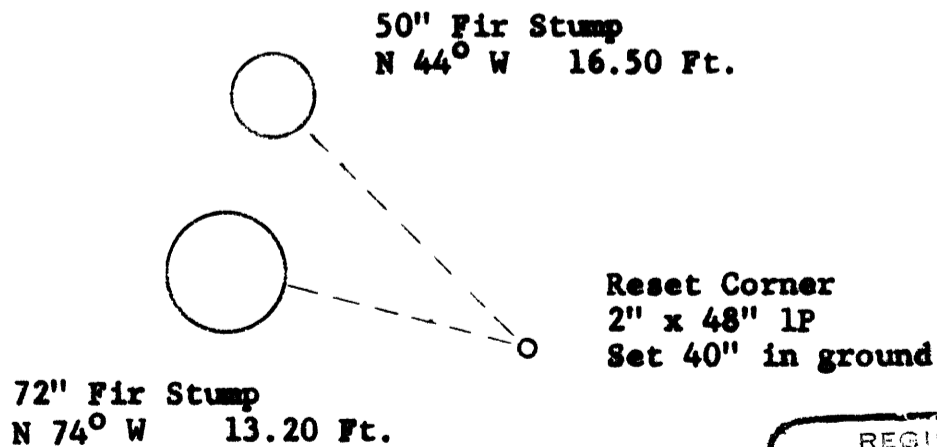

FILED
RECEIVED
1" = 10'
FEB 29

COUNTY SURVEYOR
DOUGLAS COUNTY, ORE

REGISTERED
OREGON
LAND SURVEYOR

John M. Phillips
NOV 6 1960
JOHN MORRISON PHILLIPS
307

✓ C.S. File No. 51/69