

Corner to Secs. 34, 35, 2 & 3, T16 & 17 S, R1W ✓ ✓

Only one bearing tree was standing at this corner, a Yew now 20" diam., South 50°East, 45 links distant from the post. I set a 4" Yew post and from it marked three new bearing trees:

Yew 9" diam., marked T16S R1W, S35, C.S., B.T., brs. North 88°East, 54 lks.

Red Cedar 13" diam., marked T16S R1W, S34, C.S., B.T., brs. North 58°West, 52 lks.

Yellow Fir, 50" diam., marked T17S R1W, S3, C.S., B.T., brs. South 62½° West, 49 lks.

Corner reset March 2, 1943, by

R. N. Hinkson.

Witnessed by Walter Lyons.

¼ Corner between Sections 34 & 3, T16 & 17 S, R1W ✓ ✓

One bearing tree, an Incense Cedar now 36" diam., had plain scribe markings on it. The scribe marks had rotted away from the other Incense Cedar bearing tree so I remarked it C.S. ¼ S. B.T. It is a 24" Incense Cedar and brs. South 29½°West, 113 lks distant.

From both bearing trees, I set a 4" Dogwood post marked C.S. ¼ S 34 on the North face and C.S. ¼ S 3 on the South face.

Corner reset March 2, 1943, by

R. N. Hinkson.

Witnessed by Walter Lyons.

T19S R7W, WM, Lane Co. ¼ Sec. Corner on South Bdy. Sec. 34, V. 6 N. 44 #38

Only one of the original bearing trees were standing at this corner. It was a White Fir, 30" diam., with the scribe marks nearly rotted away. From this bearing tree, I set a 4" Hemlock post marked C.S. ¼ S 34 on the North face and marked a new bearing tree:

Fir 72" diam., marked C.S. ¼ S B.T., brs. North 53°West, 18 lks.

As this is the ¼ corner for Section 34 only, I did not mark a new bearing tree in Section 3.

Re-established March 12, 1943, by

R. N. Hinkson.

Witnessed by Walter Lyons.

3 copies