

Renew Sec. Cor. ^{519/520} 530/529 T215 R5W

Fd. cor. stone MKd " + " on Top with
3 notches on S. & 1 notch on W. - &
BT, as called for in Ren. # 8 &
CS file 41-5-

12" now 15" Fir S. 2° E, 150 1/2 ft,
Now Decayed, sawed fir stump - we
open lower blaze & find "BT"
scribe & Reverse - 2^d cor. point in
place of stone - set 1" I.P. & Brass
cap MKd. " COUNTY SURVEYORS OFFICE
1970 T215 ^{519/520} 530/529 R5W " Reset old
cor. stone alongside - MK. New BTs -

8" D. Fir S. 1° E, 232 2/3 ft,

Mkd. " T215 R5W 529 CS BT "

14" Apple S. 59° W, 135 8/10 ft,

Mkd. " T215 R5W 530 CS BT "

Power Pole # 7C-48/2 Bears N. 28° W, 104 2/3 ft,

This cor. lies in old N.-S. fence
line. Note: see Reverse side -

Dec. 8, 1970

V. R. T. Ray

V.R.T.
VDR

#140 ✓

OVER

C. S. File No. 54/14-47

Fd. a.k. 21-5

sec cor 27/26
34/35

I.P. & B.Ts 2s
Recorded in Ren.
106

When A.R. EVANS Renewal of
This cor. was Recorded in Ren.
Book, an error was made in
The bearing - Ren # 8 should
have Read $5.2^{\circ} E$. To B.T.
Instead of $5.52^{\circ} E$. - Upon
checking CS. file 41/5 we
Fd. that $5.2^{\circ} E$. was correct.
When using this bearing
we found The Stone Evans
called for & decayed Remnants
of a scribed wooden Post.
We defaced B.Ts MKd. by us
& Reset Brass cap at proper
Point. -

V.P.T.

0.11
4
5
6