

DATE: April 13, 1981

Condition Report Only

Not Found

Renewed

Unrecorded

Surveyed In

Referenced Out

T215 R8W

$\frac{1}{4}$   $\frac{54}{59}$

Previous Renewal #'s NONE

Monument(s) Found: (Condition and Source) A 2 1/2 inch G.L.O. brass cap on a 1 x 30 inch long iron pipe lying loose on ground surface.

Cap is marked as follows: U.S. GENERAL LAND OFFICE SURVEY

A red painted steel  $\frac{1}{4}$   $\frac{54}{59}$

fencepost nearby protrudes 1945

42 inches from ground; a check of the bearings and distance to original southwest bearing tree reveals that fencepost does not mark corner position.

Accessories bearings and distances are check from corner position as determined from southwest bearing tree.

Accessories Found: (Condition and Source) An original Fir,

16 ins. diam. now a 42 inch D.B.H. Douglas fir bears S10°W, 12 <sup>5</sup>/<sub>8</sub> feet distant (as per record) tree is opened to find <sup>search for</sup> 1945

rescribing (see 1945 dependent resurvey of area) blaze

found is open to see scribing 1/4. An original cedar 28 ins. diam is now a downed cedar 50 inches in diameter. Center of upright hole agrees reasonably well with record bearing and distance.

#25 ✓

File No. 61/19-37

Page      of C

This cedar has fallen with blaze marks are hidden. From 1945 resurvey a fir 22 ins. diam. now a 32 inch diameter 8 ft long tipped out stump has uproot hole which agrees reasonably well with record bearing and distance. This fir stump also has tipped over on its face and no blaze marks are found.

RENEWAL

Monument Set: (Procedure and Description) Because of good condition of original southwest bearing tree the GLO brass cap monument is set at the record bearing and distance from this tree. We add reset marks to cap it now reads:

Cap now protrudes 1 inch from ground  
 Red fence post (see mon found) is set on south side of cap and protrudes 44 inches from ground.  
 New Accessories (Description)

US GENERAL LAND OFFICE SURVEY  
 RESET

$\frac{1}{4}$  54  
 59

DCSO

1981  
 1945

A 12 inch DBH Douglas Fir bears N53°W, 38 ± feet distant and is scribed  $\frac{1}{4}$  54 CS B7 on a double blaze.

A 7 inch DBH Hemlock bears N24  $\frac{1}{4}$ °W, 13  $\frac{1}{2}$  feet distant and is scribed  $\frac{1}{4}$  54 CS BT as a bark scribe. The new

bearing trees and the original southwest bearing tree are tagged with DCSO, BT tags

Location and Comments: \_\_\_\_\_ 19°E Compass Declination

DCSO

Agency

Deputy Stephen John Flouse

Party Chief

Alexander John Flouse

Notekeeper

Karen Mosley

Witnesses

*OK ghl*



**INTERNATIONAL PAPER COMPANY**

WOOD PRODUCTS & RESOURCES GROUP

WESTERN OPERATIONS

BOX 43, GARDINER, OREGON 97441

PHONE 503 271-2151

November 17, 1980

Surveyors Office  
Douglas County Court House  
Roseburg, Oregon 97470

Dear Sir:

In April of this year the 1/4 corner common to sections 4 & 9, T21S, R8W, W.M. was visited by Company personnel. The pipe is rusted through at the ground line with the brass cap and the detached portion of pipe lying on the ground.

Sincerely,

PRESLEY THORNTON  
Forest Engineer

PT:jc