

OREGON CORNER RESTORATION

Section 24 Township 31 South Range 9 West

Douglas County July 23, 1985

CORNER DESIGNATION

The 1/4 sec. cor. of secs. 24 and 25 (RENEWAL OF REMOVED IRON POST AND BRASS CAP)

Previous Renewals/Surveys, etc.

1901 Survey by W. Byars, U.S. Deputy Surveyor
Douglas County Surveyor's Office (DCSO) in 1967-Renewal #50

Monument(s) & Accessories Found: (Condition and Source)

Found DCSO iron post and brass cap lying on ground. Found the two original bearing trees:

A fir, 23 ins diam., bears S. 25° E., 79 lks. (52.1 ft.) dist., with fragmentary scribe marks visible on mostly healed blaze.

A fir, 31 ins. diam., bears N. 15° W., 51 lks. (33.8 ft.) dist., with healed blaze. (1901 record is N. 20° W., 57 lks., 1967 DCSO is N. 15° W., 33.8 ft.)

Beause the original record cannot be reconciled I accept the point determined by the Douglas County Surveyor's Office as the corner point.

Monument Detail

Brass cap marked

COUNTY SURVEYORS OFFICE

T31S R9W

1/4 S S 24

S 25


1967

Sketch

31" Fir N. 15° W. - 33.8 ft.

BC/IP

23" Fir
S. 25° E. - 52.1 ft.

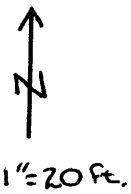

Monument Set

Reset the iron post (1" X 30") 18 ins. in the ground, to solid bedrock, in a small mound of stone, 1 1/2 ft. base, 6 ins. high.

Compass Declination= 19 1/4° E.

Firm/Agency U.S. Bureau of Land Management
3040 Biddle Road
Medford, Oregon 97504

Witnesses D. Russel
T. Gawronski

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Terrence O. Mickerson

OREGON
JULY 14, 1978
TERRENCE O. MICKERSON
1649

C.S. File No. 62/24-3c

#1684