

GOVERNMENT CORNER RESTORATION FORM

FILED

TOWNSHIP 24S RANGE 6W SEC. 25 PLSS # 200706

Date: 1/9/2025 By: X  
This survey consists of:

DOUGLAS COUNTY OREGON

DATE 1-6-25

Map: \_\_\_\_\_

Narrative: \_\_\_\_\_

Corner Rpt: CS 67/59-43

Corner Designation

SEC COR  $\frac{31}{6} | \frac{32}{5} T25-6$   
 $T22-6$

DOUGLAS COUNTY  
SURVEYOR

Monument(s) Found: (Condition and Source)

1" I.D Iron pipe Badly  
Bent BRASS CAP MISSING

Condition report

Not Found

Renewed

Unrecorded

Surveyed In

Previous Renewals

Roberts 1908 Book 7 pg 76  
Byron 1959 CS 52/5 M 14-59  
DCSO 1979 CS 60/24-19  
DCSO 1990 CS 64/5-10  
Sweeden 2001 M 138-58  
EDWARDS 2003 M 142-50  
DCSO GIS 2004 CS 67-33-1  
EDWARDS 2014 M 168-39

MONUMENT DETAIL

19" B. OAK N 8 1/2° E 59.9 FT Healed Double  
BLAZE

20" MADROVE N 136° W 38.8 FT Healed BLAZES

15" Rotted BASE MADROVE 6" & 8" sprouts

S 31° E 50.4 FT Healed Double BLAZE

21" OAK S 34 1/2° W 158.5 FT Healed Double  
BLAZE

5/8" I. ROD on N. Edge of MON.

orig Corner stone on EAST Edge  
OF MONUMENT.

RENEWAL

Monument Set (Procedure and Description)

Reference pipe location  
Set 2 1/4" Alum pipe with  
3/4" Alum cap at referenced  
location flush with  
ground

MONUMENT DETAIL

DOUGLAS COUNTY  
T255 RLW  
RESET 531 | 532  
54 | 55  
T265 RLW  
2025  
SURVEYORS OFFICE

New Accessories

Sketch of Monument, Accessories, and General Area

Location & Comments

MON IS APPROX 50  
FT NORTH  
GRAVEL DRIVEWAY

Comp. Decline. 14 1/2° E  
Agency DCSD  
Party Chief S. F. AUSE  
Note keeper  
Witnesses J. LORSUNG

CS 67/59-43  
214

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Ronald A. Quimby*

OREGON  
JULY 14, 1978  
RONALD A. QUIMBY  
1654

EXPIRES: 12/31/2026

PRIMARY CORNER DESCRIPTION Sec. Cor. for 5 & 6; 31 & 32 of T25-6

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

Set - 1" x 36" I.P. with brass cap mkd. "Douglas County Surveyor" T25S S31 S32 S6 S5 T26S R6W 1979. Cap 5" above ground, rod 9" above ground. Cap in position of stone. Placed stone next to cap and rod east side of cap.

New BTs - 12" Madrone bears S.31°E., 50.4 ft. scribed "S5 T26S R6W CS BT".  
 11" Oak bears S.33°W., 158.5 ft. scribed "S6 T26S R6W CS BT".

*DECLINATION 14 1/2° E*

*RENEWED 1/6/25*

Douglas Co. Surveyors Office - Randall Smith; Stephen Flause  
Jan. 31, 1990 - C.S. File 64/5-10

Found - A 2 1/2" dia. 1979 DCSO brass cap on a 1 1/4" O.D. I.P. protrudes 6" out of ground, now bent approx. 12" north of plumb.

*BRASS CAP GONE SEE BELOW*

5/8" dia. I.Rod protrudes 9" out of ground, now bent approx. 15" north of plumb. I.R. found along north side of DCSO BC/IP.

*SEE BELOW*

9"x9"x17" stone no marks visible found approx. 2 ft. north of DCSO BC/IP's plumb position.

(Bearings & distances taken to plumb position of DCSO BC/IP.)

*19"* 10" now 14" B.Oak with a fully healed double blaze bears N.8 1/2°E. 59.9 ft. (Rec. N.7°E., 61.3 ft. slope distance)

*20"* 6" now 14" Madrone with fully healed blazes bears N.36°W. 38.8 ft. (per record)

*TREE GONE 15" ROTTEN BASE 6" AND 8" SPROUTS*

12" now 14" Madrone with partially healed double blaze scribing visible "T26S R6W" bears S.31°E., 50.4 ft.

*21"* 11" now 14" Oak with fully healed double blaze bears S.34 1/2°W., 158.5 ft. (Rec. S.33°W., 158.5 ft.)

Set - Position of bent DCSO BC/IP is referenced. DCSO BC/IP is straightened & returned to referenced position. BC/IP now protrudes 3" above ground. 5/8" I.R. is straightened & set along North side of Brass cap. 5/8" I.R. now protrudes 1" above ground. Stone is placed along East side of DCSO BC/IP. BC/IP measures 36". 5/8" I.R. measures 50" long.

*BRASS CAP MISSING 1" I.P. NOW HAS TOP BENT ~ 6" SOUTH FROM PLUMB, 5/8" I.R. AND STONE ARE FOUND AS DESCRIBED*

Corner lies on a NW-SE running ridge on a bench approx. 50 ft North of a dirt road. *GRAVELED DRIVEWAY*

Found OK by C. Sweeden, Aug. 2001 - M138-58  
 Found OK by D. Edwards, June 2003 - M142-50

*CS 67/59 - 43 3/4*

continued next page

*PLUMB POS. OF FOUND BENT I.P. IS REFERENCED AND I.P. IS REMOVED AT REFERENCED CORNER POSITION IS SET A 3 1/2" DIAM. ALUMINUM CAP ON A 2 1/4" DIAM. ALUMINUM CAP ON A 2 1/4" O.D. X 30" ALUM PIPE OVER ->*

TOWNSHIP 26 RANGE 06 POINT IDENTIFIER # 200700

PRIMARY CORNER DESCRIPTION Sec. Cor. for 5 & 6; 31 & 32 of T25-6

Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_

DCSO-GIS Corner visitation - 6/21/2004 - Typed: 1/25/2011 -  
C.S. File 67/33-1

-----  
Monument - BC/IP 1.25"  
Comment - OK

Fd BC by D. Edwards, 5/2014 - M168-39

**CAP IS MARKED**

" T255 R6W "

RESET

S 31 / S 32  
S 6 / S 5

T 265 R6W

2025

NEW ALUMINUM CAP AND PIPE  
IS NOW NEAR FLUSH WITH GROUND  
AND SLIGHTLY LOWER THAN FOUND  
STONE. 5/8 INCH I.R. ON NORTH  
EDGE OF MON. IS DRIVEN DOWN  
TO SET ITS TOP SLIGHTLY LOWER  
THAN TOP OF NEW ALUM. MONUMENT,

CS 67/59-43  
4/4