

PRIMARY CORNER DESCRIPTION Cor. Secs 8, 9, 16, & 17

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____


GLO survey by William Thiel under contract 271 dated Aug. 18, 1877 - (DCSO records Vol. 1 Page(s) 196-7)

Set post for corner of secs. 8, 9, 16, & 17; from which
 A Fir, 8" dia., bears S.2½°W., 40 lks.
 A Fir, 8" dia., bears S.69½°E., 58 lks.

Fd. & used on GLO survey by Nathaniel Martin, under contract # 599 dated June 20, 1892 - (DCSO records Vol. 1 Page(s) 239)

BLM dependent resurvey by Thomas A. Tillman,, under Group # 297, Surveyed May 1951 thru Oct 1952 - (DCSO records Vol. 2 Page(s) 11731-32)

The cor. of secs. 8, 9, 16, & 17, determined at the record bearing & dist. from the remaining orig. BT, as follows:
 A rotted Fir stump, 18" dia., bears S.69½°E., 58 lks., in which I uncover the face of an old blaze marked: S16 T20 R10 BT.
 At the corner point
 Set an iron post, 3 ft. long, 2" dia., 28" in the ground, with brass cap marked:
 T20S R10W

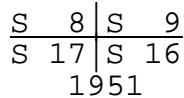

from which
 A Fir, 38" dia., bears N.35°45'E., 50½ lks., mkd: T20S R10W S9 BT.
 A Fir, 18" dia., bears S.25°E., 16 lks., mkd: T20S R10W S16 BT.
 A Fir, 16" dia., bears S.20°W., 13 lks., mkd: T20S R10W S17 BT.
 A Fir, 22" dia., bears N.32°W., 31½ lks., mkd: T20S R10W S8 BT.

Douglas Co. Surveyors Office - Vernon "Ray" Tracy - Jack Heritage - V. Perron - April 1968 - C.S. File 53/66-85

Found - 1951 GLO brass cap, properly marked, out of ground.
 38", now 40" Fir, alive, N.35 3/4°E., 33.3 ft., healed blaze.
 18", now 18" Fir, alive, badly injured on blaze side, S.25°E., 10.6 ft.
 16", now 18" Fir, alive, S.20°W., 8.6 ft., healed blaze.
 (Cont. next page)

TOWNSHIP 20 RANGE 10 POINT IDENTIFIER # 300500

PRIMARY CORNER DESCRIPTION Cor Secs 8, 9, 16, & 17

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

22" Fir, now stump, N.32°W., 20.8 ft., scribe visible on unhealed blaze.
Reset brass cap at corner point.
New BT - 9" D.Fir S.63°E., 20.4 ft., mkd: T20S R10W S16 CS BT
No other trees available in sec. 8.
This corner lies on steep southerly slope approx. 60 ft. S. of ridge top.

Fd. Ok by Richard Hintz, April 1983 - M 90-42

Jerry Estabrook - For: Menasha Log Co. LLC & The Campbell Group LLC ITS Manager - May 2012 - M163-55 & C.S. 65/75-5

Found - 2" iron pipe with brass cap marked T20S R10W S8 S9 S17 S16 1951. Per BLM
40" fir stump with healed face and tags, bears N.35¼°E., 33.3'
A rotten stob with no visible marks bears S.69½°E., 38.5'
An 18" fir stump with healed face bears S.25°E. 10.5'
An 18" fir stump with healed face bears S.20°W. 8.6'
A 22" fir stump no visible marks bears N.32°W 20.8'
New BTs- A 12" fir face scribed "NW S16 BT" with x-chop and tag bears S.80°E., 7.8' to a spike at side center
An 8" fir face scribed "NE S17 BT" with x-chop and tag bears S.60°W., 2.9' to a spike at side center
A 10" fir face scribed "SE S8 BT" with x-chop and tag bears N.27°W., 10.9' to a spike at side center.