

PRIMARY CORNER DESCRIPTION West 1/4 Cor. Sec. 18 only

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

BLM resurvey by A. Bert Skeesick, Cadastral Surveyor under Group #1925, surveyed July/Dec. 2000 - (DCSO rec. Vol. 53 Page(s) 20525-6)

The 1/4 sec. cor. of sec. 18 only, monumented with an iron post, 1" diam., firmly set, rusted and nearly broken off at ground level, projecting 14" above ground, with brass cap mkd. 1/4 S18 1917.

from which the remains of the bearing trees mkd. by Strickler

A decayed maple rootcrown, size indeterminate, bears N.10°E., 7.9 ft., no marks visible.


A root hole, bears S.51°E., 17.8 ft., no marks visible. and remains of bearing trees mkd. by Corbin

A cedar, 14" dia., bears N.47 3/4°E., 28.8 ft., no marks visible.

A root hole, bears S.32 1/2°E., 8.6 ft., no marks visible.

At the corner point

Set a stainless steel post, 28" long, 2 1/2" dia., 26" in the ground, with brass cap mkd. T 27 S

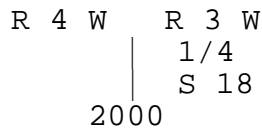

from which a new bearing tree

A fir, 9" dia., bears S.70°E., 45.6 ft., mkd. 1/4 S18 BT. Each new bearing tree has a 2 1/2 in. X 1/4 in. magnetic nail (MAG-NAIL) driven at the base on the right side-center, unless otherwise described in the corner description.

Deposit a magnet in a white plastic case at the base and the remains of the iron post inside of the stainless steel post.