

PRIMARY CORNER DESCRIPTION NE Cor. Sec. 1 (Tsp. cor.)

Alias	_____	Description	_____
Alias	_____	Description	_____
Alias	_____	Description	_____
Alias	_____	Description	_____


GLO survey by Richmond S. Dickerson, Deputy Surveyor, under Contract #474, dated May 10, 1883 - (DCSO records, Vol. 21, Page 8780

(Intersect So. Bdy. T31S R8W at a point 15 chs. and 60 lks. East of the established SW. cor. of said Tp.)
 At this point, I set a stone 18x12x12 ins., 12" in the ground for the closing cor. to Tp. 32S R 8 and 9 W., marked CC with 6 notches on the SE. and W. edges, from which

- A Fir 12" dia., bears S.10°E., 66 lks. dist. mkd. CC T32S R8W S6 BT.
- A Fir 24" dia., bears S.10°W., 70 lks. dist. mkd. CC T32S R9W S1 BT.
- A Fir 60" dia., bears N.14°W., 29 lks. dist. mkd. CC T31S R9W S31 BT.

GLO Resurvey by Fred Mensch and Gerald A. Sorrels, Surveyors under Special Instructions, Group #35, dated Dec. 22, 1916 - (DCSO records Vol. 21 Page(s) 8849-50) & (Vol. 29 Pg. #12186)

The point for closing cor. of Tp. 32 S., Rs 8 and 9 W., located by reference to the bearing trees as described by the surveyor general; all traces of the cor. have disappeared. I perpetuate this cor., as follows: at the exact cor. point Set an iron post 3 ft. long, 3" dia., 24" in the ground for closing cor. with brass cap mkd:

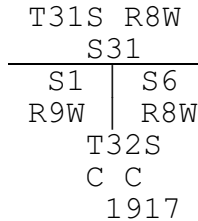

from which

- A Fir 16" dia., bears S.10°E., 66 lks. dist. mkd. CC T32S R8W S6 BT (Old BT)
- A Fir 30" dia., bears S.10°W., 70 lks. dist. mkd. CC T32S R9W S1 BT (Old BT)

Douglas Co. Surveyors Office - John M. Powell, and crew - Dec. 21, 1966 - C.S. File 54/36-69

Found - 1917 brass cap at corner, but out of ground.
 16" now 28" D.Fir S.10°E., 43.6 ft., shows good scar.
 30" D.Fir S.10°W., 54.0 ft., (not 46.2 ft.), shows good scar.

(Cont. Next Page)

TOWNSHIP 32 RANGE 09 POINT IDENTIFIER # 700700

PRIMARY CORNER DESCRIPTION NE. Cor. Sec. 1, (Tsp. Cor.)

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

60" now 55" D.Fir N.14°W., 19.1 ft., shows bark scribing.
Reset GLO 1917 brass cap at closing corner.
All bearing trees tagged and all right.
Corner lies South of road 50.0 ft. in part of fill.

BLM Dependent resurvey by Ernest Q. Lundeen, Cadastral Surveyor, under Group No. 2797, surveyed July/Aug 2015 - (DCSO records Vol. 58 Page(s) 23431)

The closing cor. of T. 32 S., Rs. 8 & 9 W., bears South, 10.95 ft., perpetuated by the Douglas Co. Surveyor's Office in 1966, as shown on the Douglas Co. Surveyor's Office corner renewal record in T. 32 S., R. 8 W., point identifier No. 109100, monumented with an iron post, 3" dia., firmly set, projecting 18" above the ground, in a collar of stone with brass cap (properly) mkd.
from which the remains of original bearing trees
A fir, 49" dia., bears S.10°E., 50.2 ft., with a healed blaze. (Record: 43.6 ft.)
A sawed and rotted fir stump, 29" dia., bears S.5°W., 43.3 ft., with a healed blaze. (Record: S.10°W., 46.2 ft.)
A sawed and rotted fir stump, 59" dia., bears N.14°W., 19.1 ft., with a healed blaze.
and a new bearing tree
A fir, 12" dia., bears S.50°W., 15.5 ft., mkd. X at breast height and BT at the base.
Each new bearing tree has a 2½"x¼" magnetic nail (Mag Nail) driven at the base on right side center
Note: The true point of intersection was not determined during course of the survey.