

-15-

County Surveyor's Record, Douglas County, Oregon

12326

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 8 W.

CHAINS

- 42.80 Esmond Creek, 15 lks. wide, course S. 80° W.
- 46.15 Unimproved road, bears N. 70° E. and S. 70° W.
- 50.00 A stream, 2 lks. wide, course S.; ascend 51 ft. over SE. slope.
- 58.20 Top of ascent, falls S.; descend 54 ft. over SW. slope.
- 58.70 Unimproved road, bears N. 75° W. and S. 75° E.
- 61.00 A stream, 2 lks. wide, course S.; ascend gradually 30 ft., along S. slope, to sec. cor.
- 65.60 A stream, 2 lks. wide, course S.
- 77.60 Unimproved road, bears N. 80° E. and S. 80° W.
- 78.74 The cor. of secs. 27, 28, 33 and 34.

Land, along bottom of Esmond Creek Canyon.
 Soil, gravelly and sandy clay.
 Timber, heavy fir, hemlock, maple, cedar, alder and dogwood.
 Undergrowth, very dense salmonberry, salal, hazel, vine maple, and bracken.

N. 0° 10' W., between secs. 27 and 28.

Ascend 180 ft. over slightly broken S. slope; through heavy timber and dense undergrowth.


- 12.50 Top of spur, slopes SW.; descend 78 ft. over NW. slope.
- 16.40 A stream, 1 lk. wide, course W.; ascend 30 ft. over SW. slope.
- 17.90 A low, short spur, slopes W.; descend 20 ft.
- 20.30 A stream, 1 lk. wide, course W.; thence along W. slope, on nearly level course to $\frac{1}{4}$ sec. cor.
- 21.50 A small draw, drains W.
- 29.90 A small draw, drains W.
- 33.00 A stream, $1\frac{1}{2}$ lks. wide, course W.
- 40.82 Point for the $\frac{1}{4}$ sec. cor. of secs. 27 and 28 as determined from the one remaining bearing tree:

A stump hole of a fallen cedar bears N. $4\frac{1}{4}$ ° E., 110 lks. dist.; the cedar is badly decayed but shows definite evidence of axe marks on the former S. face.

Definite evidence of a maple in the SW. quad. was not recovered.

At the corner point

Set an iron post, 3 ft. long, 1 in. diam., 27 ins. in the ground, with brass cap mkd.

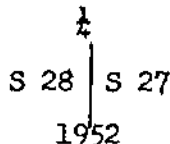

from which

*FD. JK 9/88
 W. Sims TAO
 MBK-77*