

County Surveyor's Record, Douglas County, Oregon


Corrective Dependent Resurvey
 Portion of the Subdivisional Lines,
 T. 22 S., R. 9 W., Willamette Meridian, Oregon

17911

CHAINS

Remove the iron post, destroy the marks on the bearing trees, and at the true corner point

Reset the iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

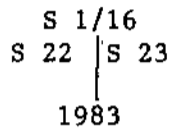

from which new bearing trees

A fir, 16 ins. diam., bears N. 19° E.,
 9 lks. dist., mkd. S 1/16 S23 BT.

A fir, 21 ins. diam., bears N. 53° W.,
 17 lks. dist., mkd. S 1/16 S22 BT.

Continue descent over NW. slope.


40.45

Point for the ¼ sec. cor. of secs. 22 and 23, at proportionate distance; there is no remaining evidence of the original corner.

From this point the ¼ sec. cor. of secs. 22 and 23, erroneously reestablished by Wofford, Rogers, and Chatters in 1973-79 bears N. 6° 27' W., 0.507 chs. dist., monumented with an iron post, 2½ ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. and witnessed as described in the official record.

Remove the iron post, destroy the marks on the bearing trees, and at the true corner point

Reset the iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

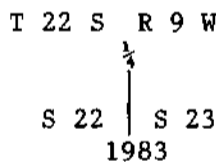

from which new bearing trees

A hemlock, 25 ins. diam., bears S. 32° E.,
 59 lks. dist., mkd. ¼ S23 BT.

A hemlock, 27 ins. diam., bears N. 11° W.,
 107 lks. dist., mkd. ¼ S22 BT.

Continue descent over NW. slope.

60.675

Point for the N 1/16 sec. cor. of secs. 22 and 23.

From this point the N 1/16 sec. cor. of secs. 22 and 23, erroneously established by Wofford, Rogers and Chatters, in 1973-79, bears N. 15° 48' W., 0.283 chs. dist., monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. and witnessed as described in the official record.