

Douglas County Surveyor's Record of
Government Corners Renewed

23 T. S. 5 R. W. W. M.

KOKE-CHAPMAN CO., EUGENE, ORE. 21881

Ben B. Irving, Co. Surv.
N.E. Richardson
C.H. Dougherty
C. Johnson
Jan. 22, 1940

C.S. 16/55

$\frac{1}{4}$ Section Corner between Sections 23 & 26. *Some as Corner #28*
Location identified from an Original Bearing Tree, a 30" Alder N.31°E. 221ks., This tree was dead & quite rotted but still standing on the bank of Pollock Creek, where chopped out, scribe marks were visible in the fungus film between the surface of the original blaze. *#7*


Drove a 1" Iron Pipe 48" long, 46" in ground for the corner & Set a Cedar Post 4" sq. 60 in. long alongside, scribed $\frac{1}{4}$ S23 *#48*
 $\frac{1}{4}$ S36, C.S. from which:

RE-NEWED CORNER NO. 48
A Fir 14" diam. bears N.21°W. 46.8 ft., blazed & scribed $\frac{1}{4}$ S 23 C.S. B.T.
A Fir 20" diam., bears S.22 $\frac{1}{2}$ °E. 64.1 blazed & scribed $\frac{1}{4}$ S 26 C.S. B.T.

James W. Byron, Deputy
Milo Godfrey
C. Putnam
August 5, 1959
C. S. File No. 49/42

$\frac{1}{4}$ Section Corner to Sec. 13, T23S R5W & Sec. 18, T23S R4W. *29*
Found - Orig. 40", now 50" Fir Snag, previously opened, shows good scribing "4 S".
No trace of Original N. E. BT. *78*

Set Brass Cap at Corner Mkd: $\frac{1}{4}$ S13 / S18 T23S County Surveyor's R5W R4W Office, 1959
New BT's: 16" Cedar bears S.13 $\frac{1}{2}$ °E. 99.0 ft. scribed $\frac{1}{4}$ S18 CS BT.
14" R.Fir bears N.35°W. 12.0 ft. scribed $\frac{1}{4}$ S13 CS BT.
Note - Scribed High above new wire fence which is thus:

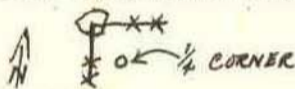

Section Corner to Sections 13-12, T23S R5W, & Secs. 7 & 18, T23S R4W. *30*
Found - $\frac{3}{4}$ " Iron Rod at Corner. *Ren #17*
All Orig. BT's. I do not open. All show scars & all check bearing & distance.

I do not set BRASS CAP.
I scribe new BT's to N.E. & N.W. because the Original BT's. to North are good saw logs. *77*
New BT's: 12" R.Fir bears N.44°E. 27.7 ft. scribed $\frac{1}{4}$ S 7 CS BT.
11" Cedar bears N.78 $\frac{1}{2}$ °W. 32.7 ft. scribed $\frac{1}{4}$ S12 CSBT.

Wilford N. Haines.
For S. Mathis
M 16 - 3

N. W. Corner Section 4, T.23 S. R.5W. *31*
Found - 36" Fir Stump of BT. S.58°E. 50 lks.
Drove 1" x 1" x 12" T. Iron into Ground next to Bank of a Road. *54*

Oct. 21, 1959

James W. Byron, Deputy
Milo Godfrey
C. Putnam
Oct. 30, 1959
C. S. File No. 49/42

Section Corner to Sections 16, 17, 20 and 21. *32*
Found - Haines T Iron at Corner. *REN #27*
Orig. 28", now 36" Fir Stump, shows good scribing "T23" N.50°E. 38.3 ft.
Orig. 20", now 40" Fir Snag S.82 $\frac{1}{2}$ °E. 13.2 ft., shows good scribing "T23S R5W S21 BT". *73*
Orig. 30", now rotted Fir Stump N.40°W. 11.9 ft.
Orig. 18", now 40" Fir, shows old scars, I do not open, S.55°W. 2.0 ft.
New BT's: 7" R.Fir bears N.61 $\frac{1}{2}$ °E. 37.9 ft. scribed S16 CS BT.
8" R.Fir bears N.84 $\frac{1}{2}$ °W. 89.6 ft. scribed S17 T23S R5W CS BT.
8" W.Oak bears S.12°E. 22.2 ft. scribed S21 T23S R5W CS BT.

See Haines renewal, Cor. No. 27.

$\frac{1}{4}$ Section Corner to Sections 17/16. *33*
At Corner Found 1 $\frac{1}{2}$ " Steel Shaft in N. & S. Fence Line.
Found rotten Stump S.85°W. 7.9 ft. with face showing scribing "BT".
No trace of N.E. BT. could be found.
Blaze & Scribe New Trees:
10" D.Fir N.65°E. 113.5 ft. Mkd. $\frac{1}{4}$ S16 CS BT".
10" D.Fir N.54°W. 96.0 ft. Mkd. $\frac{1}{4}$ S17 CS BT"