

**Douglas County Surveyor's Record of
Government Corners Renewed**


23 T. S. 5 R. W. W. M.

KOKE-CHAPMAN CO., EUGENE, ORE. 21881

James W. Byron
Milo Godfrey
Clete Putnam
Nov. 1959
C.S. File No. 49/42

39


$\frac{1}{4}$ Section Corner to Sections 8/9.
Found - Orig. 28", now 42" B. Oak N.46°E. 40.3 ft. Opened
years ago, upper face rotted and gone. I do not
open lower scar. By extending my arm through upper
opening, I am able to trace the reverse scribing "BTV."
No trace of Original NW BT. found.
Set Brass Cap at Corner Mkd: County Surveyor's Office, 1959
 $\frac{1}{4}$ S8/S9 T23S R5W.
New BT's: 20" W.Oak bears N.49°E. 46.8 ft. scribed $\frac{1}{4}$ S9 CS BT.
15" R.Fir bears N.68 $\frac{1}{2}$ °E. 49.6 ft. scribed $\frac{1}{4}$ S9CS BT.
No trees near to West.

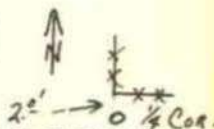

40

*fd. 12/89
C.S. 63/64*

$\frac{1}{4}$ Section Corner to Sections 19 and 20.
Found - Orig. 18", now 38" Fir Stump N.49°E. 27.7 ft. I open
near base & find good scribing "BT".
Orig. 16", now 30" Fir N.33°W. 27.1 ft., shows good
scribing on old face "BT". This BT. has been bark
scribed " $\frac{1}{2}$ S".
Set Brass Cap at Corner Mkd: County Surveyor's Office, 1959
 $\frac{1}{4}$ S19/S20 T23S R5W
New BT's: 12" R. Fir bears S.34°E. 35.8 ft. scribed $\frac{1}{4}$ S20 CS BT.

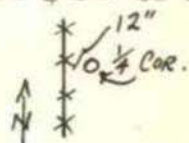

41

N. W. Corner D. L. C. No. 47.
Found - Orig. 24", now 40" W. Oak S.12°E. 45.5 ft. I open &
find good scribing "BT".
48" Oak Snag, rotted, N.25°E. No scribing found. 46.2 ft.
Find Stone at Corner chisled CL 47 on East face.
Set 3" Iron Rod alongside Corner Stone.
New BT's: 16" R.Fir bears N.71°E. 20.9 ft. scribed CL 47 NW CS BT
6" W.Oak bears S.36°E. 5.4 ft. scribed NW CL 47 CS, BT.
9/69 FOUND OK C.S. 54/16

RENEWED CORNER NO. #118

James W. Byron
Milo E. Godfrey
Clete Putnam
Nov. 27, 1959
C. S. File No. 49/42

42

$\frac{1}{4}$ Section Corner to Sections 34 and 35.
Found - 3" Iron Pipe under E.W. Fence. REN.#5
Both BT's., as recorded by BBI, 1940. BT's. are now
stumps, show good scribing.
New BT's: 16" W.Fir bears S.76°W. 29.4 ft. scribed $\frac{1}{4}$ S34 CS BT.
22" R.Fir bears S.81°E. 87.0 ft. scribed $\frac{1}{4}$ S35 CS BT.
10/69 FO. OK. C.S. 54/16

43

Section Corner to Sections 25, 26, 35, and 36.
Found - Oak Stump Holes that check bearings & distance for
Orig. SE, NW, & SW BT's.
NE BT. in log road.
10" x 2" x 15" Stone, chisled 36, 35, 26 on E W faces REN.#4
at corner.
Ralph Cockeram state this Rock has been used for the corner for
at least 20 years. He also remembers Original SE & NE BT's.
Set Brass Cap alongside Corner Stone Mkd.: County Surveyor's
Office, 1959

S26	S25
S35	S36

 T23S R5W
New BT's: 9" B. Oak bears N.46°W. 6.0 ft. scribed S26 T23S R5W CS BT.
15" Laurel bears S.31°W. 4.5 ft. scribed S35 T23S R5W CS BT.
12" Laurel bears N.17°E. 29.4 ft. scribed S25 T23S R5W CS BT.
8" R.Fir bears S.71°E. 99.5 ft. scribed S36 T23S R5W CS BT.

44

$\frac{1}{4}$ Corner to Section 35, T23S R5W, and Sec. 2, T24S R5W. M 79-77
Found - 14" W. Oa. N.16°E. 22.8 ft. scribed by Theil, 1921, shows
good scribing " $\frac{1}{4}$ ". I find stump holes only for Orig. BT's.
I, Ralph Cockeram, state that I was with Theil at this corner 1921. We
found both Orig. BT's. & soon afterward I set the existing anchor
post at $\frac{1}{4}$ corner as established by Theil. Signed statement in file.