

SPRINGFIELD
 SURVEY FILE

PUBLIC LAND CORNERS


WEYERHAEUSER TIMBER COMPANY
 SPRINGFIELD BRANCH

TOWNSHIP 24 S RANGE 3 W

SECTION 5 CORNER NW

COUNTY Douglas OREGON

23

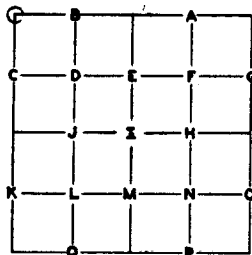

GLO SURVEY RECORD				PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)
CORNER	DATE:			
Post	1882			Gone
ACCESSORIES:				
BEARING-	LINKS-	FEET-		
7" Dogwood N 35° E	3			Gone
6" " N 55° W	50			"
12" Yew S 55° W	10			Cull log left from logging laying against tree and pushed over slightly.
30" Fir S 20° E	3			Tree OK, faint scribe marks on bark face.
G. L. O. SURVEY RECORD				PRESENT CONDITION: Pipe with brass cap bent over by logging operation.
CORNER	DATE:			
2"x3" pipe with brass cap	1950			
42" Fir S 22° E	34 links	faint scribing		OK
4" yew S 60° W	10"			Pushed over slightly by cull log against it.
18" Yew N 38 1/2° E	49"			Now dead - scribing visible
7" yew N 49 3/4° W	42"			Shattered off close to ground by logging.

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20 E

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
44" Fir stump	N 26° W	46.1		X	X	
46" Fir stump	N 13° E	52.7		X	X	
42" Fir	S 19° E	22.6	1882	X	X	
50" Fir	S 70° W	53.8		X	X	

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Logged to North, SE Residual timber, SW O. G. Timber

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) S 37° E ON MINUS (-) 64 %

NORTH: +60% for 80'

SOUTH: -60% for 200'

EAST: -24% for 60', thence steeper

WEST: +30% for 180'

FROM CORNER

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK:

BY: Marvin D. Hule DATE: 11-18-58
 ENGINEER - SURVEYOR

ASSISTED BY: H. E. Case
W. W. Dixon

COPIES SENT TO:

UNDER THE SUPERVISION OF:

SEAL PAGE 3

PAGE 1

CS 53/111-6

6