

SPRINGFIELD
 SURVEY FILE


PUBLIC LAND CORNERS

WEYERHAEUSER TIMBER COMPANY
 SPRINGFIELD BRANCH

TOWNSHIP 25S RANGE 2 W

SECTION 36 CORNER NE

COUNTY Douglas OREGON

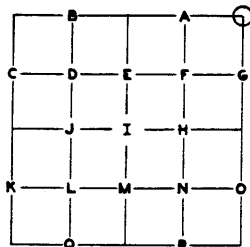

GLO SURVEY RECORD

DATE: 1883
 CORNER 6 Hemlock trees

PRESENT CONDITION - (DESCRIBE FULLY -
 USE PAGE 2 IF NEEDED FOR EXPLANATION.)

12" Hemlock - old face-squared-

ACCESSORIES:

	BEARING-	LINKS-	FEET-	
8" Hemlock	N 29 E	26	17.2	Rotten remains down Hemlock. Marks should have been obliterated by 1900 Survey
36" Fir	S 26 E	31	20.5	44" Fir - Face not opened. Marks should have been obliterated by 1900 Survey
4" Fir	S 25 W	65	42.9	6" Fir - Scribing visible.
6" Fir	N 35-1/2 W	27	17.8	8" Fir-scribing visible.

Hosford Dep. RE SURVEY RECORD

DATE: 1950
 Hosford identified the above corner tree and all BT's

PRESENT CONDITION:

CORNER SET: 12" Hemlock-common only to sections MAG. DECL.: 20°

25, 36 25S-2W

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-
N21E	17.2	Original
S26E	20.5	"
S30W	42.3	"
N39W	17.8	"

PAGE 1

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
<u>44" FIR</u>	<u>S28W</u>	<u>43.0</u>	<u>--</u>	<u>X</u>	<u>X</u>	<u>--</u>
<u>42" FIR</u>	<u>N68W</u>	<u>40.0</u>	<u>--</u>	<u>X</u>	<u>X</u>	<u>--</u>

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: VINE MAPLE

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) S60 E ON MINUS (-) 15 %

NORTH: ± 10% for 30' then ascent steepens 175' access road.

SOUTH: -10% 60' then descent increases/.

EAST: -15% for 30' across messy springs.

WEST: ± 15% 25 then ascent steepens - 210' to access road.

FROM CORNER 1

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK:

BY: L. L. McChesney DATE: 6/2/59

ENGINEER - SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY:

COPIES SENT TO:

SEAL

PAGE 3

CS 43/112-48

25