

RESTORED CORNER FOR STATE OF OREGON--DEPARTMENT OF FORESTRY

Closing corner common to Sections 15 and 22, T23S, R10W, W.M., Douglas County, Oregon.

ORIGINAL

Fir post (missing) from which a:

- 6" Fir bears N27°W 27 lks.; only decayed root system remaining.
- 12" Hemlock bears S85°W 38 lks.; now 30" in place, scribes 23 S2 BT exposed.

RESTORED

Set 1½" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T23S S15 CC S22 R10W S14 1970 RS359", 34 inches in ground, and from which a:


- 30" Hemlock (original) bears S85°W 25.1 ft.; scribed RS359.
- 25" Hemlock bears N63°W 67.1 ft.; scribed T23S R10W S15 CC BT.

Section corner 14 and 23 bears South 1.57 chains.

Set 4" x 4" x 72" white painted Cedar post 2.0 ft. N30°W of corner pipe. Oregon State Forestry Department metal location poster on original Hemlock S85°W 25.1 ft.

Dated May 19, 1970

Restored by Lloyd D. Smith under my direction.  
Lloyd D. Smith, Transitman

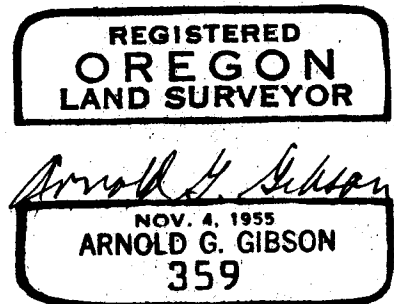

Present and witnessed by David R. Brown  
Steven F. Howard  
Robert W. Hansen

#811  
FILED  
RECEIVED

JUN 17 1970

COUNTY SURVEYOR  
DOUGLAS COUNTY, ORE.