

DATE: March 30 1981

Condition Report Only

Not Found

Renewed

Unrecorded

Surveyed In

Referenced Out

T275

518 | 517

519 | 520

R2W

Previous Renewal #'s 46

Monument(s) Found: (Condition and Source) A 2 inch DCSO brass

cap on a 1 inch iron pipe protrudes 16 inches

from ground and is leaning northeast, apparently

dislodged by a falling tree. The brass cap is

marked as follows: COUNTY SURVEYORS OFFICE

A cedar stake is lying

T275 R2W

near the brass cap

518 | 517

monument, it measures

519 | 520

1964

3x4x18 inches long, shows possible scribe marks.

Both monuments are recorded in renewal #46.

Accessories Found: (Condition and Source) An original Fir

30 ins diam. now a 33 inch DBH. D. fir bears

N 19 1/2° E, 33 ± ft. distant (as per record), tree

has healed double blaze no scribing visible.

An original Cedar, 50 ins. diam is now

gone, removed by road work. An original

Fir, 18 ins. diam. recorded as a rotted

#20 ✓

stamp and log in renewal #46 is no longer
in evidence. An original Cedar 24 ins. diam,
now a 32 inch D.B.H. Cedar bears $N 25 \frac{1}{2}^{\circ} W$, 113 feet
distant (as per record) tree has fully healed double
blaze. From renewal #46 a 37" Doug. Fir now a
31 inch DBH D. Fir RENEWAL bears $S 69^{\circ} W$, 242 feet distant
(as per record), tree has fully healed double blaze
Monument Set: (Procedure and Description) Location of


base of brass cap-pipe monument is referenced
out (measurement of accessories were checked from
this location.) Monument is lowered plumbed and
set firmly at above referenced location. Monument
now protrudes 7 inches from ground.

Cedar stake is lain next to monument.
New Accessories: (Description) A 12 inch D.B.H. Cedar

bears $S 15 \frac{1}{2}^{\circ} E$, 73 feet distant and is scribed
T 27 S R 2 W S 20 C 5 BT on a double blaze.

New DCSO bearing tree tags are placed
on all bearing trees.

Location and Comments: 19°E Compass Declination
DCSO Agency
Deputy Stephen John Flause Party Chief
Stephen John Flause Notekeeper
DEBBIE STEWART Witnesses *OK [Signature]*

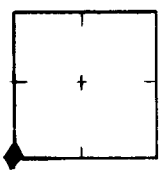

How was corner identified? BRASS CAP

Condition of corner: IT HAS BEEN DISTURBED BY A FELLED TREE. THE PIPE IS STILL IN THE GROUND BUT IT IS LEANING

Best route to reach corner: CORNER IS APPROX 15 ft WEST OF BLM ROAD # 27-2-17-0. BLM LOCATION TAG IS ON TOP OF CUT BANK. BRASS CAP IS 10 ft WEST OF TAG

Quadrant	NE	NW	SE	SW
Species & Size				
Dist. & Bearing				
Condition of Scribe				
Original or Resurvey				
Appearance of B.T.				
Tags, Marks, etc.				

Other Remarks:

C. S. File No. 61/19-20 Shary Brooks ^{Resident} _{BLM}
 Signed
 Forester - North Umpqua