

DATE: April 1, 1981

T215

$\frac{1}{4}$  S1  
S12

R10W

Condition Report Only

Not Found

Renewed

Unrecorded

Surveyed In

Referenced Out

Previous Renewal #'s 1957 BLM Rehabilitation

Monument(s) Found: (Condition and Source) A 2 1/2 brass cap

on a rusted and broken 1 inch diam. iron pipe <sup>which</sup> is firmly set and protruding 10 inches above the ground.

The cap is marked as follows: US GENERAL LAND OFFICE SURVEY

Brass cap fell loose from

the iron pipe during the

investigation of the accessories.

$\frac{1}{4}$  S1  
S12  
1919

Accessories Found: (Condition and Source) The original 30 ins. diam. Fir Northeast bearing tree is now a nearly obliterated stump hole agreeing well in location with original record bearing, and distance. An original Cedar 18 ins. diam. now 20 inch D.B.H. Cedar bears S 80° W, 19 ~~2~~ feet distant (as per record) and has an opened blaze with no scribing visible. From the 1957 BLM rehabilitation the following two trees.

#52 ✓

A fir, 70 ins. diam. now a fir stump 30 inches tall and 72 inches in diameter, bears N 63° E, 40 ± feet distant (as per record) and tree has good evidence of a blaze. A fir 52 ins. diam. now a D. Fir 55 inches DBH. bears S 41° E, 75 ± feet distant (as per record) and tree has a well healed and clearly identifiable double blaze.

RENEWAL


Monument Set: (Procedure and Description) Found monument location is accepted, monument is referenced out and then removed.  
In referenced location is placed a standard DCSO, 2 1/2<sup>inch</sup> brass cap on a 1 inch x 30 inch long, iron pipe. Brass cap is marked as follows:  
New cap is firmly set and protrudes COUNTY SURVEYORS OFFICE 9 inches above ground.

New Accessories: (Description)

T 215  
 1/4 S 1  
 S 12  
 R 10W  
 1981


A 10 inch D.B.H. Hemlock bears  
S 62 1/2° E, 28 ± feet distant and is scribed 1/4 S 12 CSBT  
on a double blaze (tree also has an injury scar approx  
12 inches long and 36 inches above the ground on its north  
face). All trees are tagged with DCSO, BT tags.

Location and Comments:

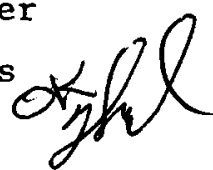19° E Compass Declination  
DCSO Agency  
Deputy Stephen John Flause Party Chief  
Stephen John Flause Notekeeper  
Karen Muechly Witnesses  


Section 1 Twp 24<sup>th</sup> S Rge 10 W

Date: 2/21/77

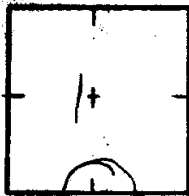

How was corner identified? BRASS CAP G.L.O. 1/4 1/2

Condition of corner: NEEDS NEW PIPE, CONCRETE CORE IS CRACKED, BRASS CAP IS ATTACHED

Best route to reach corner: FROM IP 20-10-36.0 WALK DOWN SPUR RIDGE ABOUT 300'

1081  
14601

Quadrant	NE	NW	SE	SW
Species & Size	60" FIR			20" CEDAR
Dist. & Bearing	61 LKS N 63° E			30 LKS. S 80° W
Condition of Scribe				
Original or Resurvey	ORIG.			
Appearance of B.T.				
Tags, Marks, etc.	TAG			TAG

Other Remarks:

GROUND IS SHALLOW WITH ROCK BELOW

Robert E. Kuss  
I.P. Co. Signed

6/1/1977