


SECOND RE-ESTABLISHMENT

GCDB 540500

**DOUGLAS COUNTY
SURVEYOR**

Quarter corner common to Sections 11 and 14 of Township 30 South, Range 3 East, W.M.

Found at corner position , exposed 4 ins., the 1 in. diam. galv. iron pipe with a 2½ ins. diam. brass cap set by the GLO in 1928 and marked:

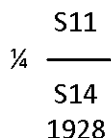

Original bearing trees recorded by H. Raymond of the GLO in 1928 found with healed blazes and measured to center at base;

Fir rotted sawed stump with reversed scribe brs. record S86½°W, 55.5 ft.

P. pine dead, down, and rotted, brs. record N7°W, 9.5 ft. to center of stump hole

Bearing tree marked on 1st re-establishment in 1978 found with healed double blaze and measured to center at lower blaze;

D. fir now 28 ins. diam. brs. record S2½°W, 23.1 ft.

Marked new bearing trees "CS" "BT" and measured to center at lower blaze:

D. fir 8 ins. diam. brs. S68°E, 32.1 ft.

D. fir 9 ins. diam. brs. N82°W, 10.1 ft.

D.fir 45 ins. diam. marked with 3 notches facing monument brs. N40½°E, 9.8 ft

Corner lies approx. 1300 ft. west of bend in gravel road.

August 10, 2009

B. Beeman

H. Durkee

Kerry K. Bradshaw

Jackson County Surveyor

P – 177

V – 15°15'