

BT6  
COUNTY SURVEYOR'S RECORD  
OF  
RE-ESTABLISHED GOVERNMENT CORNERS

Decl. Compass 17° E Mo. December 22 Day 2014 Year No. Book Page

Old Monument Byron 1957 Book 12, Pg. 13  
Found 2 1/2" brass cap on a 1 1/4" iron pipe, Douglas County Surveyor, 0.7' tall, in good condition but loose in the ground. We set a Douglas Fir post 3" North and paint the top in blue.


Old BT Byron 1957 Book 12, Pg. 13  
Found a 28" Hemlock, N 47° E, 39.20' to found nail at left side center. We find a G.P. tag in place. We paint a band around the tree in blue. GOOD

Old BT Byron 1957 Book 12, Pg. 13  
Found a 31" Hemlock, S 77° 30' E, 17.36' to right side center. We find a healed blaze and 2 BLM tags in place. We paint the face and a band around the tree in blue. GOOD CONDITION

Old BT GAYRON 1962 G 27, Pg. 051  
Found a 22" Hemlock, S 14° 30' W, 20.39' to right side center. We find a healed blaze and 2 BLM tags in place. We paint the face and a band around the tree in blue. GOOD CONDITION

New BO  
A 17" Douglas Fir stump, 1' tall, N 81° W, 39.21' to a spike and Coos County washer driven in at heart center. We paint the top of the stump in blue and attach a yellow Coos County tag.

Present:  
Matthew Martin  
Bill Hales  
Michael L. Dado

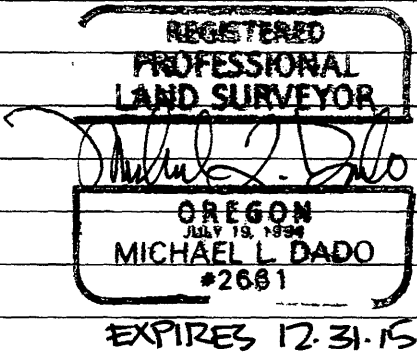

FILED  
Date: 3-9-2015 By: JC  
This survey consists of:  
Map \_\_\_\_\_  
Name \_\_\_\_\_  
Corner Lot: C565/87-29  
DOUGLAS COUNTY  
SURVEYOR