TOWNSHIP 27 RANGE 07 POINT IDENTIFIER # 400140

PRIMARY CORNER DESCRIPTION 1/4 Corner for Secs. 33 & 34

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

Original - Dennis Hathorn, Deputy, under Contract #57 dated April 12, 1855 (DCSO records, Vol. 12 Page 5247)

Set ¼ sec. post, from which
A B.Oak 18" dia., bears N.76°W., 39 lks. dist.
A B.Oak 12" dia., bears S.72°E., 60 lks. dist.

GLO survey by Fred Mensch, under Contract #109 dated 1924 (DCSO records, Vol. 14 Page 5860)

Intersect the ¼ sec. cor., located by record bearing and distance from the original NW bearing tree, old blaze open and marks plain. Old bearing tree in sec. 34 is not found. At the exact cor. point, Set an iron post, 3 ft. long 1" dia., 28" in the ground, for ¼ sec. cor., with brass cap mkd.

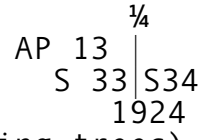

from which (new bearing trees)
A B.Oak 18" dia., bears N.44 3/4°E., 230 lks. dist. mkd. ¼ S 34 BT.
A B.Oak 20" dia., bears N.26°W., 61 lks. dist., marked ¼ S 33 BT.
Original bearing tree, an Oak, now 28" dia., bears N.76°W., 39 lks. dist.

Doug. County Surveyors Office - James W. Byron, Deputy Milo Godfrey; Clete Putnam - Nov. 1960 - C.S. File 49/79-59

Found - Brass cap set in 1924, in good condition.
Orig. Oak, approx. 30", N.76°W., 25.7 ft. Still standing but center completely rotted away.
20" B.Oak N.26°W., 40.3 ft. is uprooted & down.
No trace found of NE BT. (1924)
24" D.Fir N.42°W., 50.0 ft. with recent scribing showing in still open blaze.
Blaze and scribe:
16" Madrone N.77°E., 34.0 ft. mkd: "¼ S34 CS BT".

Fd. & used BLM resurvey by Philip G. Griffin, Cadastral Surveyor, under Group # 1529, surveyed April/July 1990 (DCSO Records Vol. 50 Page(s) 19137-38)