Douglas County Surveyor's Record of Government Corners Renewed

T25 S . T. S. R 5 W R.W.W.M.

KOKE-CHAPMAN CO., EUGENE, ORE. 21881

70

Section Corner to Sections 22 - 23 - 26 - 27.
Found - New 30" Stump S.42½°W. 16.6 ft., shows good bark scribing "BT".
REN.# 15
New 30" Stump N.49½°E. 50.3 ft., bark gone, no scribing.
30" Fir Stump S.49½°E. 36.6 ft., shows good bark scribing.
Note - Corner Fence Post at Sec. Cor. - Set Brass Cap alongside & marked County Surveyor's Office, 1960 T25S R5W

S22	S23
S27	S26

New BT's: 5" R.Fir bears S.68°W. 12.7 ft. scribed S27 T25SR5W CS BT.
10" R.Fir bears N. 6°W. 43.9 ft. scribed S22 T25S R5W CS BT.

James W. Byron, Deputy County Surveyor
Milo Godfrey
Clete Putnam
May and June 1960
C. S. File No 49/124

71

¼ Section Corner to Sections 24 and 25.
Found - Orig. 16", now 40" B. Oak N.54°W. 63.4 ft., shows old scars opened years ago, center rotted.
Shell of large Oak Stump that checks bearing & dist. for orig. S.E. BT., no scribing found at either BT. I believe that these were the Orig. BT's.
Also the call to West Top Ridge checks O. K.
Set Brass Cap at Corner Mkd: County Surveyor's Office, 1960

¼	S24
	S25

T25S R5W

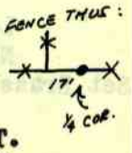

New BT's: 19" R.Fir bears S.39°W. 25.0 ft. scribed ¼ S25 CS BT.
20" R.Fir bears N. 9°E. 27.2 ft. scribed ¼ S24 CS BT.

72

Section Corner to Secs. 35 & 36, T25S R5W, & Secs. 1 & 2, T26S R5W.
Found - Orig. 24" , now 44" Fir S.42½°E. 4.6 ft. I open & find good scribing.
Laurel Trees, now mostly rotted, that check for orig. N.W. & N.E. BT's.
#151
No trace of Original S.W. BT. found.
Set Brass Cap at Corner Mkd: County Surveyor's Office, 1960

S35	S36	T25S
S 2	S 1	T26S

R5W

New BT's: 18" R.Fir bears N.53°E. 12.4 ft. scribed S36 T25SR5W CS BT.
11" Maple bears N.37°W. 10.1 ft. scribed T25S R5W S35 CS BT.
10" R.Fir bears S.22°W. 59.0 ft. scribed T26S R5W S 2 CS BT.

RE-RENEWED, SEE CORNER NO.

James Byron
For Ed Russell
April 1955
C. S. File No. 47/12

9/86 FD OK PER M102-48 BY BENTZ & M106-4

73

Renew Township Corner: R6W R5W

S36	S31	T25S
S 1	S 6	T26S

Found: 1½" Iron Pipe at fence int. Use 1½" I. P. for Sec. Cor.
All Original Bearing Trees gone.
Blzd & Scribed: 10" R.Fir N.17°E. 146.0 ft. S31 T26S R5W CS BT.
16" R.Fir(Stool of) S.84°E. 600.0 ft. S6 T26S R5WCSBT.
No other trees near.
1963 GOV'T BRASS CAP SET - VOL. 32, PG. 13362

74

Renewed Section Corner to Sections 27, 26, 34 and 35.
Found - All four of Cole's BT's:
REN. #17-18
24", now 24", down & partly burned Oak S.54½°W. 91.3 ft.
24", now 28" Fir Stump S.46½°E. 13.0 ft. I open & find good scribe marks.
N. E. BT. now base of Fir Stump only.
N. W. BT. now Stump, checks record bearing. Distance should be 37.0 ft., record 27.0 ft.
Set Brass Cap at Corner Mkd:

S27	S26	T25S R5W
S34	S35	County Surveyor's Office, 1960

94

New BT's: 10" R.Fir bears S.66°W. 73.5 ft. scribed T25S R5W S34 CS BT.
15" R.Fir bears N.17°W. 74.4 ft. scribed T25S R5W S27 CS BT.
12" R.Fir bears S.41°E.113.9 ft. scribed T25SR5W S35 CS BT.
R.Fir bears N.27°E. 63.6 ft. scribed T25S R5W S26 CS BT.

RE-RENEWED, SEE CORNER NO.

James W. Byron - M. Godfrey
July 1960
C.S. 49/124