GOVERNMENT CORNER RESTORATION FORM

Township 30S Range 4W Sec. 34 County DOUGLAS

State OR. Date 12-10-81 No.

Corner Designation

T 30 S
AP S 34 / S 3 R 4 W
T 31 S

___ Condition Report Only
___ Not Found
✓ Renewed
___ Unrecorded
___ Surveyed In
___ Referenced Out

MONUMENT DETAIL

Previous Renewals 2 RESURVEYS, REN #162, REN #251

Monument(s) Found: (Condition and Source)

FD. 3/4" IR PER REN. #251 STILL 2.6 FT. FROM 40" FIR PER REN. # 162, HOWEVER THE FIR WAS BLOWN OVER IN A RECENT WINDSTORM TAKING THE IR OVER WITH IT.

Accessories Found:

FD. 30" NOW 27" CEDAR WITH SCRIBED "¼S34 BT" IN BARK PER REN #162

FD. 10" NOW 12" MADRONE, PARTIALLY UP-ROOTED, WITH ROTTED FACE VISIBLE IN PARTIALLY HEALED BLAZE, PER REN. #162.

FD. 14" NOW 17" CHINQUAPIN PER REN. #162 WITH SCRIBED "¼S3 R4W BT" VISIBLE.

+ 28 : T 30 : 4 W
+ 1 : T 31 : 5 W

G.S. File No. 61/30-1

RENEWAL

Monument Set (Procedure and Description)

USING REC. BEARING & DIST. FROM 30" NOW 27" CEDAR (S27W 6ℓ) I ESTABLISH TEMP. POSITION FOR CORNER. FROM THIS POSITION I CHECK BEARINGS & DIST'S TO MARKHAM'S BT'S PER REN. #162. BEARING & DIST TO 10" NOW 12" MADRONE MATCHES RECORD (S52W 24ℓ FT) TO WHAT I DETERMINE TO BE CENTER OF TREE BEFORE BEING PARTIALLY UP-ROOTED BEARING & DIST. TO 14" NOW 17" CHINQUAPIN DIFFER BADLY FROM RECORD. BT NOW BEARS S72W 37ℓ FT. RECORD PER REN #162 IS S62W 33ℓ FT. SINCE THE TEMP. POSITION FITS TWO BT'S WELL AND ALSO FALLS IN THE ROOT HOLE WITH A GOOD RELATIONSHIP TO THE APPROX CENTER OF HOLE I SET A 1"×30" IP WITH BRASS CAP, MARKED AS PER DETAIL ON RT, AT THE LOCATION OF THE TEMP. POSITION.

Monument Detail

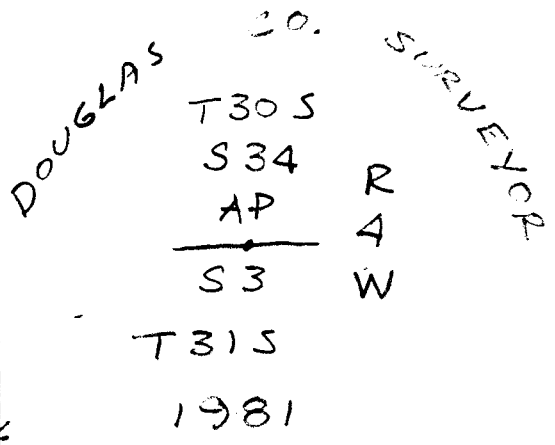

New Accessories

6" FIR SCRIBED "AP S34 CS BT" IN DOUBLE BLAZE BEARS N51E 12ℓ.

8" FIR SCRIBED "AP S34 CS BT" IN DOUBLE BLAZE BEARS N79E 39ℓ.

Sketch of Monument, Acessories, and General Area

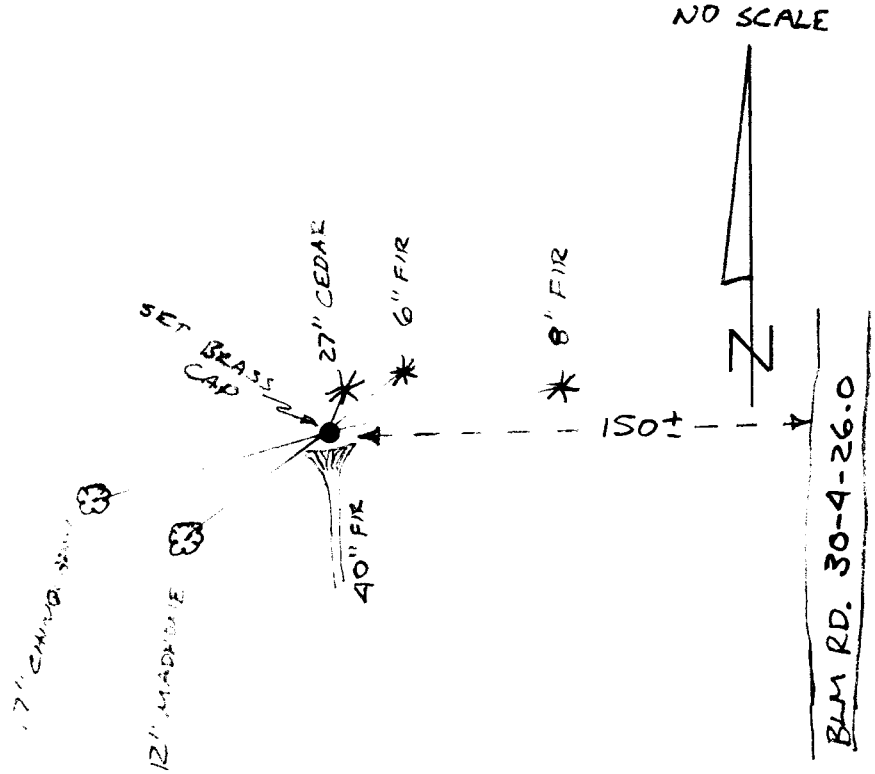

Location & Comments

Comp. Declin. 19° E
Agency DCSO
Party Chief GREG QUIBELL
Notekeeper Gregory E. Quibell
Witnesses TERESA BULEY
JOHN POWELL

Surveyor's Seal