FILED
Date: 6/11/2012 By: JC
This survey consists of:
Map: _____
Narrative: _____
Corner Rpt: CS 65/77-2
DOUGLAS COUNTY
SURVEYOR

OREGON CORNER RESTORATION FORM

Section 5 Township 31 South, Range 9 West
County Douglas Date 8 June 2012

Corner Description
CN 1/16
Section 5

___ Condition Report Only
___ Not Found
_X_ Renewed
___ Unrecorded
___ Surveyed In
___ Referenced Out

Previous Renewals / Surveys, etc.
C.S. 55 / 23

Monument (s) & Accessories Found: (Condition and Source)
No monument found
38" Port Orford Cedar stump South 27.7' – no marks
46" D. Fir stump N 7° E (record N 6° E) 70.0' (record 69.3' – partial blaze visible

Monument Detail

Sketch

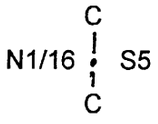

2012
54633LS

Monument Set (Procedures and Description)
Set 5/8" X 30" rebar with 2 ½" aluminum cap – marked as shown
Set by bearing – distance from Port Orford Cedar bearing tree per record data C.S. 55 / 23
Record data did not produce a distance - distance intersection between Cedar and Fir bearing trees.

New Accessories
14" D. Fir bears N 88° E 13.5' – blazed, scribed CN 1/16 S5 BT
13" D. Fir bears S 16° W 3.8' – blazed, scribed CN 1/16 S5 BT

Location & Comments
Corner has steel post adjacent to it. All BT's have red painted bands and yellow tags.

Compass Declination 16° East
Firm/Agency Northwest Land Surveying Inc.
Address P.O. Box 2827
Florence, OR 97439
Party Chief Ron Rice
Notes _____
Witness Jason Collver

Surveyor's Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR
Ronald L. Rice
OREGON
JULY 9, 2002
RONALD L. RICE
54633LS

RENEWS: 12-31-2012

C.S. FILE 65/77-2