COUNTY SURVEYORS FILE DATA
DO NOT REMOVE FROM OFFICE

SURVEY FOR U.S. FOREST SERVICE

IN SECTION 12, T.30S., R.IW., DOUGLAS COUNTY, OREGON

BY UMPQUA SURVEYING COMPANY, MYRTLE CREEK, OREGON

JANUARY 1978 SCALE 1"=500'

FILED
RECEIVED
APR 19
COUNTY SURVEYOR
DOUGLAS COUNTY, ORE.

MAP FILE M45-80

I, WILLIAM J. RUPPERT, a registered professional land surveyor in the State of Oregon hereby certify that that plat and the notes hereon, or attached, are a correct representation of a survey I performed during September 1977 thru March 1978, for the U.S. Forest Service, in accordance with statutes of the State of Oregon and with the Articles of the contract.

WILLIAM J. RUPPERT

REGISTERED OREGON LAND SURVEYOR
JULY 12, 1968
WILLIAM J. RUPPERT
866

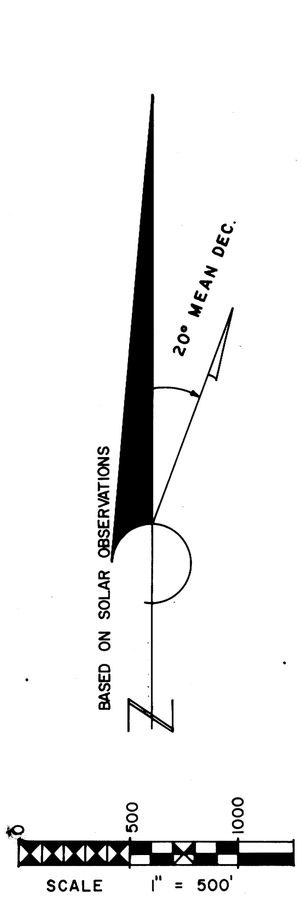

NOTE:
DISTANCES SHOWN ARE NOT REDUCED TO SEA LEVEL.

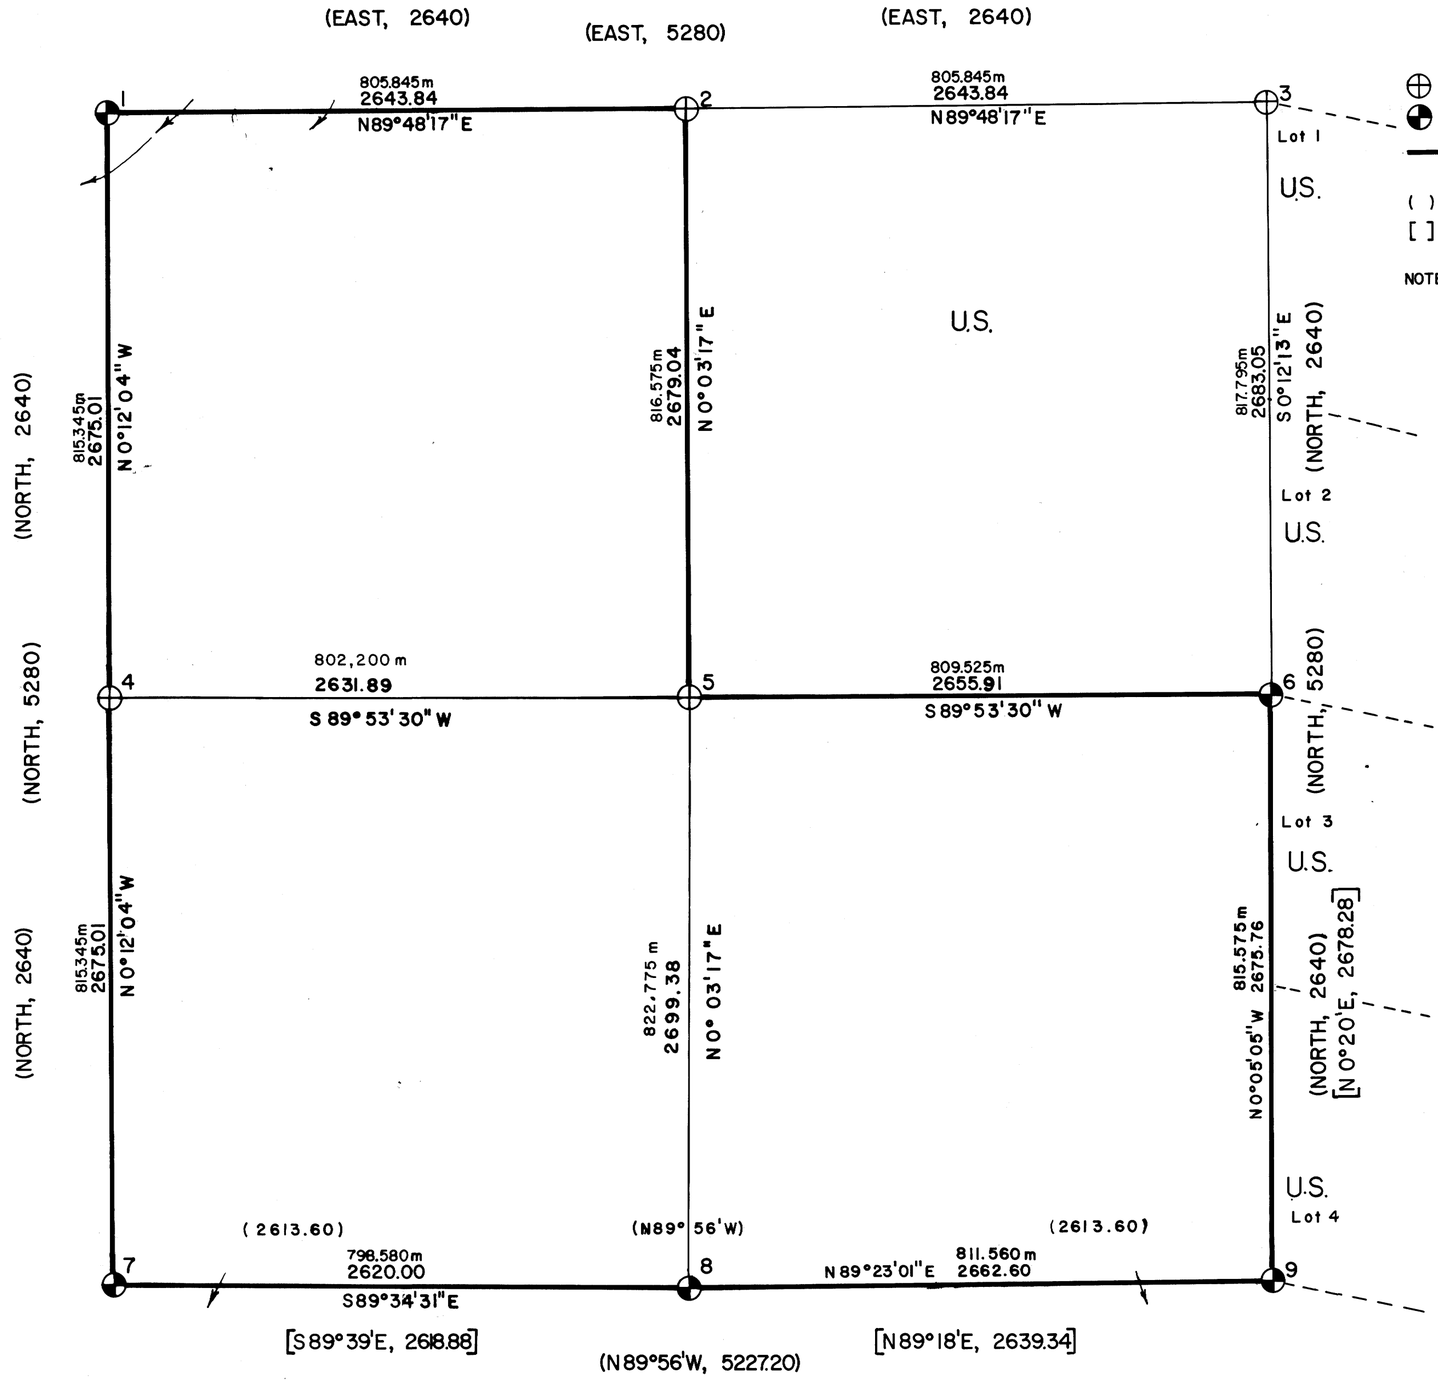

LEGEND

- ⊕ SET BRASS CAP
- ◐ FOUND BRASS CAP
- ▬ TRUE LINE POSTED WITH STEEL FENCE POSTS AND GOVERNMENT PROPERTY SIGNS
- ( ) RECORD CALLS — GLO PLAT 1858
- [ ] RECORD CALLS — GLO PLAT 1923

NOTE

ALL MONUMENTS SET ON THIS SURVEY ARE 2"x30" GALV. IRON PIPES WITH 2 1/2" BRASS CAP.

ALL BEARING TREE DIMENSIONS INDICATE THE DIAMETER OF THE TREE AT CHEST HIEGHT.

ALL BEARING TREE DISTANCES AND BEARINGS ARE FROM THE CENTER OF THE MONUMENT TO CENTER OF THE TREE AT ROOT CROWN.

SCRIBED BEARING TREES HAVE A BRASS WASHER STAMPED LS 866 NAILED IN LOWER BLAZE.

DISTANCES TO BEARING TREES ARE IN FEET.

1 — US. P.C. PROP. COR. T30S RIW 2 | 1 / 11 | 12 1967 RE 4287 DO NOT DISTURB

FOUND: 1/2" pipe with a 2 1/2" brass cap
8"CEDAR N03°05'E, 11.6 VIS. SCR.
6"CEDAR S33°55'W, 22.9 VIS. SCR.
8"W.FIR N44°01'E, 22.0 VIS. SCR.
12"D.FIR S04°20'E, 23.8 GOOD SCAR

2 — T30S RIW 1/4 S1 / S12 RLS 866 1978

SCRIBED
15"D.FIR N12°51'W, 24.4 "1/4 S12 BT"
7"W.FIR S60°15'W, 5.3 "1/4 S1 BT"

3 — T30S RIW API S1 S12 RLS 866 1978

SCRIBED
12"W.FIR N 31°03'E, 24.6
6"W.FIR S 56°11'E, 10.0
FOUND
STUMP S52°E 17.2 SCR. "BT"

4 — T30S RIW 1/4 S11 | S12 RLS 866 1978

SCRIBED
11"W.FIR **S58°21'W, 46.9** "1/4 S11 BT"
10"W.FIR **S83°39'E, 32.3** "1/4 S12 BT"

5 — T30S RIW C1/4 · S12 RLS 866 1978

SCRIBED
8"W.FIR N59°09'W, 5.9 "C1/4 S12 BT"
8"D.FIR N62°34'E, 3.0 "C1/4 S12 BT"

6 — COUNTY SURVEYOR T30S RIW 1/4 S12 1976

FOUND: 1" pipe 2 1/2" brass cap
32"CEDAR N12°16'W, 5.7 GOOD SCAR
14"D.FIR S35°02'E, 7.2 GOOD SCAR
20"CEDAR S 33°41'W, 9.4 VIS. SCR.

7 — U.S. GENERAL LAND OFFICE SURVEY T30S RIW S11 | S12 / S14 | S13 1923

FOUND: 1" pipe with 2 1/2" brass cap
21"D.FIR N83°04'W, 21.7 GOOD SCAR
12"D.FIR N33°50'E, 20.4 VIS. SCR.
18"D.FIR S53°56'E, 47.6 VIS. SCR.
6"CEDAR WINDFALL S31°32'E, 24.0 VIS. SCR.
18"PINE S07°38'W, 23.3 VIS. SCR.

8 — U.S. GENERAL LAND OFFICE SURVEY 1/4 S12 / S13 1923

FOUND: 3/4" pipe with 2 1/2" brass cap
32"P.PINE N19°24'W, 87.4 GOOD SCAR
10"D.FIR N10°10'E, 10.0 VIS. SCR.
37"P.PINE S27°21'E, 103.5 GOOD SCAR
15"D.FIR FALLEN S37°25'W, 10.8 GOOD SCAR
SCRIBED
13"D.FIR S65°19'W, 58.6 "1/4 S13 BT"

9 — U.S. GENERAL LAND OFFICE SURVEY T30S S 12 / S 13 R IW 1923

FOUND: 1/2" Pipe with 2 1/2" Brass cap
21"Ash N30°24'W, 118.1 good scar, rotted face
22"D.Fir S11°48'W, 190.8 opened prior
10" D.Fir N 62°25'W, 35.8 good scar
20" D.Fir S 37°13'W, 32.8 good scar

NOTE: BEARING TREE LOCATIONS OF 1923 SURVEY DO NOT AGREE WITH RECORD. MONUMENT LOCATION USED PER TELEPHONE CONVERSATION L. MURPHY, BLM PORTLAND OFFICE MARCH 27, 1978

TILLER LAND SURVEY NO. 22 CONTRACT NO. 02292 (R6-15-77-86)

MAP FILE M45-80

COUNTY SURVEYORS FILE DATA
DO NOT REMOVE FROM OFFICE