COUNTY SURVEYORS FILE DATA
DO NOT REMOVE FROM OFFICE

LEGEND

- ⊕ SET CORNER MONUMENT
- ◒ FOUND CORNER MONUMENT
- —— LINE POSTED WITH STEEL FENCE POSTS AND GOVERMENT PROPERTY SIGNS
- [ ] COURSE PER G.L.O. PLAT 3/6/06
- (( )) COURSE PER M 37-18 OF DOUGLAS COUNTY SURVEYORS FILES
- ( ) COURSE PER M 29-27 OF DOUGLAS COUNTY SURVEYOR'S FILES

REGISTERED PROFESSIONAL LAND SURVEYOR

Romanso E. Ware

OREGON NOV. 16, 1973 ROMANSO E. WARE 1005

200 100 50 0 100 200 400 600 800 FEET

SURVEY FOR U.S. FOREST SERVICE

Sec. 10, T. 27 S., R. 2 W., W.M., Douglas County, Oregon.

B.H.W. ENG. & SURVEYING INC.

June 1978 Scale 1" = 400'

M70-24

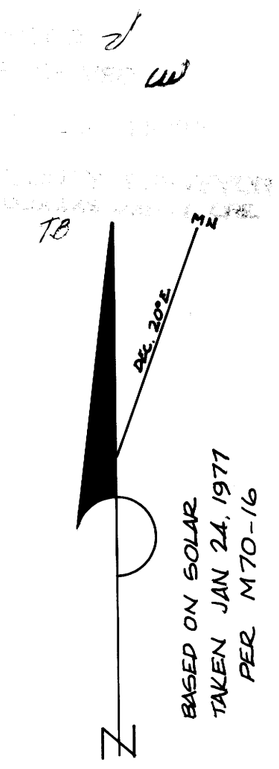

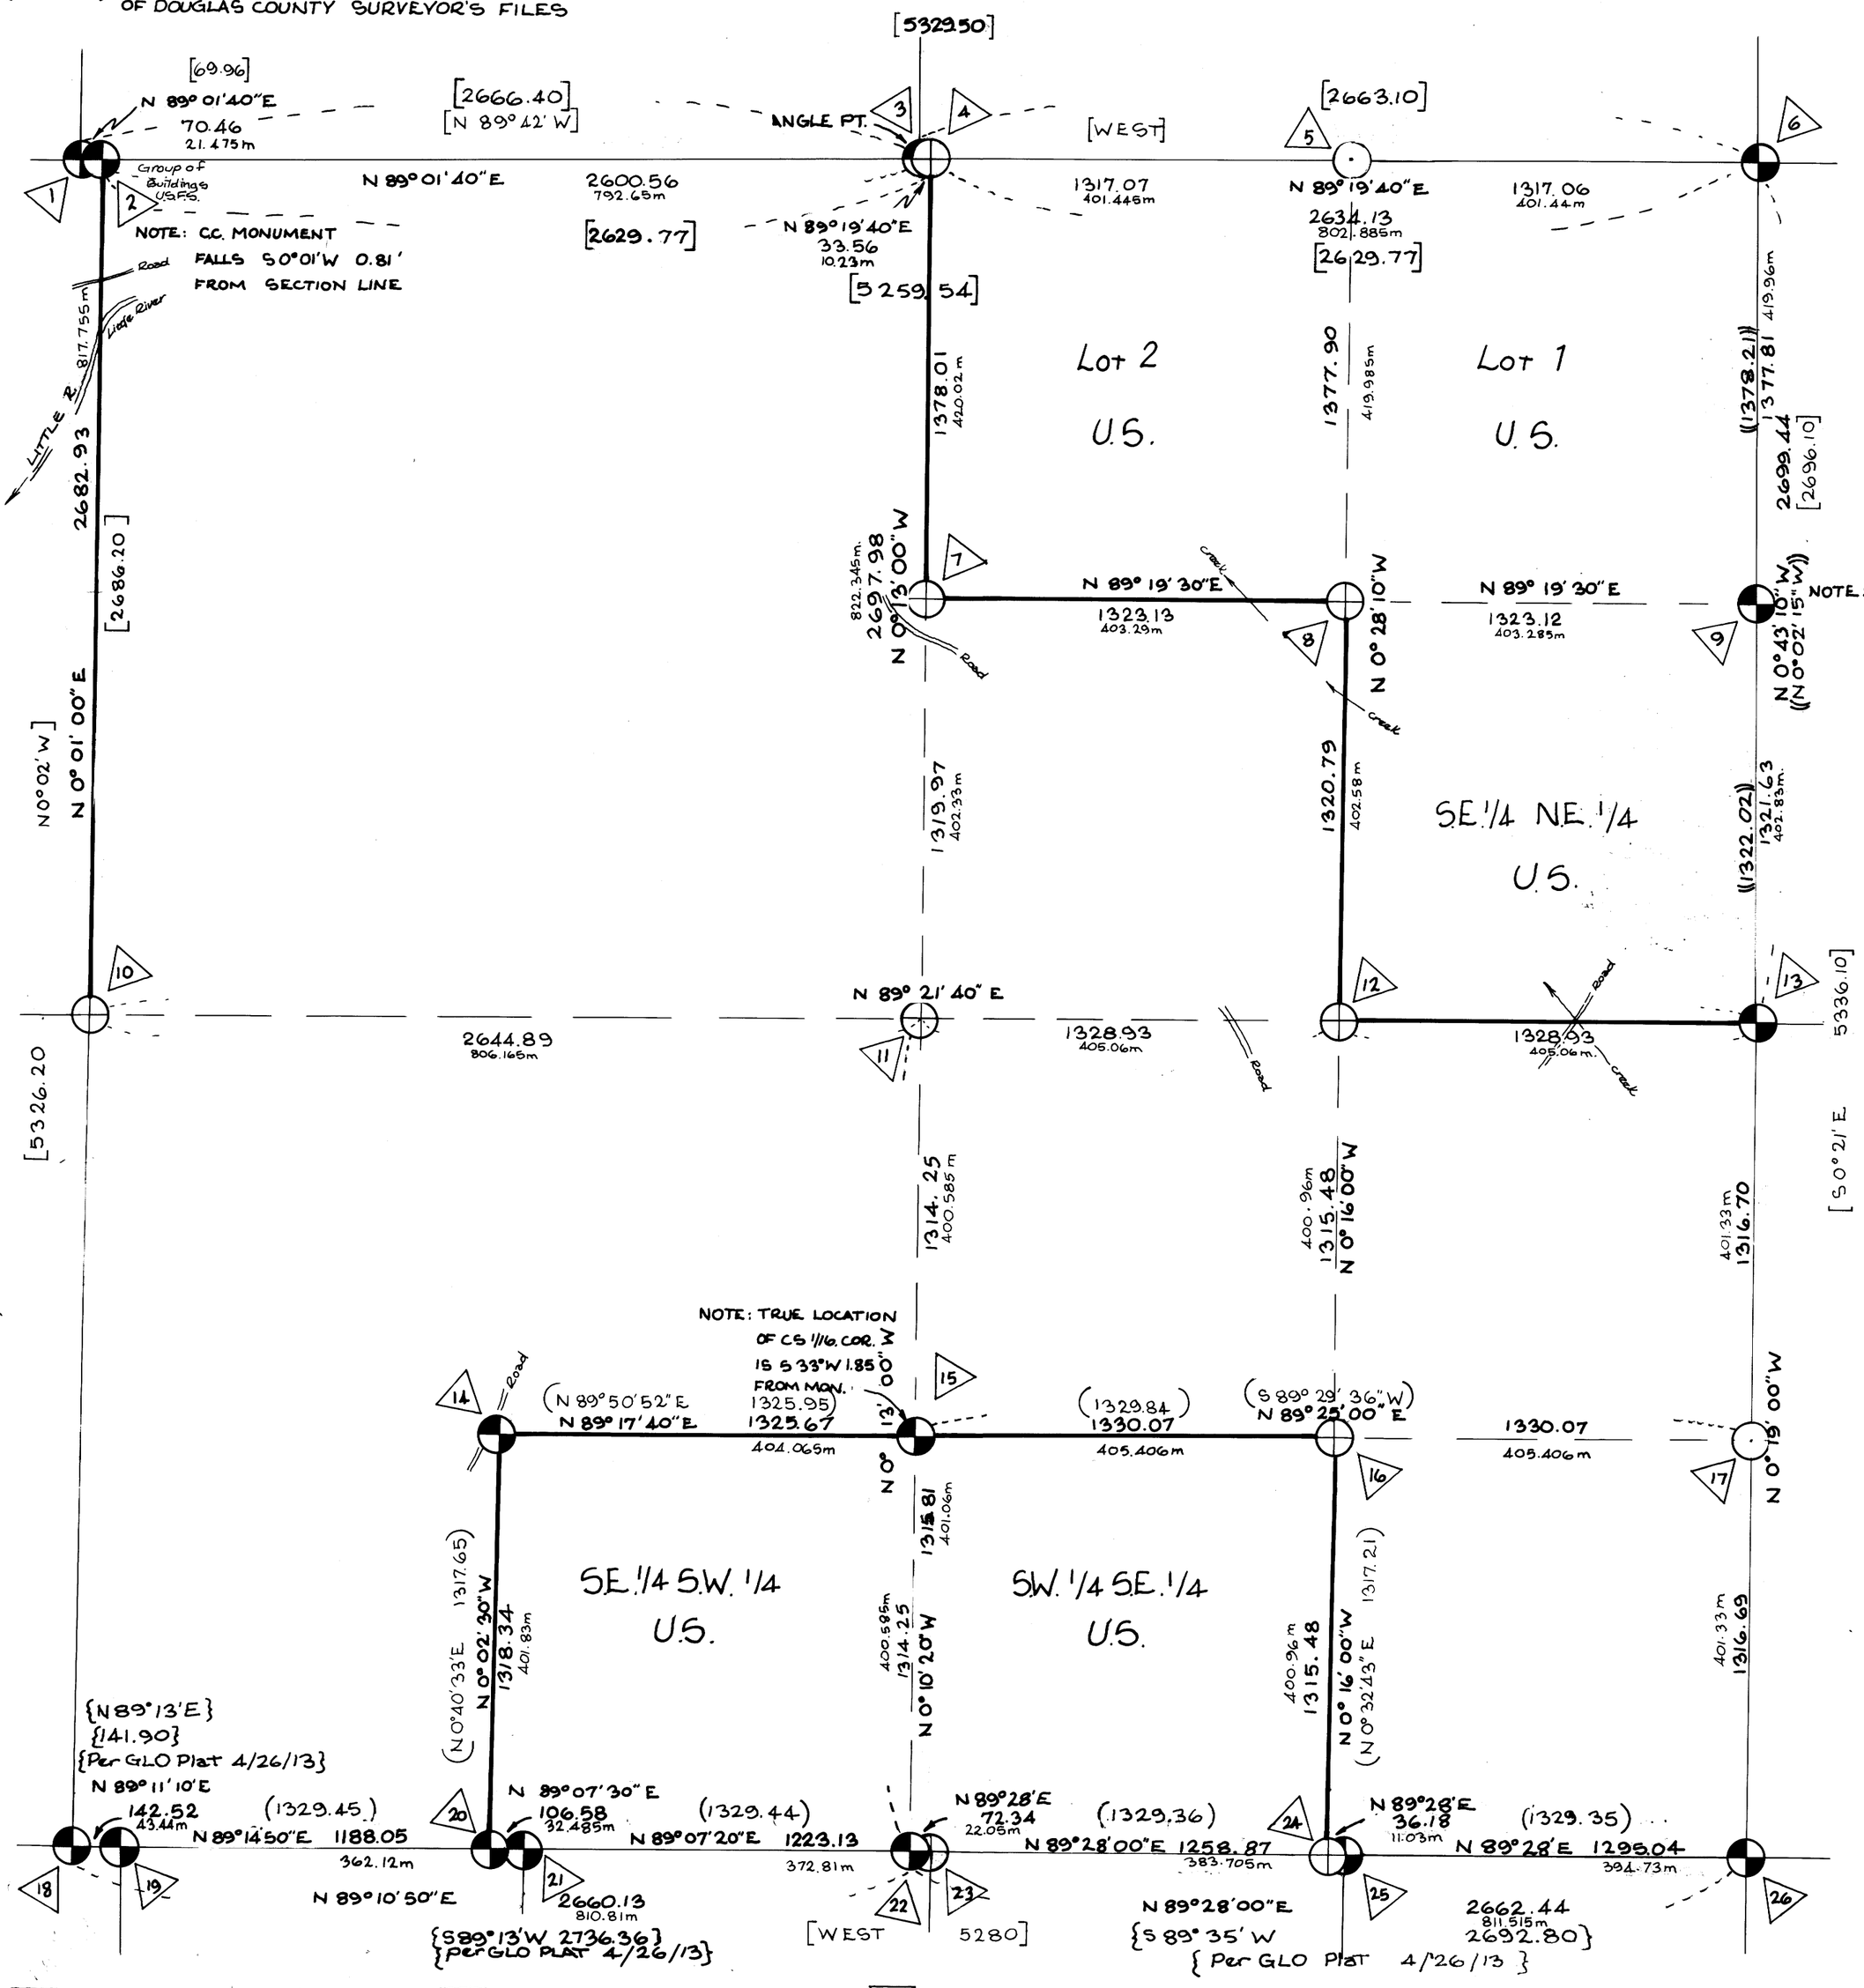

1 Found 1" iron pipe c 2½" BC 30" Fir stump N51½° W 93.1' scribing vis. "T27S, R2W, S4 BT" 16" Cedar N24½° W 81' some scribing vis. 10" D. Fir N24½° E 46.3' Good Scar NE Cor. F.S. Bldg. (old bunkhouse) bears S43° W 41.5'.

2 Found 1½" Galv. iron pipe c Brass Cap Sugar Pine (down) N13½° E 12½ FT. scribes vis. "CS S3, T27S, R2W" D. Fir stump S78° E 31' vis. scribes. 16" D. Fir (down) N79° W 70.6' vis scribe. 8" Fir log N13° E 12.9' Down & rotted 28" Fir S42° W 103.6 Healed face 16" Fir S5° W 70.6 Healed face 18" Fir S18° E 62.2 Healed face

3 Found - recently repositioned Brass Cap (Marked as shown) 15" Fir N42¾° W 40.6' "1/4 S3 CS BT" Roothole & 10" Hemlock N2° E 64' "1/4 S3 CS. BT" 12" White Fir N47° 1/4 E 47.8 "1/4 S3 BT"

4 Set 2½" iron pipe c 3" B.C. (marked as shown) in mound of stones Scribed - 13" W. Fir S85° W 45.7' "½ S10 BT" Found 8" Hemlock S8° E 38.1' "S10 N¼ BT" 3/4" iron rod c 2½" Alum. Cap bears S13° 23' E 7.4' from true corner. SEE NOTE BELOW

5 NOT MONUMENTED CALCULATED POSITION ONLY

6 Found GLO B.C. 10" D. Fir N60° E 57.4' 12" Cedar S28° 30' E 19.8' 13" Hemlock N57° 30' W 21.8' (recorded as Fir) 24" Cedar N59° W 49.5' 5" Pine snag S27° W 18.5' 13" Hemlock S22° W 29.7'

7 Set 2½" Galv. iron pipe c 3" B.C. (marked as shown) in mound of stones Scribed - 8" D. Fir S30° W 20.4' "CN1/16 S 10 BT" 8" D. Fir N64° E 43.3' "CN 1/16 S10 BT" Each tree has B. Washer marked RLS 1005 nailed to lower face

8 Set 2½" Galv. iron pipe c 3" B.C. (marked as shown) in mound of stone Scribed - 22" Sugar Pine S30° E 84.5' "NE 1/16 S10 BT" 24" D. Fir N17° E 38.1' "NE 1/16 S10 BT" Each tree has B. washer marked RLS 1005 nailed to lower blaze.

9 Found 3/4" iron rod c misoriented 2½" Alum. Cap in rock mound (marked as shown) 12" Maple N12° 15' W 21.4' 32" D. Fir S36° 15' E 12.2' Good Scar (recorded 21.2') Per M 37-18 ACCESSORY TIES ARE TO MONUMENT TRUE CORNER BEARS S79° 24' W 2.09

10 Set 2½" Galv. iron pipe with 3" B.C. (marked as shown) in rock mound. Found - 10" W. Fir N38° E 42' Good Scar (record is Hemlock) 20" Cedar N78° W 17.9' "¼ S9 C.S. BT" 8" Cedar Snag N40° W 46.2' "¼ S9 BT"

11 Set 2½" Galv. iron pipe c 3" B.C. (marked as shown) in rock mound Scribed 10" Cedar N57° W 31' "C¼ S10 BT" 8" D. Fir N57° E 31' "C¼ S10 BT" each tree has Brass Washer marked RLS 1005 nailed to lower blaze.

12 Set 2½" Galv. iron pipe c 3" B.C. (marked as shown) in rock mound Scribed 8" D. Fir N57° E 30.1' "CE 1/16 S10 BT" 10" D. Fir S25° E 40.3' "CE 1/16 S10 BT" Each tree has B. Washer marked RLS 1005 nailed to lower blaze.

13 Found 3/4" iron rod c 2½" Alum. Cap (marked as shown) 32" D. Fir Snag N13° 30' W 12.1' Good Scar 8" Hemlock N31° 30' W 27.3' scribing vis. 10" W. Fir S50° E 38.6' scribing vis. 24" Fir stump S62° E 7.6' scribing vis.

14 Found 3/4" iron rod c 2½" Alum. Cap (marked as shown) 8" Yew S58° E 22.6' vis. scribes 10" Yew stump S7½° W 27' vis. scribes. Scribed - 24" W. Fir S11° W 19.7' "SW 1/16 S10 BT" SEE NOTE BELOW

15 Found 3/4" iron rod c 2½" Alum. Cap on East edge 26" Cedar Snag 10" Cedar S39½° E 30.3' vis. scribes. 12" Cedar stump S28½° W 19.8' vis. scribes. Scribed - 12" Madrone S66° E 48.6' "CS 1/16 S10 BT" TRUE CS 1/16 COR. LIES S33°00' W 1.85 FROM MONUMENT. SEE NOTE BELOW

16 Set 2½" Galv. iron pipe c 3" B.C. (marked as shown) in rock mound Scribed: 8" D. Fir N06° W 51.4' "SE 1/16 S10 BT" 14" Cedar N22° E 74.8 "SE 1/16 S10 BT" Found a 3/4" iron rod c 2½" Alum. cap which bears N72° 51' E 7.54' from true corner

17 NOT MONUMENTED CALCULATED POSITION ONLY

18 Found B.C. (marked as shown) 22" Sugar Pine N20° W 40.9' good scar 20" W. Fir N33° E 42.9' good scar 16" D. Fir S26½° W 26.4' good scar.

19 Found 3/4" iron rod c 2½" Alum. Cap (marked as shown) 10" D. Fir S12° W 41.2' scribes vis. 16" Cedar Snag S50° W 33' scribes vis. Scribed - 8" W. Fir N81° W 40.5' "T27S, R2W, S10 CC BT" 14" Maple S62° E 73.6' "T27S, R2W, S15 CC BT" SEE NOTE BELOW

20 Found 3/4" iron rod c 2½" Alum. Cap (marked as shown) Scribed: 8" Cedar S55° E 13.7' "W 1/16 S10 BT" 12" D. Fir N17° E 71' "W 1/16 S10 BT" Each tree has B. washer marked RLS 1005 nailed to lower blaze

21 Found 3/4" iron rod c 2½" Alum. Cap (marked as shown) 8" Cedar S5° E 30.1' vis. scribes Scribed - 26" D. Fir S77° E 2.5' "W 1/16 S15 BT" SEE NOTE BELOW

22 Found 3/4" iron rod c 2½" Alum. Cap (marked as shown) alongside original stone. 24" Cedar N55° W 29.4' vis. scribes vis. 28" D. Fir S3° W 9.1' good scar Scribed - 12" Cedar S47° W 10.7' "¼ S10 BT" nailed alum. washer to face.

23 SET: 2"x30" Galv. iron pipe c 3" Brass Cap (marked as shown) in rock mound Scribed: 14" Hemlock N57° W 9.3' "1/4 S15 BT" with brass washer "RLS 1005" nailed to lower blaze Found: 10" Douglas Fir S40° W 4.2 FT from true corner Found a 3/4" iron rod c 2½" Alum. Cap which bears S74° W 3.65 FT from true corner

24 Set 2½" Galv. iron pipe with 3" B.C. (marked as shown) in rock mound. Found - 3/4" iron rod 2½" Alum Cap S86° 36' E 7.96' 12" Maple N21° E 32' vis scribe 10" Hemlock N11° W 27.7' vis. scribes. SEE NOTE BELOW

25 True corner not monumented, accessory ties are to old monument found. Found 3/4" iron rod c 2½" Alum. Cap (marked as shown) 14" Cedar S4° W 22.9' vis. scribes. 22" Hemlock S7½° W 23' vis. scribes. True corner bears N6° 55' W 0.97 FT.

26 Found 2½" Alum. Cap, on 3/4" iron rod (marked as shown) 9" Madrone N26° E 24.6 vis scribes 11" D. Fir N19° W 34.1' good scar 12" Live Oak N59° W Rotted face, badly leaning 14" Fir Snag S40° E 35' vis scribes (original BT) 18" D. Fir Snag S28° W 33' good scar Scribed - 17" D. Fir S31° E 22.3' "T27S, R2W, S14, BT" 16" D. Fir S88° W 35' "T27S, R2W, S15, BT"

"I, Romanso E. Ware, a registered professional land surveyor in the State of Oregon, hereby certify that this plat and the notes hereon, or attached, are a correct representation of a survey I performed during March, 1978 to June, 1978, for the U.S. Forest Service, in accordance with the statutes of the State of Oregon and with the Articles of my contract."

Romanso E. Ware
Registered Professional Land Surveyor
Oregon License No. 1005

NOTES: LINES POSTED ARE BETWEEN MONUMENTS AS FOUND OR SET. NEW MONUMENTS WERE SET, IN ACCORDANCE WITH PROVISIONS OF THE CONTRACT, AT TRUE CORNER LOCATIONS ONLY WHERE INDICATED ON THIS PLAT. ACCESSORY TIES ARE TO NEW MONUMENT SET AT TRUE CORNER LOCATION. ALL NEW BEARING TREES SCRIBED IN THIS SURVEY ARE MARKED WITH A BRASS OR ALUMINUM WASHER STAMPED "RLS 1005" NAILED TO THE LOWER BLAZE OF THE TREE.

FIELD BOOK - SEC. 10 GLIDE SURVEY NO. - 6 CONTRACT NO. - 006810N

COUNTY SURVEYORS FILE DATA
DO NOT REMOVE FROM OFFICE