

PRIMARY CORNER DESCRIPTION Sec Cor for 25 & 36 only (East)

Alias	Description
Alias	Description
Alias	Description
Alias	Description

GLO Survey by Henry L. Chandler, U.S. Deputy Surveyor, under Contract #705, dated April 19, 1899 - (DCSO records Vol. 1 Page(s) 270)

The cor. of secs. 25 & 36, established on former survey*, which is a Fir 12" dia., mkd. T19S S36 on SW.; and R10W S25 on NW. sides, with 1 groove on S. and 5 grooves on N. sides; from which

A Fir 18" dia., bears S.83°W., 71 lks. dist. mkd. T19S R10W S36 BT.


A Fir 18" dia., bears N.3½°W., 6 lks. dist. mkd. T19S R10W S25 BT.

(* 1899 survey is a corrective resurvey of Chandler's 1895 survey. The Orig. 1895 survey was not accepted but some corners were accepted on a case by case basis. Per Eugene's & Coos Bay's BLM offices.)

Douglas Co. Surveyors Office - Godfrey and crew - Sept. 29, 1964 - C.S. File 53/66-42

Found - 28" D.Fir, shows good scars.
40" D.Fir N.3½°W., 4.0 ft., shows good scars.
38" Hemlock S.83°W., 46.9 ft., opened and found good reverse scribing.

Set Brass cap at base of corner tree (S.E. side) and mkd:
County Surveyors Office

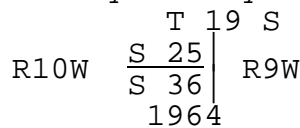

Blaze and rescribe:
40" D.Fir N.3½°W., 4.0 ft. mkd. T19S R10W S25 CS BT
38" Hemlock S.83°W., 46.9 ft. mkd. T19S R10W S36 CS BT.

Fd. OK, March 27, 1980 by E. Alvarado - C.S. File 61/6-17

Ernesto Alvarado, U.S. Forest Service, Deputized by DCSO - Wit: Elwin Price - Sept. 1982 - C.S. File 59/30

REFERENCED OUT DUE TO LOGGING IN AREA.
Found - Corner tree, 28" D.Fir, uprooted.
Brass cap on root wad.
38" Hemlock, uprooted.
40" D.Fir, uprooted.
Set at corner point, 5 ft. steel post 1½ ft. above ground.
Brass cap placed alongside.
(Cont. Next Page)

PRIMARY CORNER DESCRIPTION Sec Cor for 25 & 36 only (East)

Alias	Description
Alias	Description
Alias	Description
Alias	Description

New Accessories:

- 38" Hemlock to rootwad, bears N.87°W., 33.6 ft. Up-rooted Hemlock, determined center of tree. At location, set 5 ft. steel post, bears S.82°W., 47.0 ft.
- 38" Hemlock stump bears S.74°W., 47.3 ft. R.P. 8" x 3/8" nail. Brg. & dist. to top of nail head.
- 36" Hemlock stump bears S.41°W., 45.5 ft. R.P. 8" x 3/8" nail. Brg. & dst. to top of nail head.
- Referenced point: 43" Hemlock snag, bears N.71°E., 73.7 ft. 8" x 3/8" nail. Brg. & dist. to top of nail head.
- Uprooted 28" D.Fir bears N.23°E., 19.3 ft., to rootwad. Original corner tree.
- 40" uprooted D.Fir bears N.2°E., 24.1 ft., to rootwad.

Location: Go up F.S. Rd. #23 approx. 5.0 miles to location poster on N. side of road. From poster, go N. 10 chs. to corner which lies on N. face.

Ernesto R. Alvarado, U.S. Forest Service, Deputized by DCSO -Wit: David Braley; Jennifer Hawks - May 7, 1984 - C.S. File 62/15-14

Found - The corner tree is uprooted with brass cap at the base of tree, on the rootwad. In Sept. 1982, I referenced out the cor. point from the uprooted cor. tree and uprooted BTs., so that the area could be logged. My reference point is S.11°E., 4.6 ft. from the center of the root hole.

- Both BTs uprooted.
- 40" D.Fir, uprooted, bears N.0½°W., 19.6 ft., to center of rootwad.
- 38" Hemlock, uprooted, bears S.86½°W., 48.7 ft., to center of rootwad.

RESET old 1964 DCSO brass cap at center of root hole of the corner tree. Cap properly mkd. Corner tree root wad bears N.28 3/4°E., 15.2 ft. to center of root wad.

Used the same stumps for BTs as previously used for reference points. Set 3/8" steel rebar on center of all three stumps and an 8" x 3/8" nail facing the corner. Brgs. & Dists. are to the center rebar of the stumps.

- New BTs- 43" Hemlock stump bears N.78 3/4°E., 77.5 ft. scribed CS BT.
- 36" Hemlock stump bears S.44°W., 50.5 ft. scribed T19S R10W S36 CS BT.
- 38" Hemlock stump bears S.75°W., 51.05 ft. scribed CS BT.

No stump available in section 25. (Cont. Next Page)

PRIMARY CORNER DESCRIPTION Sec. Cor. for 25 & 36 only (East)

Alias	Description
Alias	Description
Alias	Description
Alias	Description

Location: Go up Rd. #23 approx. 5 miles to location poster on section line post on S. side of road. Cor. lies N.1°E., 580 ft. on N. slope N. of landing in clearcut.

BLM Resurvey by Robert W. Dahl, Cadastral Surveyor, under Group #1450, surveyed Aug. 1988/May 1991 - (DCSO records Vol. 49 Page(s) 18751-52)

The Sec. Cor., perpetuated by Godfrey in 1964, also perpetuated by Alvarado in 1982, and remonumented by Alvarado in 1984, with an iron post 1½" dia., firmly set in the center of a root hole and in a collar of stone, projecting 8" above ground with brass cap mkd. in 1964, from which the original bearing trees:

A root hole bears S.83°W., 71 lks. dist., lying alongside is an uprooted Hemlock 38" dia., with old chop marks and illegible scribe marks visible on partially healed blaze. (Rec. Fir.)

A root hole bears N.3½°W., 6 lks. dist., lying alongside is an uprooted Fir stump 40" dia., with healed blaze. and the bearing trees mkd. by Alvarado

An iron rod, 3/8" dia., firmly set, projecting 6" from a Hemlock stump, 43" dia., 6 ft. high, bears N.74°55'E., 116.4 lks. dist., with scribe marks CS BT visible on unhealed blaze and a spike.

An Iron rod, 3/8" dia., firmly set, projecting 6" from a Hemlock stump 36" dia., 6 ft. high, bears S.40°15'W., 76.0 lks. dist., with scribe marks T19S R10W S36 CS BT visible on unhealed blaze and a spike.

An Iron rod, 3/8" dia., firmly set, projecting 12" from a Hemlock stump 38" dia., bears S.70°45'W., 77.0 lks. dist. with scribe marks CS BT visible on unhealed blaze and a spike.

Lying down the hill is the original corner tree, an uprooted Fir stump, 28" dia., with two healed blazes.

From this point, the United States Forest Service GPS Station No. 191036 bears S.41°30'20"W., 71.294 chs. dist., monumented with an iron rod, 5/8" dia., firmly set in concrete, flush with ground surface, with alum. cap mkd. GPS 191036 + 1988.