

PRIMARY CORNER DESCRIPTION Cor. Secs. 8, 9, 16, & 17


Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

GLO survey by Wm. P. Wright, Deputy Surveyor, under contract #486, dated Aug. 1, 1883 - (DCSO recs. Vol. 2 Page(s) 869)

Set post 6" dia., 4 ft. long on mound of rocks 18" high 5 ft. sq. at base for corner to secs. 8, 9, 16 & 17, marked T21S, S 9 on NE, R8W, S 16 on SE, S 17 on SW, S 8 on NW face with 4 notches on E & S edge.
No witness trees near.

BLM dependent resurvey by Norman D. Price, Cadastral Eng. & Geo. F. Rigby, Assoc. Cadastral Eng., under group #282, surveyed May/Aug. 1945 - (DCSO records Vol. 27 Page(s) 11409)

Proportional measurement
Set an iron post, 3 ft. long, 2" dia., 28" in the ground, for cor. of secs. 8, 9, 16, & 17, with brass cap marked:

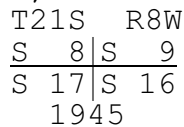

- from which
- A Fir, 70" dia., bears N.84½°E., 37 lks., mkd: T21S R8W S9 BT.
 - A dead Fir, 64" dia., bears S.6¼°E., 131 lks., mkd: T21S R8W S16 BT.
 - A Fir, 50" dia., bears S.31°45'W., 50 lks., mkd: T21S R8W S17 BT.
 - A Fir, 60" dia., bears N.83¼°W., 159 lks., mkd: T21S R8W S8 BT.

BLM remonumentation of certain orig. corner points by Wm. W. Glenn & James E. Jelley, Cadastral Surveyors, under group #s 350 & 635, surveyed April/May 1967 - (DCSO records C.S. File 65/27-1)

The cor. of secs. 8, 9, 16, & 17, monumented with an iron post, 2" dia., firmly set, projecting 6" above ground, with brass cap properly mkd, from which BTs mkd. in 1945

- A Fir stump, 70" dia., bears N.84½°E., 37 lks., no marks remaining on burned out blaze. Rescribed T21S R8W S9 BT on new blaze.
- A Fir stump, 64" dia., bears S.6¼°E., 131 lks., with healed blaze.
- A Fir stump, 50" dia., bears S.31°45'W., 50 lks., with healed blaze.
- A Fir stump, 60" dia., bears N.83¼°W., 159 lks., with healed blaze.

continued next page

TOWNSHIP 21 RANGE 08 POINT IDENTIFIER # 300500

PRIMARY CORNER DESCRIPTION Cor. Secs. 8, 9, 16, & 17

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

<p>and new BTs A Fir, 8" dia., bears S.46½°E., 142 lks., mkd: T21S R8W S16 BT. A Fir, 4" dia., bears S.60 3/4°W., 25 lks., mkd: T21S R8W S17 BT. A Fir, 10" dia., bears N.70 3/4°W., 118 lks., mkd: T21S R8W S8 BT.</p>
<p>Found OK by R. Rice, Oct. 2002 - M141-12</p>
<p>Found brass cap & 4 1945 BTs & 3 1967 BTs by Gary Smither, 2/2005 - C.S. File 65/54-7</p>
<p>Ronald L. Rice, Ward NW - Aug. 15, 2008 - C.S. File 65/63-29 ----- Found - 2½" brass cap (properly mkd) dated 1945 with the following accessories: 25" D.Fir bears N.70¾°W 77.9' - healed face 18" D.Fir bears S.60¾°W 16.5' - healed face 70" D.Fir stump bears N.84½°E., 24.4' - scribing visible 23"x4' D.Fir stump bears S.46½°E., 93.7' - healed face Note - Corner has steel T-post adjacent to it. All BTs have red painted bands and yellow tags.</p>
<p>Ronald L Rice - OCT. 2016 - Oxbow Timber 1 LLC - M172-76 ----- Found - 1967 BLM brass cap on fiberglass pipe, checked to confirm pipe is fiberglass (rec. iron pipe per 2009 BLM) with following accessories: Rotted D.Fir stump of indeterminate dia. bears N.57°W., 9.9', no mks. 34" D.Fir snag bears S.46½°W., 63.4', scribing visible. 18" D.Fir bears N.17½°E., 9.4', healed face. 7" D.Fir bears S.17°E., 1.9', healed face. 9" D.Fir bears S.69¾°W., 12.8', healed face. 12" D.Fir bears N.67½°W., 13.8', healed face. Steel post adjacent to corner.</p>
<p> </p>