

PRIMARY CORNER DESCRIPTION N NW Cor Abel Fryer DLC #47

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

Surveys of Donation Land Claims by - Dennis Hathorn, Deputy, dated Sept. 1856

Set post NW cor. Claim 47, from which
 A Fir 30" dia., bears S.7°E., 105 lks.
 A Fir 9" dia., bears S.60°W., 18 lks.

F. C. Frear, Deputy Co. Surveyor - Wit: Chas. Clements and S.B. Soloman - Sept. 1917 - Vol. 3 Page 1 and Field Book 43 Page 14


Renew from old BTs.
 Set in 1" x 24" Iron pipe, from which
 A 50" Fir bears S.7°E., 1.05 chs. Old tree.
 A 38" Fir bears S.60°W., 0.18 chs. Old tree.
 A 24" Fir bears N.51°W., 0.13 chs. Old tree (?)

BLM resurvey by Floyd A. Brooks and James E. Jelley, Cadastral Surveyors, under Group #'s 514 and 350, surveyed June 1963/March 1965 (DCSO records Vol. 33 Page(s) 13734-35)

The NW cor. of Claim No. 47, perpetuated and recorded by Frear in 1917, monumented with an iron pipe, 1½" dia., 8" above ground, firmly set, from which the original bearing trees:

A sawed Fir stump 50" dia., bears S.7°E., 105 lks. dist., with a healed blaze.
 A forked Fir 45" dia., bears S.75°W., 18 lks. dist., with a healed blaze. (Rec brg. S.60°W.)
 and a bearing tree mkd. by Frear,
 A Fir 30" dia., bears N.40°W., 15 lks. dist., with a healed blaze.

At the corner point
 Set an iron post, 28" long, 2 1/2" dia., 24" in the ground, with brass cap mkd: T 22 S R 8 W

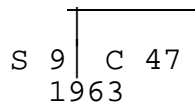

from which a new bearing tree,
 A Fir 9" dia., bears S.77½°E., 74 lks. dist., mkd. T22S R8W C47 BT.
 Reset the iron pipe alongside the iron post.

Douglas Co. Surveyors Office - John M. Powell, and crew - Dec. 28, 1970 - C.S. File 52/14-141

(Cont. Next Page)

PRIMARY CORNER DESCRIPTION N NW Cor Abel Fryer DLC #47

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

Found - 9" now 11" W.Fir S.77½°E., 48.8ft., shows good scar.
45" now 45" forked D.Fir S.75°W., 11.9 ft., shows good scar.

30" now 35" D.Fir N.40°W., 9.9 ft., shows scar.

Found I.P. set by Frear lying on surface of ground.

By using metal location finder, found 1963 Cadastral

brass cap T 22 S R 8 W

S 9 | S 47

1963

This cap buried under 10" of soil, apparently disturbed by errant cat skinner during logging operation.

RESET brass cap at proper location with I.P. alongside.

This corner lies on top of ridge, running SE about 150 ft.

North of log landing.

Douglas Co. Surveyors Office - Stephen Flause and T.R. Franssen, crew - Aug. 6, 1991 - C.S. File 64/17-3

Found - A rusted and bent 22" long 1½" O.D. I.P. found out of ground and out of position approx. S.33°W., 31 ft. dist. from cor. Location determined from found BTs. I.P. monument described by Frear as 1½" x 24". Found monument and missing monument probably disturbed by road work to nearby clear-cut.

Orig. Fir 30" dia., now a rotted 40" dia. 36" tall Fir stump with no scribing or face evident; bears S.07°E., 69.3 ft. (As per record)

Orig. Fir 9" now forked Fir 45" DBH with a fully healed blaze, bears S.75°W., 11.9 ft. (agrees w/BLM and subsequent renewals) (Orig. rec. S.60°W., 11.9 ft.)

Possible evidence of a 24" Fir, later call a Fir 30" dia., in BLM resurvey, now a broken rotted 30" dia. 36" tall Fir stump with no blazes or scribing found, bears N.45°W., 9.9 ft. (BLM resurvey rec. N.40°W., 9.9 ft. (Frear BT)

A 9" Fir now a 36" dia. 12" tall Fir stump with the possible remains of a partial lower blaze, bears S.77½°E., 48.8 ft. as per record. (1963 BT)

At location determined by intersecting distance measurements from found BTs as noted - Set a 2 3/8" dia. brass cap on a

1¼" O.D. 31" long I.P. mkd. Douglas County Surveyors Office

T 22 S R 8 W

S 9 |
1991

(Cont. Next Page)

PRIMARY CORNER DESCRIPTION N NW Cor Abel Fryer DLC #47

Alias	Description
Alias	Description
Alias	Description
Alias	Description

I.P. is firmly set, protruding approx. 6" above the ground. The found 1½" I.P. is set on the South edge of the B.C. monument and protrudes 4" above ground.
New BTs -A 4" DBH D.Fir scribed "X BT" on a double blaze, bears N.80°E., 28.1 ft. dist.
A 5" DBH D.Fir scribed "T22S R8W C 47 CS BT" on a double blaze, bears S.34°W., 53.2 ft. dist.
Corner is located approx. 320 ft. southerly along spur road from BLM Rd. #22-8-9.1, at edge of older reprod. unit on wide bench and near edge of recent clear-cut unit.

Found OK by Roberts, Jan. 1997 - M 126-32

Dependent resurvey by Edith M Forkner, Cadastral Surveyor, under Group #2180 & 2300, surveyed May/Oct. 2007 (DCSO records Vol. 56 Page(s) 22233-4)

The N-NW cor. of DLC 47, in sec. 9, perpetuated by Frear in 1917, remonumented by Brooks and Jelley in 1963-65, found disturbed and reset by the Douglas County Surveyor's Office in 1970 and further perpetuated by the Douglas County Surveyor's Office in 1991; monumented with an iron post, 1½" dia., firmly set, projecting 6" above ground, with brass cap (properly) mkd.

from which the remains of the original bearing trees

A decayed fir stump, size indeterminate, bears S.7°E., 69.3 ft., no marks visible.

A double fir, 49" dia., bears S.75°W., 11.9 ft., with a healed blaze and axe marks X at breast height.

and the remains of a bearing tree mkd. by Frear and reported by Brooks and Jelley

A decayed fir stump, size indeterminate, bears N.40°W., 9.9 ft., no marks visible.

and the bearing trees mkd. by the Douglas County Surveyor's Office in 1991

A fir, 11" dia., bears N.79¾°E., 27.8 ft., with a healed blaze.

A fir, 12" dia., bears S.33¾°W., 53.2 ft., with a healed blaze.

The Frear iron pipe, 1½" dia., firmly set, projecting 4" above ground, with bent top, reset by the Douglas County Surveyor's Office in 1991, and a steel fence post are alongside the cor.

Corner is located on a broad spur, slopes S.45°E., in the NW. cor. of fir reproduction, edge bears S. and E., and S., 10 ft. from an overgrown dirt spur road, 8 ft. wide, extending N.45°W. and S.45°E., 20 ft. from the end of the road.