

PRIMARY CORNER DESCRIPTION E. NE Cor. Rufus Butler DLC #48

Alias 049020 Description SW Cor. Andrew Sawyer DLC #49
Alias 058030 Description NW Cor. S.F. Chadwick DLC #58
Alias _____ Description _____
Alias _____ Description _____

Surveys of Donation Land Claims by - Dennis Hathorn, Deputy,
dated Sept. 1856

Set post NE cor. Claim 48, from which
A Fir 10" dia., bears N.33°W., 50 lks.
An Oak 10" dia., bears N.18°E., 37 lks.

Survey by A. R. Evans - For: Bernau and Sawyer - Jan. 1951 -
C.S. File 44/78 and M 10-62

Determined from original BT:
D.Fir N.33°W., 50 lks., rescribe this tree which is 24"
dia.
Set 3/4" Iron rod for corner.
Blaze and scribed new BT:
12" Chinquapin S.58°W., 22.0 ft. mkd. N.W. Cl. 49 CS BT.

Douglas Co. Surveyors Office - James Byron, Deputy and crew
-For: Oregon State Game Commission - April 4, 1962 - C.S.
File 52/119

Found - 3/4" I.Pipe at corner and BTs as recorded by Evans.
Chinquapin now dead.
New BTs -12" R.Fir bears S.33°E., 59.4 ft. scribed N.W. Cl.
58 CS BT.
Rescribe now 28" R.Fir N.33°W., 33.0 ft. mkd "S.W.
DLC 49 CS BT"

BLM resurvey by Floyd A. Brooks and James E. Jelley,
Cadastral Surveyors, under Group #'s 514 and 350, surveyed
June 1963/March 1965 (DCSO records Vol. 33 Page(s) 13710)

The cor. of Claims 48, 49 and 58, in the SW¹/₄ of sec. 7. The
claim cor. has been remonumented with a steel rod, 3/4" dia.,
4" above ground, firmly set, from which the remaining
original bearing tree,
A Fir 28" dia., bears N.33°W., 50 lks. dist., with no
marks remaining on opened and burned blaze. The tree
was reblazed by Byron in 1962 alongside the original
blaze, and is marked SW CL 49 CS BT.
a bearing tree mkd. by Evans in 1951,
A dead Chinquapin 10" dia., bears S.58°W., 33 lks. dist.,
with no marks remaining on opened and burned blaze.
a bearing tree mkd. by Byron in 1962,
A Fir 13" dia., bears S.36°E., 90 lks. dist., with a
healed blaze.
and a bearing tree not of record,
(Cont. Next Page)

TOWNSHIP 22 RANGE 08 POINT IDENTIFIER # 048010


PRIMARY CORNER DESCRIPTION E. NE Cor. R. Butler DLC #48

Alias 049020 Description SW Cor. A. Sawyer DLC #49
Alias 058030 Description NW Cor. S. Chadwick DLC #58
Alias _____ Description _____
Alias _____ Description _____

A burned Fir stump 12" dia., bears S.49°W., 48 lks. dist., with scribe marks BT C48 CS visible on opened and burned blaze.

At the corner point

Set an iron post, 28" long, 2 1/2" dia., 21" in the ground, with brass cap mkd:

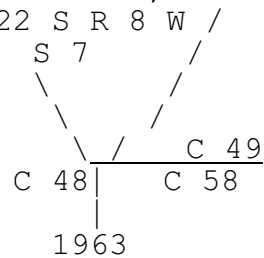

Reset steel rod alongside iron post.

Fd. B.C., August 1992, by Donald Bentz, 1992-0082
Fd. OK by D. Edwards, Feb. 2000 - M134-20

BLM remonumentation by Aaron M Graham, Cadastral Surveyor and Michael Jones Surveying Technician under Group #2199 surveyed April 2008/April 2009 - (DCSO rec. Vol. 56 Pages 21947-8)

The cor. of DLC Nos. 48, 49, and 58, in the SW ¼ of sec. 7, remonumented by Brooks and Jelley in 1963-65; monumented with an iron post, 2½" dia., firmly set, projecting 10" above ground, with a brass cap (properly) mkd.

from which an original bearing tree

A fir, 37" dia., bears N.33°W., 31.3 ft., with a healed blaze. (Record, 33.0 ft.)

and a bearing tree mkd. by Byron in 1958 and reported by Brooks and Jelley in 1963-65

A fir, 26" dia., bears S.36°E., 59.4 ft., with a healed blaze.

An iron rod, 3/4" dia., projecting 6" above ground, reset alongside the cor. by Brooks and Jelley in 1963-65, is alongside the cor.