

PRIMARY CORNER DESCRIPTION Sec. Cor. for 13 & 24; 18 & 19, T22-7

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____


GLO survey by Gordon and Gardner, under Contract #52 dated Feb. 17, 1855 (DCSO records Vol. 4 Page(s) 1500-01)

-----  
 Set post cor. of secs. 13, 24, 18 and 19, from which  
 A B.Oak 30" dia., bears S.53°E., 48 lks. dist.  
 A B.Oak 20" dia., bears N.44°W., 73 lks. dist.  
 A B.Oak 20" dia., bears S.51°W., 84 lks. dist.  
 A W.Oak 20" dia., bears N.30°E., 53 lks. dist.

BLM resurvey by Jack W. Bowder, Cadastral Surveyor, under Group #928, surveyed July/Aug. 1977 (DCSO records Vol. 40 Page(s) 16016-17)

-----  
 The cor. of secs. 13, 18, 19 and 24, on the W. bdy. of Tp., (T22-7) at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 28" long, 2½" dia., 24" in the ground, with brass cap mkd:

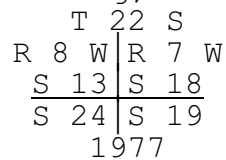

from which

- A Fir 5" dia., bears N.64½°E., 82 lks. dist. mkd. X BT.
- A Fir 5" dia., bears S.21 3/4°E., 45 lks. dist. mkd. T22S R7W S19 BT.
- A Fir 5" dia., bears S.44¼°W., 57½ lks. dist. mkd. T22S R8W S24 BT.
- A Fir 12" dia., bears N.12½°W., 77½ lks. dist. mkd. T22S R8W S13 BT.

Found OK by M. Smalley, Dec. 2000 - M132-59  
 FD. BC by Marshal Wagstaff, ODOT - 12/2006

Daniel Baker - For: Eagle View Management Co. Inc. - 1/2020 - M177-28A-C

-----  
 Found - 3¼" BLM BRASS CAP "1977"  
 22" Fir, N.64°E., 45.7' to side/center- (M132-59  
           rec. N.64½°E., 45.7')  
 18" Fir, S.22°E., 29.7' to side/center- (M132-59  
           rec. S.21¾°E., 29.7')  
 15" Fir, S.44°W., 38.0' to side/center- (M132-59  
           rec. S.44¼°W., 38.0')  
 30" Fir, N.12°W., 51.2' to side/center- (M132-59  
           rec. N.12½°W., 51.2')