

PRIMARY CORNER DESCRIPTION Cor. Secs. 14, 15, 22, & 23

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

Original - Gordon & Gardner, Contract #52 dated Feb. 1855 (DCSO records Vol. 7 Page(s) 3037)

-
- A B.Oak, 15" dia., bears N.88°W., 100 lks.
 - A B.Oak, 12" dia., bears S.75°W., 148 lks.
 - A B.Oak, 18" dia., bears S.13°E., 233 lks.
 - A W.Oak, 24" dia., bears N.4°E., 634 lks.


BLM Resurvey by C. Albert White & Norman J. McDonald, Cadastral Surveyors, under Group #'s 243, 350, & 513, surveyed April/July 1963 - (DCSO records Vol. 32 Page(s) 13470-71)

The cor. is determined by chaining approx. rec. bearings from known corners to the north & west, and pinpointed at rec. dist. from the stump hole of each of the orig. BTs:

- Oak stump hole, bears N.4°E., 634 lks.
- Oak stump hole, bears S.11°E., 233 lks.
- Oak stump hole, bears S.69°W., 148 lks.
- Oak stump hole, bears N.89°W., 100 lks.

At the corner point

Set an iron post, 28" long, 2½" dia., 24" in the ground, with brass cap mkd:

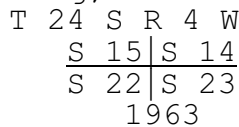

from which new bearing trees:

- A Fir, 14" dia., bears N.74°E., 88 lks.
- An Oak, 12" dia., bears S.86½°E., 116 lks.
- A Cedar, 24" dia., bears N.41°W., 654 lks.

There is no bearing tree available within limits in Sec.22 From this point the SE cor. of Claim #46 bears S.88°W., 4.50 chs. mkd. by a corner of fences extending N. & W. (Rec. N.89°30'W., 4.53 chs.)

Fd. & used in BLM dependent resurvey by James E. Jelly, Cadastral Surveyor, under Group #979, surveyed May/Sept. 1979 (DCSO records Vol. 42 Page(s) 16381)

Fd. Ok by D. Bentz - 8/90, M 112-11.

Douglas Co. Surveyors Office - Stephen J Flause - Mike Koch - 3/4/2015 - C.S. File 67/42-15

Found - 1963 BLM 3¼" dia., brass cap (properly mkd) on a 2½" I.D. iron pipe firmly set protruding 3" above ground.

continued next page

TOWNSHIP 24 RANGE 04 POINT IDENTIFIER # 500400

PRIMARY CORNER DESCRIPTION Cor. Secs. 14, 15, 22, & 23

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

Orig. BT stump-holes fd in 1963 were not looked for, land has since been machine cleared and is regrowth with heavy brush.

A fir 14" dia., now a 28" dia., 2 ft. tall Fir stump showing a healed blaze which is opened to find the scribing "WS14 BT"; bears N.73¼°E., 58.1 ft (record N.74°E., 58.1 ft.) 1963

A cedar, 14" dia., now a 41" dia., x 3 ft. tall I.Cedar sawed stump, showing a healed blaze; bears N.41°W., 431.6 ft. (as per record) 1963

We find BC monument for ESE corner of DLC 46 to be West 299.0 ft. (rec. N.89½°W., 299.0 ft.)

Round 6" fence corner post SW 0.7' - fences north & East.

New - A 15" dia. D.Fir scribed "T24 R4 S14" "CSBT" on a double blaze; bears N.80°E., 39.2 ft.

A 13" dia. D.Fir scribed "T24 R4 S22 CS" "BT" on a double blaze; bears S.34½°W., 103.4 ft.

Note - Corner monument is near bottom of shallow South coursing draw in open fir woodland with scattered cedar and madrone.

Compass decl. 15¼°E.