

PRIMARY CORNER DESCRIPTION Sec. Cor. for 4 & 5; 32 & 33, T23-6

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

Original - Robert Elder and Henry Gile, Deputy Surveyors, under Contract #31 dated April 7, 1853 (DCSO records Vol. 6 Page(s) 2389)

Set post cor. to secs. 4, 5, 32 and 33, from which
A Fir 20" dia., bears N.76°E., 27 lks.
A Fir 20" dia., bears S.33°E., 29 lks.
A Fir 16" dia., bears S.30°W., 60 lks.
A Cedar 18" dia., bears N.42°W., 40 lks.

GLO survey by William R. Whipple, Deputy Surveyor, under Contract #577, dated July 18, 1891 (DCSO records Vol. 8 Page(s) 3180 and 3181-82)

All traces of cor. and bearing trees to secs. 4, 5, 32 and 33, having been destroyed by forest fires. (I proceed to reestablish same by re-running Tp. line.)
Cut cross on sand stone bed rock for sec. cor, mkd. 33 on NE.; 4 on SE.; 5 on SW.; and 32 on NW. with 6 notches on the South and 4 notches on the East thus $\frac{32|32}{5|4}$ from which
A Laurel 5" dia., bears N.11°15'E., 26½ lks. dist., mkd. T23S R6W S33 BT.
A Fir 7" dia., bears S.77°40'E., 44 lks. dist., mkd. T24S R6W S4 BT.
A Laurel 4" dia., bears S.34°30'W., 15 lks. dist., mkd. T24S R6W S5 BT.
A cross cut in bed rock on SE slope, bears N.54°W., 4 lks. dist., mkd. B O thus: $\frac{B|O}{|}$

BLM resurvey by Otis Gould, Joseph Gawron, and Orville Eggen, Cadastral Surveyors, under Group #244, surveyed June 1943/October 1957 (DCSO records Vol. 30 Page(s) 12646-47)

Point for the sec. cor., at proportionate distance; there is no remaining evidence of the original corner.
Set an iron post 30" long, 2" dia., 5" in the ground, to solid rock, and in a mound of stone, 4 ft. base, to top, with brass cap mkd:
T23SR6W
 $\frac{S32|S33}{S 5|S 4}$
T24S
1957

from which
A Fir 16" dia., bears N.38°E., 47 lks. dist., mkd. T23S R6W S33 BT.
(Cont. Next Page)

PRIMARY CORNER DESCRIPTION Sec. Cor. for 4 & 5; 32 & 33, T23-6


Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____

- A Fir 11" dia., bears S.17½°E., 60 lks. dist., mkd. T24S R6W S4 BT.
- A Fir 18" dia., bears S.85°W., 50 lks. dist., mkd. T24S R6W S5 BT.
- A Fir 16" dia., bears N.27½°W., 31 lks. dist., mkd. T23S R6W S32 BT.

BLM Corrective Dependent Resurvey by Wayne L. Rogers; Boyd W. Peterson; Philip G. Griffin; Dale T. Bedell; Cadastral Surveyors; and Robert H. Browning, Surveying Technician - under Group #'s 1266, 1637 and 1688, - surveyed June 9, 1986/August 22, 1995 - (DCSO records Vol. 51 Pages 19449-50)

Point for the cor. of secs. 4, 5, 32, and 33 at proportionate distance; there is no remaining evidence of the original corner.

Set a stainless steel post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone, with brass cap mkd.

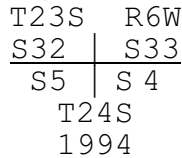

from which bearing trees mkd. by Gould, Gawron, and Eggen
 A fir, 22 ins. diam., bears N. 78 3/4° E., 19 lks. dist., with healed blaze.

A fir, 15 ins. diam., bears S. 4½° E., 92 lks. dist., with healed blaze.

A fir, 25 ins. diam., bears S. 58° W., 70 lks. dist., with healed blaze.

and a new bearing tree

A cedar, 8 ins. diam., bears N. 14° W., 45 lks. dist., mkd. T23S R6W S32 BT.

Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.

The corner is located on steep SE. slope.

From this point, the cor. of secs. 4, 5, 32, and 33, erroneously reestablished by Gould, Gawron, and Eggen in 1943-57, bears S. 16° 57' 30" W., 0.357 chs. dist.; monumented with an iron post, 2 ins. diam., firmly set, projecting 8 ins. above a mound of stone, 2½ ft. base, 1 ft. high, with brass cap marked and witnessed as described in the official record, except the NW. bearing tree is now a snag. Amended the marks on the brass cap to read AM 1994 1957, reset the monument, inverted, and obliterated the marks on the NW. bearing tree snag.

continued next page

Alias	Description
Alias	Description
Alias	Description
Alias	Description

Robert Ward - Ron Rice & Josh Reed, crew - June 2010 - C.S. File 65/69-26

Found - BLM Brass Cap (properly marked) dated 1994 with the following Accessories:
24" Fir bears N.78¼°E., 12.5' healed face.
15" Fir bears S.4½°E., 60.7' healed face.
27" Fir bears S.58°W., 46.2' healed face.
12" Cedar bears N.14°W., 29.7' visible scribing.

Ken Hoffine - For: Lone Rock Timber Co. - G. Angiolet & I. Roman - Sept. 2016 - C.S. File 65/93-54

Found - 1994 BLM brass cap (properly mkd)
BT 1 - 25" D.Fir bears N.78¼°E., 12.5 ft. (Record N.78¼°W., 12.5 ft.) Healed face and tag.
BT 2 - 15" D.Fir bears S.7¼°E., 60.8 ft. (Record S.4½°E., 60.7 ft.) Healed face and tag.
BT 3 - 28" D.Fir bears S.55°W., 46.3 ft. (Record S.58°W., 46.2 ft.) Healed face and tag.
12" Cedar at record bearing of N.14°W., 29.7 ft. is standing we did not measure as tree is behind small rock bluff.
1957 erroneous pipe bent and with no cap bears S.16°57'30"W., 23.17 ft. (Record S.16°57'30"W., 23.562 ft.)

New - IR 1 - 5/8"x40" Iron rod with Orange Plastic Cap marked Lone Rock Timber PLS 2291 bears S.39°45'W., 131.68 ft.
IR 2 - 5/8"x40" Iron rod with Orange Plastic Cap marked Lone Rock Timber PLS 2291 bears N.16°34'E., 183.46 ft.
IR 3 - 5/8"x40" Iron rod with Orange Plastic Cap marked Lone Rock Timber PLS 2291 bears N.8°43'E., 239.64 ft.

Note - 8" Mag spike in root of BT bears N.59°12'E. 9.26 ft.
Due to upcoming logging we visited and provided additional references for the NWSC of section 4. The monument lies directly below the landing and yarder wedges, and may get disturbed by logging operations. We set three iron rods and a mag spike to reset the monument if necessary. The corner lies on steep southeast slope in small rock bluff. Piled stones over top of monument to protect it.

continued next page

Alias	Description
Alias	Description
Alias	Description
Alias	Description

Ken Hoffine - For: Lone Rock Timber Co. - G. Angiolet & I. Roman - 11/2017 - C.S. File 65/99-29

Referenced out

- Found - 1994 BLM brass cap (properly mkd)
- BT 1 25" Doug. Fir Stump 2 ft. Tall Bears N.78¼°E., 12.5 ft. (Record N.78¼°W., 12.5 ft.) We cover with metal roofing.
 - BT 2 15" Doug. Fir stump bears S.7¼°E., 60.8 ft. (record S.4½°E., 60.7 ft.) Cut below scribe, we cover with metal roofing.
 - BT 3 28" Doug. Fir stump bears S.55°W., 46.3 ft. (record S.58°W., 46.2 ft.) Cut below scribing, we cover with metal roofing.
 - 12" Cedar 3 ft. tall stump at record bearing of N.14°W., 29.7 ft. is standing we did not measure as tree is behind small rock bluff. We cover with metal roofing
 - 1957 erroneous pipe bent and with no cap bears S.16°57'30"W., 23.17 ft. (Record S.16°57'30"W., 23.56 ft.)
 - IR 1 5/8"x40" iron rod with orange plastic cap bears S.39°45'W., 131.68 ft. as per record put U-Post alongside
 - IR 2 5/8"x40" iron rod with orange plastic cap bears N.16°34'E., 183.46 ft. as per record put U-Post alongside
 - IR 3 5/8"x40" iron rod with orange plastic cap bears N.8°43'E., 239.64' ft. as per record put U-Post alongside
 - 8" Mag spike in root of BT bears N.59°12'E., 9.26 ft.

Note - After logging we visited the NWSC of sec. 4 to check condition of corner and cover BT stumps with metal roofing material. The monument lies directly below the landing and in yarder wedge, we found corner in good condition. We installed a U-Post alongside corner as the record post was destroyed by logging. We also installed U-Posts alongside each of the reference rods.