


PRIMARY CORNER DESCRIPTION CE 1/16 Sec. 5

Alias	Description
Alias	Description
Alias	Description
Alias	Description

BLM Resurvey by C. Albert White, Cadastral Surveyor and Donald R. Beck, Surveying Technician, Under Group #515, Surveyed June/Oct. 1963 - (DCSO records Vol. 32 Page(s) 13488)

Point for the center E 1/16 sec. cor. of sec. 5
Set an iron post, 28" long, 2½" dia., 23" in the ground, with brass cap marked:

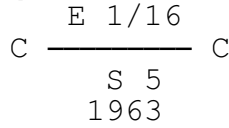

from which

- A fir, 12" dia., bears N.1½°E., 28 lks. mkd: CE 1/16 S5 BT
- A fir, 14" dia. bears S.47¼°W., 61 lks. mkd: CE 1/16 S5 BT

Douglas Co. Surveyors Office - Stephen J Flaue - Mike Koch - 9/2/2014 - C.S. File 67/41-59

Found - The orig. 1963 monument, a 3¼" dia., brass cap (properly mkd) on a 2" I.D. iron pipe, set plumb protruding 6" above ground.

OBTs - A fir, 12" dia., now a sawed rotting 26" dia., 2½ ft. tall D.Fir stump with a fully healed single blaze; bears N.1½°E., 18.5 ft. (as per rec.)

A fir, 14" dia., now a D.Fir 32" in dia., with the blaze marks no longer visible; bears S.47¼°W., 42.0 ft. (rec. S.47¼°W., 40.3 ft.)

New - A G.Fir, 10" dia., scribed "CE 1/16 S5 CS" "BT" on a double blaze; bears S.12°E., 16.2 ft.

Note - Monument is on gentle west slope SW quadrant is very old fir reprod. Pasture to east and clear-cut in NW quadrant. A dirt road is ~ 37 ft. (East per sketch) and an E-W running wire fence is 2½ ft. south.

Compass decl. 15½°E.