

TOWNSHIP 30 RANGE 08 POINT IDENTIFIER # 340500

PRIMARY CORNER DESCRIPTION (WC) 1/4 Cor. Secs. 9 & 16

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

GLO survey by W.H. Byars under contract #456, dated July 28, 1882 - (DCSO records Vol. 17 Page(s) 7350)

Set a cedar post 3 ft. long, 3" sq., 18" in the ground, for 1/4 sec. cor., marked 1/4 S on North face; from which
A cedar, 28" dia., bears N.28°W., 18 lks., mkd: 1/4 S BT.
A cedar, 36" dia., bears S.68°W., 46 lks., mkd: 1/4 S BT.

Douglas Co. Surveyors Office - Vernon "Ray" Tracy - Mike Darby & Jack Barnett - Sept. 1964 - C.S. File 53/67-57

Found - Cedar stub N.28°W., 11.9 ft. no scribe.
40" now 36" cedar, laying in creek bottom, shows partial scribe & axe marks on what is left of overgrowth. This tree fell & slid into creek, hole S.68°W., approx. 30 ft.
Set brass cap at cor. mkd: COUNTY SURVEYORS T30S R8W 1/4 S 9
OFFICE 1964 S16
New BTs- 20" cedar N.11°W., 41.4 ft. mkd: 1/4 S9 CS BT.
40" cedar S.85°E., 26.4 ft. mkd: 1/4 S16 CS BT.
Note - This corner lies on the west side of small creek 7.0 ft. East.

BLM resurvey by George M. Winter, Cadastral Surveyor, under Group No. 2698, surveyed April 2013/Feb. 2014 - (DCSO records Vol. 58 page(s) 23155)

Point for the 1/4 sec. cor. of secs. 9 and 16, perpetuated by the Douglas County Surveyor's Office in 1964-65, determined at distance-distance intersection from the remains of an original bearing tree and bearing trees mkd. by the Douglas County Surveyor's Office (there is no remaining evidence of the monument set by the Douglas County Surveyor's Office), and is located in an area of unstable ground where it is impractical to establish a permanent monument. Not monumented.
from which the remains of an original bearing tree
A cedar slab, projecting 4 1/2 ft. above ground, bears N.21°W., 11.9 ft., with no marks visible. (Record, N.28°W.)
and BTs mkd. by the Douglas County Surveyor's Office
A cedar, 51" dia., bears S.86 1/2°E., 26.4 ft., with scribe marks BT visible on a partially healed double blaze.
A cedar, 26" dia., bears N.10 1/2°W., 41.4 ft., with a healed blaze.


continued next page

TOWNSHIP 30 RANGE 08 POINT IDENTIFIER # 340500

PRIMARY CORNER DESCRIPTION 1/4 Cor. Secs. 9 & 16

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

From the true point, the point selected for an offline witness cor. to the 1/4 sec. cor. of secs. 9 and 16 bears N.53°43'47"E., 48.16 ft.; set a stainless steel post, 28" long, 2 1/2" dia., 25" in the ground, with brass cap mkd.

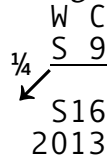

Deposit a magnet in a white plastic case at the base of the stainless steel post.

The true point for the cor. is located on downed cedar trunk, 26" dia., straddling a creek, 5 ft. wide, course N.45°W.

Brent Knapp - Crew: N. Fromdahl, J. Ogden, & W. Keady - 6/12/2024 - C.S. file 65/113-37

Found - 2013 BLM Brass cap (properly mkd)
28" Cedar, N.75°W., 48.1'; with healed scar
54" Cedar, S.23°W., 32.4'; with healed double blaze
RR Spike in log, S.54°W., 48.1'
Broken Cedar Slab, S.67 1/2°W., 48.0'
New - 10" Fir, S.68 1/2°W., 46.4'; Scribed "1/4 S9 BT
Note - Compass decl. 15°E.