


PRIMARY CORNER DESCRIPTION CC for Secs. 15 & 22 (West)

Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____

GLO survey by Fred Mensch, US Cadastral Engineer - Under special instructions dated June 7, 1922 - (DCSO records Vol. 18 Page(s) 7541)

 Point of intersection of line bet. secs. 15 & 22, determined as hereinafter described.

Set an iron post, 3 ft. long, 2" dia., 28" in the ground, for closing cor. of secs. 15 & 22, with brass cap marked

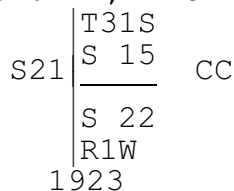

from which

A fir, 30" dia., bears N.35°E., 33 lks., mkd: T31S R1W S15
 CC BT.

A fir, 36" dia., bears S.55°E., 7 lks., mkd: T31S R1W S22
 CC BT.

Douglas Co. Surveyors Office - John M. Powell - Frank Jones & W. Penley - Aug/Sept. 1968 - C.S. File 54/71-114

Found - GLO brass cap properly marked in 1923.
 30" D.Fir, now stump, N.35°E., 21.8 ft. shows good scar.

Set - 36" D.Fir, now stump, S.55°E., 4.6 ft.
 3/4" IR in top of 34" D.Fir stump N.35°E., 22.7 ft
 3/4" IR in top of 38" D.Fir stump S.55°E., 4.1 ft.

Note - This corner lies in clear out area 46.2 ft. S of corner of secs. 16 & 21.

Douglas Co. Surveyors Office - Dennis Gaylord, Deputy DCS & USFS - Roland Simshauser - Dec. 8, 1977 - C.S. File 59/42-24

Found - 1923 GLO brass cap properly stamped, pipe loose in ground & leaning badly.

3/4" Iron rod in top of orig. 34" BP stump bears N.35°E., 22.7 ft. Stump has well healed scar.

3/4" I.R. in top of orig. 38" BT stump bears S.55°E., 4.1 ft. Stump has a well healed scar.

Set - Using the 3/4" I. Rods set by Powell for reference, I re-set the brass cap & placed a mound of stone around the monument.

No new accessories available.