

PRIMARY CORNER DESCRIPTION CC Secs. 16 & 21, East

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____


GLO survey by Dennis Hathorn, US Deputy Surveyor, contract 73 dated June 8, 1857 - (DCSO Records Vol. 18 Page(s) 7467

-
- Set post, cor. secs. 15, 16, 21 and 22, from which
- A fir, 15" dia., bears N.37°E., 40 lks.
 - A fir, 6" dia., bears S.80°E., 32 lks.
 - A fir, 9" dia., bears S.70°W., 25 lks.
 - A fir, 36" dia., bears N.45°W., 4 lks.

GLO survey by Fred Mensch, US Cadastral Engineer - Under special instructions dated June 7, 1922 - (DCSO records Vol. 18 Page(s) 7541-2)

-
- The cor. established for secs. 15, 16, 21 and 22, which is a badly decayed fir post, with marks still legible; from which
- A fir, 24" dia., bears N.37°E., 40 lks., mkd. T31S R1W S15 BT. (Old BT)
 - A fir, 15" dia., bears S.80°E., 32 lks., mkd. T31S R1W S22 BT. (Old BT)
 - A fir, 16" dia., bears S.5°W., 45 lks., mkd. T31S R1W S21 BT. (New BT)
 - A fir, 40" dia., bears N.45°W., 4 lks., mkd. T31S R1W S16 BT. (Old BT)

The original BT in sec. 21 is dead and fallen.
 I now change this cor., to refer to secs. 16 and 21 only, and obliterate the marks on the BTs referring to secs. 15 and 22. In place of the decayed post.
 Set an iron post, 3 ft. long, 2" dia., 28" in the ground, for cor. of secs. 16 & 21 only, with brass cap mkd

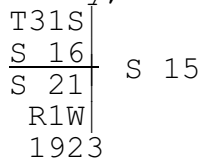

Douglas Co. Surveyors Office - John M. Powell & Vernon "Ray" Tracy - Aug. 1968 - C.S. File 54/71-115

-
- Found - 1923 GLO brass cap, in place.
 40" D.Fir, now stump, N.45°W., 2.6 ft., shows good scar.
 16" D.Fir, now stump, S.5°W., 29.7 ft., shows good scar.
- Set - Area to the west & south clear cut, therefore:
 ¾" iron rod in top of orig. 43" D.Fir stump N.45°W., 3.7 ft.
 ¾" iron rod in top of orig. 19" D.Fir stump S.5°W., 29.5 ft. continued next page

TOWNSHIP 31 RANGE 01 POINT IDENTIFIER # 400401

PRIMARY CORNER DESCRIPTION CC Secs. 16 & 21, East

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

New BT - 28" D.Fir N.40°E., 27.6 ft. scribed "T31S R1W S15 CS BT"

Note - This corner lies 46.2 ft. north of CC secs. 15 & 22, and 15' S of old road.

Loyd R. Moffit - For: USFS - Jan. 1986 - C.S. File 62/30-44

Found - A 2½" brass cap on a 1¼" iron pipe in small rock mound. (1922 GLO)

32" fir bears N.40°E., 27.6 ft. scribe visible.

16" fir stump with 5/8" rebar in top bears S.05°W., 29.6 ft. scar visible.

40" fir stump with 5/8" rebar in top bears N.45°W., 2.6 ft. scar visible.

Note - No live trees for BTs available in NW quad.

New BT- Since there are no live trees available in the northwest quadrant I marked a 8" Pine BT which bears S.24°W., 7.1 ft. from the corner, scribed T31S R1W S21 BT. Nailed LS 944 brass washer to BT scribe.